
Form 3160-5 (June 2015)		UNITED STATES PARTMENT OF THE D	NTERIOR ^{IN}	M OIL CONS ARTESIA		OMB NO	APPROVED 0. 1004-0137 nuary 31, 2018
	SUNDRY	UREAU OF LAND MANA	RTS ON WI	ELLS SEP 18		5. Lease Serial No. NMNM81622	
	Do not use thi abandoned wel	s form for proposals to II. Use form 3160-3 (AP	drill or to re D) for such p	enter an proposals.		6. If Indian, Allottee of	r Tribe Name
<u> </u>	SUBMIT IN 1	TRIPLICATE - Other inst	tructions on	page 2	VED	7. If Unit or CA/Agree	ment, Name and/or No.
1. Type of Well	Gas Well Oth	1er				8. Well Name and No. GOLD RUSH 30 F	EDERAL 2
2. Name of Opera COG OPER	ator RATING LLC	Contact: E-Mail: Abbym@b		NTGOMERY es.com		 API Well No. 30-015-29747-0 	0-S1
3a. Address 600 W ILLIN MIDLAND,	NOIS AVENUE TX 79701		3b. Phone No Ph: 432-58	. (include area code) 0-7161		10. Field and Pool or F NASH DRAW	Exploratory Area
		., R., M., or Survey Description	ı)			11. County or Parish, S	State
Sec 30 T23	S R30E SWSE 43	0FSL 1750FEL				EDDY COUNTY	΄, ΝΜ
12.	CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA
TYPE OF S	SUBMISSION						
Notice of	Intent	🗖 Acidize	🗖 Dee	pen	Product	ion (Start/Resume)	□ Water Shut-Off
_		Alter Casing	🗖 Hyd	lraulic Fracturing	🗖 Reclam	ation	Well Integrity
Subsequer	nt Report	🗖 Casing Repair		v Construction	🗖 Recomp		Other
🗖 Final Aba	ndonment Notice	Change Plans		g and Abandon		arily Abandon	
		Convert to Injection	🗖 Plu	g Back	U Water I	Disposal	
Attach the Bor following com testing has bee determined tha 1. Set 5 1/2	nd under which the wor pletion of the involved en completed. Final Al at the site is ready for f 2" CIBP @ 6585'.	ally or recomplete horizontally, rk will be performed or provide l operations. If the operation re pandonment Notices must be fi inal inspection. Circulate hole w/ MLF. Sp D-5690. (Brushy Canyon)	e the Bond No. o esults in a multip led only after all pot 25 sx cem	n file with BLM/BIA le completion or reco requirements, includ	A. Required su completion in a si ling reclamatio	bsequent reports must be new interval, a Form 316 n, have been completed a	filed within 30 days 0-4 must be filed once
 Spot 30 Cut & P0 Spot 155 Spot 650 	sx cement @ 4250 OH 5 1/2" csg. @ + 5 sx cement @ 332	0-4090. (Cherrý Canýon) ⊦/- 2820'. 25-2770'. Tag (Shoe, Bell 70-300. Can be in stages	(Canvon)				
8. Cut off w	vellhead and weld	on Dry Hole Marker.	RECL/	MATION PROCE Attached		EE ATTACHE ONDITIONS	D FOR OF APPROVAL
14. I hereby certi Name(Printed		Electronic Submission #	OPERATING L	LC. sent to the Ca	arlsbad n 07/20/2017		or record
	(Typea) ADIGAIL I			HUE AGENT		opted	<u>G</u>
Signature	(Electronic S	Submission)		Date 07/18/2	017	VCCED VIV	
		THIS SPACE FO		L OR STATE	OFFICE U	SE	Z
Approved By	banes (Comos_		Title S	AET	/	9:14-17 Date
certify that the appl		d. Approval of this notice does uitable title to those rights in th act operations thereon.		Office CF	-0		
Title 18 U.S.C. Sec States any false, f	tion 1001 and Title 43 ictitious or fraudulent s	U.S.C. Section 1212, make it a statements or representations as	crime for any p s to any matter w	erson knowingly and ithin its jurisdiction.	willfully to m	ake to any department or	agency of the United
(Instructions on pag	re 2)	ISED ** BLM REVISE				D ** BLM REVISE	D **

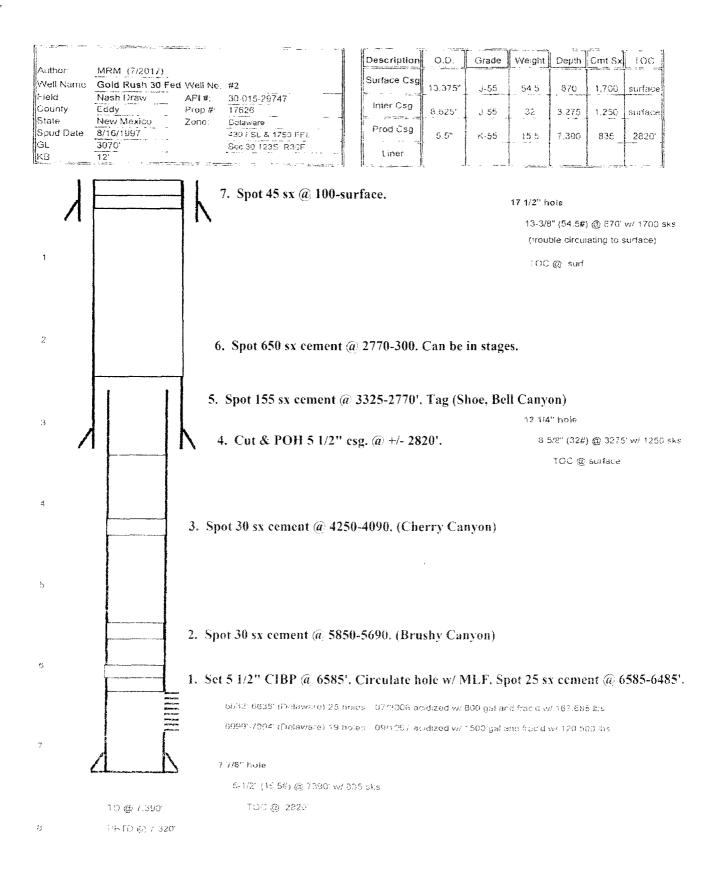

	<u></u>			Description	0.D.	Grade	Weight	Depth	Cmt Sx	TOC			
ithor: ell Name	MRM (7/2017) Gold Rush 30	Fed Well No.		Surface Csg	13.375"	J-55	54.5	670	1,700	surface			
eld ounty	Nash Draw Eddy	- ·	30-015-29747 17626	Inter Csg	8.625"	J-55	32	3,275	1.250	surface			
ate ud Date	New Mexico 8/16/1997	Zone:	Delaware 430 FSL & 1750 FEL	Prod Csg	5.5"	K-55	15.5	7,390	835	2820'			
- }	3070' 12'	-	Sec 30 T23S R30E	Liner		<u> </u>							
Х			17 1/2" hole 13-3/8" (54.5#) @ 670' v TOC @ surf	v/ 1700 sks (troub	le circulat	ing to surf	ace)	, '	fro	~ č	309	, g	15 8 P
										75	a/4	1	
			12 1/4" hole 8-5/8" (32#) @ 3275' w/ TOC @ surface	1250 sks						₽/s	alt	17	80
			7 7/8" hole 5-1/2" (15.5#) @ 7390' v	w/ 835 sks						De	ſ	33	.7& <i>7034</i> 7/24
			TOC @ 2820'							100	ing	22	7034
1	1	IN		Tbg and BH					1/2016	R			7/24
				2 7/8 NEW E				T 6,958.	55.	0-	-		/
				2- JTS OF 2 2 7/8 x 4' SL									
				2 7/8 NEW I				392.33.					a.
				19- JTS OF	2 7/8 j55.	591.12.							
				2 7/8 x 5 1/2	NEW TA	C 2.87. H	ANGING /	AT 6,300	.41.				
				200- JTS OI	F 2 7/8 J5	5. 6,220.8	4.						
		bernster: Brwwnet Enstaats Letter at	6632'-6638' (Delaware) 25			· ·							
			6999'-7094' (Delaware) 19	holes - 09/1997 a	icidized w	/ 1500 gai	and frac'd	d w/ 120,	500 lbs	,			

TD @ 7,390' PB⊺D @ 7,320'

8 PBTD @

32 86 1A 20

,

ya em 89.23

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

NM OIL CONSERVATION ARTESIA DISTRICT

SEP 1 8 2017

Permanent Abandonment of Federal Wells RECEIVED Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

.

ŝ

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

١

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.