Form 3160-5 (June 2015)

# **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

RECEIVED

OCT 1 2 2018

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMNM83037

SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such preposals. II-ARTESIA O.C.						NMNM83037				
						Indian, Allottee or	Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.					
1. Type of Well ☐ Oil Well ☐ Gas Well ☐ Other					8. Well Name and No. JONES CANYON 4 FED 8					
Name of Operator Contact: DAVID STEWART OXY USA WTP LIMITED PTNRSHIP E-Mail: david_stewart@oxy.com					9. API Well No. 30-015-32292-00-S1					
			(include area code 5-5717	10. Field and Pool or Exploratory Area INDIAN BASIN-UPPER PENN ASSOC						
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State					
Sec 4 T22S R24E SESE 1150FSL 943FEL					EDDY COUNTY, NM					
12. CHECK THE AP	PROPRIATE BOX(ES)	TO INDICA	ΓE NATURE O	F NOTICE,	REP	ORT, OR OTH	ER DATA			
TYPE OF SUBMISSION TYPE OF ACTION										
☐ Notice of Intent	☐ Acidize	☐ Deep	en	☐ Product	ction (Start/Resume)		■ Water Shut-Off			
☑ Subsequent Report	☐ Alter Casing	☐ Hyd	draulic Fracturing 🔲 Re		nation		■ Well Integrity			
_ , .	Casing Repair	_	Construction	☐ Recomp			☐ Other	Other		
☐ Final Abandonment Notice	☐ Change Plans ☐ Convert to Injection	☑ Plug ☐ Plug	and Abandon	☐ Tempor☐ Water I	rarily Abandon					
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandoment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.  Well was plugged 6/29/18, when crew arrived to cut-off and install P&A marker, they noticed gas migrating up 9-5/8" casing. Notified James Amos and Jim Hughes with the BLM & rec approval to re-enter well and re-plug.  7/17/18 - MIRU PU, NU BOP  Accepted for record - NMOCD  7/18/18 - RU reverse unit, power swivel. PU 6-1/8" bit, NU stripper head, drill out cement to 90', circ clean, PUH, SI.  7/19/18 - Csg PSI-0#. Continue drilling to 264', circ clean, PUH, SI.  7/19/18 - PU swivel, continue drilling @ 264', fall out of cement @ 895'. RIH & tag cmt @ 1640'.										
Electronic Submission #435552 verified by the BLM Well Information For OXY USA WTP LIMITED PTNRSHIP, sent to the Carlsbac Committed to AFMSS for processing by DEBO RAH MCKINNEY on 09/17/2018 Name (Printed/Typed) DAVID STEWART Title SR. REGULATORY					d 3 (18D	LM0710SE)				
Signature (Electronic S	ubmission)		Date 09/17/2	018			<u> </u>			
	THIS SPACE FO	R FEDERA	L OR STATE	OFFICE U	E(	EPTED FO	R RECO	)RD		
Approved By			Title			0.000	Date			
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office			SEP 18	2018 			
Fitle 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make Blany department of the Company of the Compan								<b>Vil</b> ted		

#### Additional data for EC transaction #435552 that would not fit on the form

#### 32. Additional remarks, continued

PUH, SI.


7/24/18 - Tbg/Csg PSI-0#. RU swivel, start drilling out @ 1640', fall out of cement @ 1860', PUH, SI

7/25/18 - RIH & tag @ 2792', circ well w/ BW, POOH. RIH w/ WL to 2792', run CBL from 2792'-surface.

7/27/18 - RIH w/ tbg to 1845', M&P 40sx Cl C cmt, PUH, WOC. RIH & tag cmt @ 1604', POOH. RIH & perf @ 835', EIR @ 3bpm @ 600# w/ returns to surface.

7/30/18 - RIH & set pkr @ 618', EIR @ 3bpm @ 0# w/ full returns to surface on the 7" X 9-5/8" csg. M&P 150sx CL C cmt, circ cmt to surface on 7" X 9-5/8" csg. SI WOC.

7/31/18 - Check PSI, well dead, no sign of gas, visually confirm cmt to surface on 7" X 9-5/8" csg. RIH & tag cmt @ 681', POOH, LD pkr. RIH to 259', M&P 50sx CI C cmt, circ to surface. POOH & top off csg w/ cmt. NDBOP, RDPU.

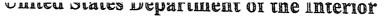



### **BUREAU OF LAND MANAGEMENT**

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

## Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
  Operations must include adequate measures for stabilization and reclamation of disturbed lands.
  Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
  process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612