Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED

7. If Unit or CA/Agreement, Name and/or No.

	OMB NO. 1004-0137 Expires: January 31, 20
5.	Lease Serial No.


SUNDRY N	OTICES AND REPORTS ON WELLS	
Oo not use this	form for proposals to drill or to re-enter a	n


abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name

NMNM94839

SUBMIT IN 1	RIPLICATE - Other instructio	ns on page 2	7. If Unit or CA/Agreement, Name and/or No.				
1. Type of Well Gas Well Oth	er		8. V	8. Well Name and No. ORACLE 21 FEDERAL 4			
2. Name of Operator		A EYLER RO-RES.COM		API Well No. 30-015-38597-00)-S1		
3a. Address 600 N MARIENFELD STE 600 MIDLAND, TX 79703	3b. P	hone No. (include area code) 432-687-3033		10. Field and Pool or Exploratory Area WILDCAT			
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)		11.	11. County or Parish, State			
Sec 21 T25S R36E NENW 40 32.121839 N Lat, 104.299911		,	1	EDDY COUNTY, NM			
12. CHECK THE AF	PROPRIATE BOX(ES) TO IN	DICATE NATURE OF	NOTICE, REI	PORT, OR OTH	ER DATA		
TYPE OF SUBMISSION		TYPE OF	TYPE OF ACTION				
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)		☐ Water Shut-Off		
_	☐ Alter Casing	☐ Hydraulic Fracturing	□ Reclamation		■ Well Integrity		
☐ Subsequent Report	□ Casing Repair	■ New Construction	□ Recomplete		Other		
☐ Final Abandonment Notice	□ Change Plans	🛛 Plug and Abandon	□ Temporarily	Abandon			
	☐ Convert to Injection	□ Plug Back	■ Water Dispo	sal			
THE REQUIRED DISPOSAL,	66-5,316' (T/BSPG.). 16'-1,796'(T/DLWR., 9-5/8" CSI SXS.CMT. @ 498'-3'(13-3/8" C LHEAD 3' B.G.L.; WELD ON S' WE PLAN TO USE THE CLOS PER OCD RULE 19.15.17.	ED-LOOP SYSTEM W/	SEE ATTA(CHED FOR VS OF APP	DNTENTS TO		
14. I hereby certify that the foregoing is Comm Name (Printed/Typed) DAVID A	Electronic Submission #451680 For CIMAREX ENERGY C itted to AFMSS for processing by	OMBANY OF CO. Asset to	· the Carlahad *		EB 1 2 2019		
······································				DISTRICT	II-ARTESIA O.C.D.		
Signature (Electronic S	Submission)	Date 01/24/20)19				
	THIS SPACE FOR FE	DERAL OR STATE (OFFICE USE				
Approved By	1- Ce Anso.	Title S	167		2-9-19 Date		
Conditions of approval, if any, are attache certify that the applicant holds legal or equanich would entitle the applicant to condi-	itable title to those rights in the subject		0	 			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent			willfully to make to	any department or a	agency of the United		
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISED ** B	LM REVISED ** BLM	REVEED	中世界便用			

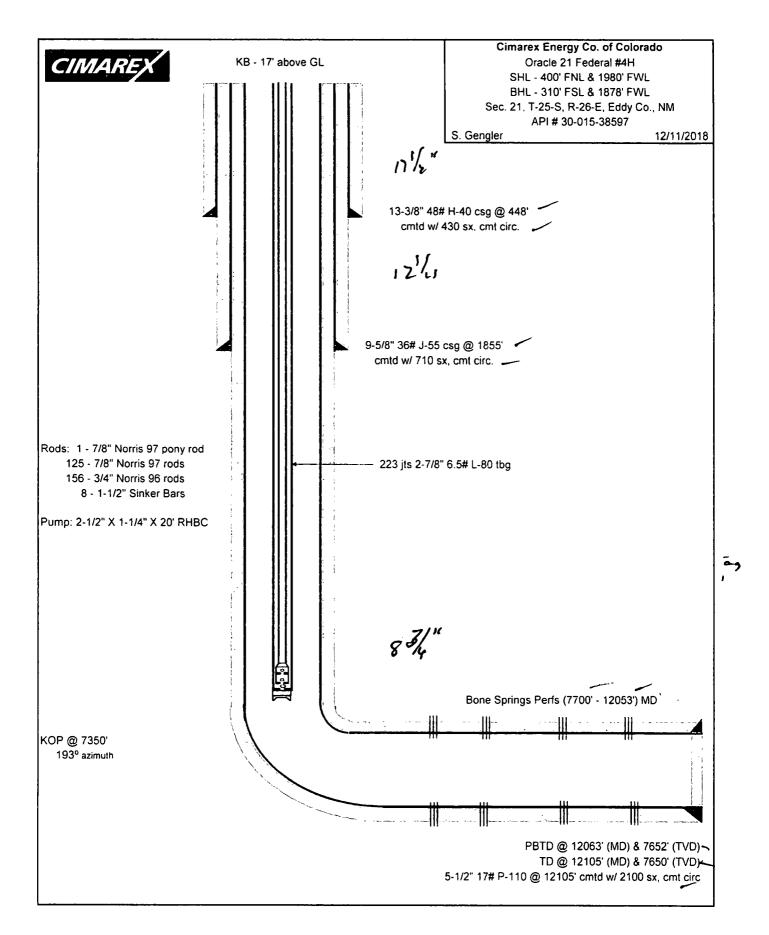

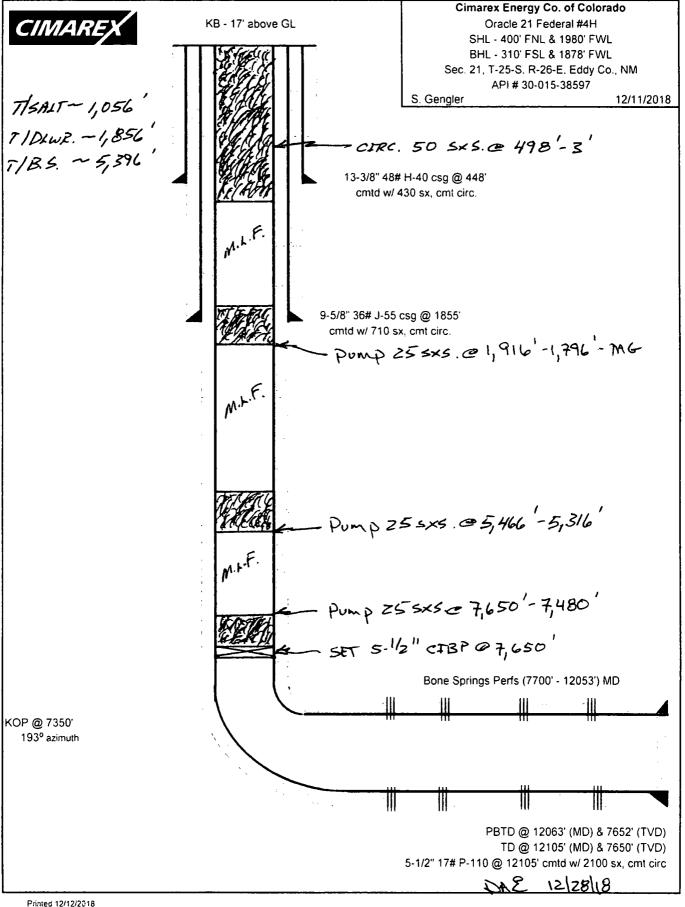

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.