Form 3160-5 (June 2015) •

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

**OCD** Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018


5. Lease Serial No. NMNM20965

SUNDRY NOTICES	AND F	REPORTS	ON WEL	LS.
----------------	-------	---------	--------	-----

Do not use this form for proposals to drill or to re-enter an

abandoned we	II. Use form 3160-3 (APD) for	such proposals.	6. If Indian, Allottee	or Tribe Name			
SUBMIT IN	TRIPLICATE - Other instructi	ons on page 2	7. If Unit or CA/Agr	eement, Name and/or No.			
1. Type of Well Gas Well Otl		8. Well Name and No. RDX FEDERAL 17 14					
Name of Operator WPX ENERGY PERMIAN LLC	9. API Well No. 30-015-39845-	9. API Well No. 30-015-39845-00-S1					
3a. Address 3500 ONE WILLIAMS CENTE TULSA, OK 74172	R MD 35 3b. Ph:	Phone No. (include area code) 539-573-3527	10. Field and Pool or BRUSHY DRA	Exploratory Area W-WOLFCAMP			
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)	<del>-</del>	11. County or Parish	11. County or Parish, State			
Sec 17 T26S R30E SWSE 99	EDDY COUNT	EDDY COUNTY, NM					
12. CHECK THE AI	PPROPRIATE BOX(ES) TO I	NDICATE NATURE OF	NOTICE, REPORT, OR OT	HER DATA			
TYPE OF SUBMISSION		TYPE OF	ACTION				
■ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off			
	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity			
☐ Subsequent Report	Casing Repair	■ New Construction	☐ Recomplete	Other			
☐ Final Abandonment Notice	Final Abandonment Notice		□ Temporarily Abandon				
•	☐ Convert to Injection	☐ Plug Back	■ Water Disposal				
Attach the Bond under which the wor following completion of the involved testing has been completed. Final Aldetermined that the site is ready for f WPX ENERGY PERMIAN, LL Please see the below for the procedure:  1. Set 5 1/2" CIBP @ 5412'. C2. Spot 25 sx cmt @5048-484 3. Spot 25 sx cmt @3483-326 4. Perf & Sqz 80 sx cmt @ 13 5. Perf & Sqz 50 sx cmt @ 15	C respectfully requests to P&A procedure, and the attached for 8'. WOC & Tag @4948' or abo 33'. WOC & Tag (9 5/8" Shoe 8 02-918'. WOC & Tag (T/Salt & 0'-Surface.  to surface, weld on Above Gro	and No. on file with BLM/BIA. In a multiple completion or record of after all requirements, including the above mentioned were the current and propose test csg. Spot 25 sx cmt ve. B B/Salt). 3533 13 3/8" Shoe).	Required subsequent reports must be impletion in a new interval, a Form 31 ng reclamation, have been completed in the impletion of the impleted in the implete	e filed within 30 days 60-4 must be filed once and the one ator has PECEWED  DEC 0 3 2019  COLARIESIAO.C.D  OR  APPROVAL			
, , ,	Electronic Submission #49227 For WPX ENERGY F itted to AFMSS for processing b	PERMIAN LLC, sent to the y DEBORAH MCKINNEY o	Carlsbad				
		1,2002	TOTAL TEOLETI				
Signature (Electronic S	Submission)	Date 11/13/20	019				
	THIS SPACE FOR F	EDERAL OR STATE (	OFFICE USE				
Approved By  Conditions of approval of any, are attache certify that the applicant holds legal or equivalent would entitle the applicant to conduct the applicant the app	uitable title to those rights in the subject operations thereon.	Office Cfo		//-/7-/9 Date			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent:	U.S.C. Section 1212, make it a crime statements or representations as to any	for any person knowingly and matter within its jurisdiction.	willfully to make to any department of	or agency of the United			

### CURRENT WELLBORE DIAGRAN

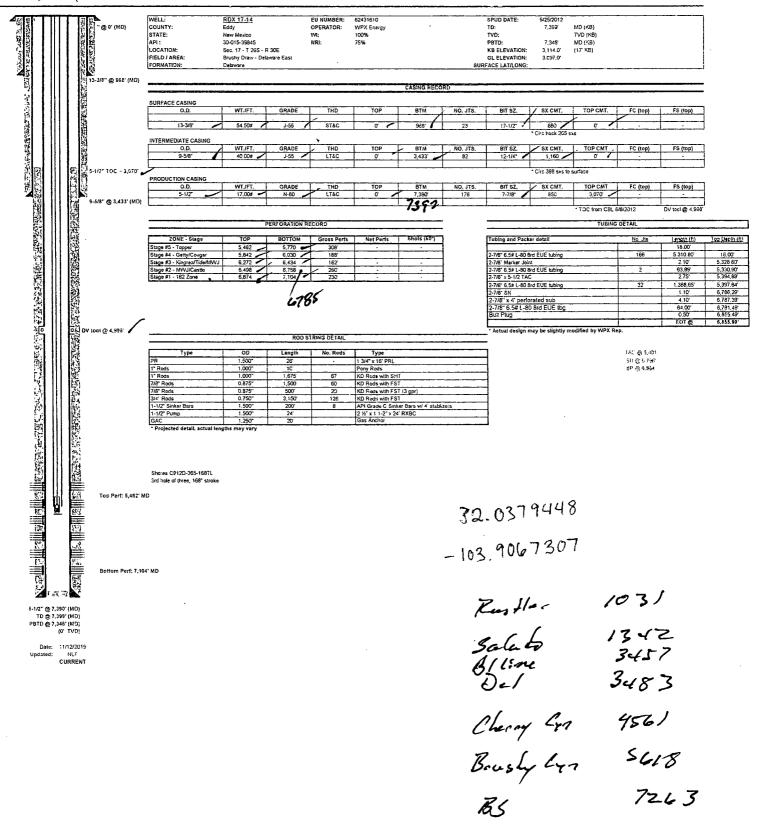

# WPXENERGY.

#### PROPOSED WELLBORE DIAGRAM

FROFOSED WELLBORE DIAGRAM								
WELL:	RDX 17-14	EU NUMBER:	62431610	SPUD DATE:	5/25/2012			
COUNTY:	Eddy	OPERATOR:	WPX Energy	TD:	7,399	MD (KB)		
STATE:	New Mexico	WI:	100%	TVD:		TVD (KB)		
API:	30-015-39845	NRI;	75%	PBTD:	7,346	MD (KB)		
LOCATION:	Sec. 17 - T 26S - R 30E			KB ELEVATION:	3,114.0	(17 <sup>-</sup> KB)		
FIELD / AREA:	Brushy Draw - Delaware East			GL ELEVATION:	3,097 0"			
FORMATION:	Delaware			SURFACE LAT/LONG:				

CASING RECORD											
ACE CASING											
O.D.	WT./FT.	GRADE	THD	TOP	втм	NO, JTS.	BIT SŽ.	SX CMT.	TOP CMT.	FC (top)	FS (top)
13-3/6*	54,50#	J-55	ST&C	0,	698.	23	17-1/2"	880	σ	-	<del> </del> -
RMEDIATE CASING									·		
O.D.	WT./FT.	GRADE	THD	TOP	втм	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	FC (top)	FS (top)
9-5/8*	40.00#	J-55	LT&C	G.	3,433'	82	12-1/4*	1,160	0,		-
DUCTION CASING		1				1	<u> </u>	1			
O.D.	. WTJFT.	GRADE	THD	TOP ,	ВТМ	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	FC (top)	FS (top)
5-1/2"	17.00#	N-80	LT&C	ď	7,390	176	7-7/8"	850	3,070		· · ·
z 50 sx cmt @	150'-Surface	11			l	<u> </u>	L		* TOC from CB!, 6	10/7012	DV tool @ 4,

5. Perf & Sqz 50 sx cmt @ 150'-Surface. 4. Perf & Sqz 80 sx cmt @ 1302-918'. WOC & Tag (T/Salt & 13 3/8" Shoe) A Transport of the Control of the Co 9-5/8" @ 3,433" (MD) 9-5/8" @ 3,433' (MD) 9-5/8" @ 3,433' (MD)
3. Spot 25 sx cmt @ 3483-3283'. WOC & Tag (9 5/8" Shoe & B/Sa 3. Spot 25 sx cmt @ 3483-3283'. WOC & Tag (9 5/8" Shoe & B/Salt) 1. Set 5 1/2" CIBP @ 5412'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 5412-5212'.

Top Perf @ 5462' MD

Bottom Perf @ 7104' MD

5-1/2" @ 7,390" (MD) TD @ 7,399" (MD) PBTE @ 7,346" (MD) (3" TVD)

Date: 11/12/2019
Updated: RLF
CURRENT

### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of get per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5 <u>Cement Requirement</u>. Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In heu of a coment plug across perforances in a cased hole 'not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforances shall be capped with 25 sacks of coment. If a bailer is used to cap this plug, 35 feet of coment shall be sufficient. Before pumping or bailing coment on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the coment may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8 <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.