


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

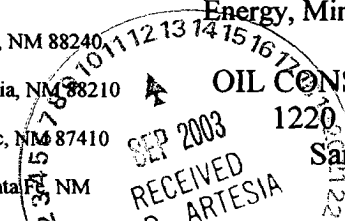

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30 005 63299
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 26826
7. Lease Name or Unit Agreement Name Willow Springs "15" State
8. Well Number 1
9. OGRID Number 149441
10. Pool name or Wildcat Pecos Slope Abo

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other

2. Name of Operator
Reliance Energy, Inc.

3. Address of Operator
6 Dista Drive, Suite 5500, Midland, Tx 79705

4. Well Location
Unit Letter **N** : **660** feet from the **South** line and **1980** feet from the **West** line
Section **15** Township **4S** Range **25E** NMPM County **Chaves**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3809' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Set CIBP @ 3600' w/ 35' cmt.
Spot 30 sx @ 2000' - 1900' - TAG
Cut & pull 1200' 5.5" casing
Spot 30 sx @ 1250' - 1150' - TAG
100' plug - 884' - 984' - TAG
Spot 25 sx @ 10# 60' - surface woc 24 HPS TAG
Salt gel mud consisting of 10#
Brine W/25# of gel per bbl
must be placed between each plug

934' - 11 3/4 CMC
1949' - 8 5/8 CMC
2975' - 5 1/2 TOC 1210'
Perfs - 3680 - 3880

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Laura Clapper TITLE Regulatory Analyst DATE 9-11-2003

Type or print name Laura Clapper E-mail address: lclapper@nmid.com Telephone No. 683-4816
(This space for State use)

APPROVED BY [Signature] TITLE Wild Rep DATE SEP 16 2003

Conditions of approval, if any: