Form 3 60-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD-ARTESIA

FORM APPROVED OMB NO. 1004-0135 Expires: November 30, 2000

5. Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELL	SUNDRY	NOTICES	AND	REPORTS	ON	WELL	.S
------------------------------------	--------	---------	-----	---------	----	------	----

Do not use this form for proposals to drill or to re-enter an

MAR 18 2008 NM-28172 OCD-ARTESIA If Indian, Allottee or Tribe Name

abandoned well. Use Forr						
SUBMIT IN TRIPLICATE -	7 If Unit or CA/Agreement, Name and/or No.					
1. Type of Well Oil Well X Gas Well Other 2 Name of Operator	8 Well Name and No Delta Federal #1					
OXY USA WTP Limited Partnership	192463	9. API Well No				
3a. Address P.O. Box 50250, Midland, TX 79710-	3b. Phone No (include area code) 0250 432 - 685 - 5717	30-015-23147				
4 Location of Well (Footage, Sec., T, R, M, or Survey L		10 Field and Pool, or Exploratory Area Sage Draw Wolfcamp				
1980 FNL 1980 FEL SWNE(G) Sec 7 T						
•		11. County or Parish, State				
		Eddy NM				
12. CHECK APPROPRIATE	BOX(ES) TO INDICATE NATURE OF NOTICE,	REPORT, OR OTHER DATA				
TYPE OF SUBMISSION	TYPE OF ACT	FION				
X Notice of Intent		duction (Start/Resume) Water Shut-Off				
Subsequent Report		lamation Well Integrity				
		ompleteOther				
Final Abandonment Notice		iporarily Abandon				
	Convert to Injection Plug Back Wat	er Disposal				
Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion in a new interval, a Form 3160-4 shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.) TD-11968' PBTD-9480' Perfs-9556-9564' CIBP -9480' TD-11968' PBTD-9480' Perfs-9556-9564' CIBP -9480' 10-3/4" 40.5# csg @ 1700' w/ 1450sx, 14-3/4" hole, TOC-Surf-Circ 7-5/8" 26.4-29.7# csg @ 9139' w/ 900sx, 9-1/2" hole, TOC-3485'-Calc 4" 18# csg @ 8535-11968' w/ 250sx, 6-1/4" hole, TOC-8535'-Calc 1. RIH & Tag CIBP @ 9480', M&P 25sx cmt to 9386' 929 D' 2. M&P 25sx cmt @ 9189-9089' WOC-Tag No Lower than 8999' (Tag Options) 3. M&P 25sx cmt @ 8585-8485' NOC- Tag No Lower than 8999' (Tag Options) 4. M&P 30sx cmt @ 6175-6075' GO15', 5. M&P 30sx cmt @ 5240-5140' GO9 D' 6 Perf @ 3390' sqz 50sx cmt to 3290' WOC-Tag No Lower than 3260' 7 Perf @ 1750' sqz 55sx cmt to 1650' WOC-Tag 8. Perf @ 300' sqz 150sx cmt to Surface 10# MLF between plugs ACCEPTION Repeated to the site of the si						
14 I hereby certify that the foregoing is true and correct Name (Printed/Typed)	ACCEPTED FOR RECORD					
David Stewart	Sr. Regulatory	AnalysAPPROVED				
In State	APR 9 - 1000 31,010	3				
Approved by THIS SPACE FOR FEDERAL OR STATE OFFICE USE MAR 1 5 2008 NMOCD-District II ARTESIA Date						
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. JAMES A. AMOS SUPERVISOR-EPS						

OXY USA WTP LP - Proposed Delta Federal #1 API No. 30-015-23147

150sx @ 300-Surface

55sx @ 1750-1650' WOC-Tag

50sx @ 3390-3290' WOC-Tag

30sx @ 5240-5140'

30sx @ 6175-6075'

25sx @ 8585-8485'


25sx @ 9189-9089' WOC-Tag

25sx @ 9480-9380'

11/05-CIBP @ 9480'

7/91-CIBP @ 9790' w/ 35' cmt

7/91-25sx cmt @ 10880-10584' 3/91-20sx cmt on pkr @ 11100' 12/90-16' cmt on pkr @ 11410'

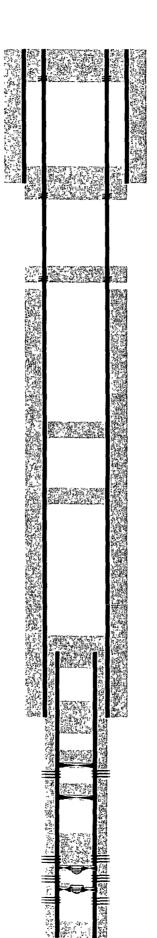

TD-11968'

Perf @ 300'

14-3/4" hole @ 1700' 10-3/4" csg @ 1700' w/1450sx-TOC-Surf-Circ

Perf @ 1750'

Perf @ 3390'

9-1/2" hole @ 9139' 7-5/8" csg @ 9139' w/900sx-TOC-3485'-Calc

Wolfcamp Perfs @ 9556-9564'

Atoka Perfs @ 10834-10866' Morrow Perfs @ 11333-354' Morrow Perfs @ 11496-11540'

> 6-1/4" hole @ 11968' 5" @ 8535-11968' w/250sx-TOC-8535'-Calc

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3: Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C" for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.