JUN -2 2010

FORM APPROVED OMB No 1004-0137 Expires March 31, 2007

UNITED STATE	9	NMOCD ANT		Expires Maich 31, 2007				
DEPARTMENT OF THE	INTER		ESIA	5 Lease Serial No. NM 108953				
BUREAU OF LAND MAI					or Trubo No			
APPLICATION FOR PERMIT TO	DRIL	L OR REENTER		6 If Indian, Allotee	of the Na	une		
Ia Type of work	ΓER			7 If Unit or CA Agre	eement, Nam	e and No	 • · α	
lb. Type of Well ☐ Oil Well ☐ Gas Well ☐ Other	[Single Zone Multip	ole Zone	8. Lease Name and COWICHAN		13	D D	
2 Name of Operator EOG Resources, Inc.	77)	one No. (include area code)		9 API Well No 30-015- 3 7	887	7		
3a. Address P.O. Box 2267 Midland, TX 79702		10 Field and Pool, or Cottonwood C		camp We	st			
4. Location of Well (Report location clearly and in accordance with a	any State ro	equirements *)		11 Sec, T R M or B	lk and Surve	ey or Area		
At surface 485' FEL & 610' FNL (U/L A) At proposed prod zone (660' FWL & 760' FNL (U/L D)		UNORTHO LOCATIO		Section 34, T1	6S-R24E, i	N.M.P.M.		
14 Distance in miles and direction from nearest town or post office* Approx 9.5 miles WNW of Artesia, NM				12 County or Parish Eddy	1	3 State NN	 ⁄1	
15 Distance from proposed* 485'	16 N	o of acres in lease	17 Spacin	g Unit dedicated to this	well			
property or lease line, ft (Also to nearest drig, unit line, if any)	640		N/2 S	Sec 34, T16S-R24E, N.M.P.M.				
18 Distance from proposed location* to nearest well, drilling, completed,	19 Pi	oposed Depth	BIA Bond No. on file					
applied for, on this lease, ft / 1633'	51,9	0'(TVD); 8677'(TMD)	2308					
21 Elevations (Show whether DF, KDB, RT, GL, etc.)	22 A	pproximate date work will sta	rt*	23 Estimated duration				
GL 3674.7'		06/01/2010		14				
,	24.	Attachments						
The following, completed in accordance with the requirements of Onsh-	ore Oil an	d Gas Order No 1, must be a	ttached to th	is form				
Well plat certified by a registered surveyor A Drilling Plan		4 Bond to cover the Item 20 above)	he operatio	ns unless covered by an	existing boi	nd on file ((see	
3 A Surface Use Plan (if the location is on National Forest System SUPO must be filed with the appropriate Forest Service Office)	n Lands,			ormation and/or plans as	s may be req	uired by th	ie	
25 Signature Am J. Muy		Name (Printed Typed)	Date					
Cha D. May		Donny G. Glanton			03/11/2010			
Title Sr. Lease Operations ROW Representative								
Approved by (Signature) /s/ Don Peterson		Name (Printed Typed)			Date MA'	Y 27	2010	
FIELD MANAGER		Office CARL	SBAD	FIELD OFF				
Application approval does not warrant or certify that the applicant ho	lds legal					plicantto		
conduct operations thereon. Conditions of approval, if any, are attached	x .	APPR	OVAL	FOR TWO	YEAR!	3	==	
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a		any person knowingly and v	willfully to n	nake to any department	or agency of	the Unite	d	

*(Instructions on page 2)

Form 3160-3 (February 2005)

ROSWELL CONTROLLED WATER BASIN

SEE ATTACHED FUR CONDITIONS OF APPROVAL

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED

District 1

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico

Energy, Minerals & Natural Resources Department

OIL CONSERVATION DIVISION 1220 South St. Francis Dr.

Santa Fe, NM 87505

Form C-102

Revised October 12, 2005

Submit to Appropriate District Office

State Lease- 4 Copies


Fee Lease-3 Copies

☐ AMENDED REPORT


WELL LOCATION AND ACREAGE DEDICATION PLAT Pool Code Pool Name API Number Cottonwood Creek Wolfemp West 30-015-Property Code Property Name Well Number 38183 COWICHAN 34 FED. 1HOGRID No. Operator Name Elevation 7377 EOG RESOURCES, INC. 3674.7'

Surface Location UL or lot no. Section Lot Idn Feet from the North/South line | Feet from the East/West line Township Range County NORTH A 34 16 SOUTH 24 EAST, N.M.P.M. 610 485 **EAST EDDY** Bottom Hole Location If Different From Surface UL or lot no. Section Lot Idn Feet from the North/South line Feet from the Township East/West line County D 760 NORTH 660 34 16 SOUTH 24 EAST, N.M.P.M. WEST **EDDY** Dedicated Acres Joint or Infill Consolidation Code Order No. 320

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the

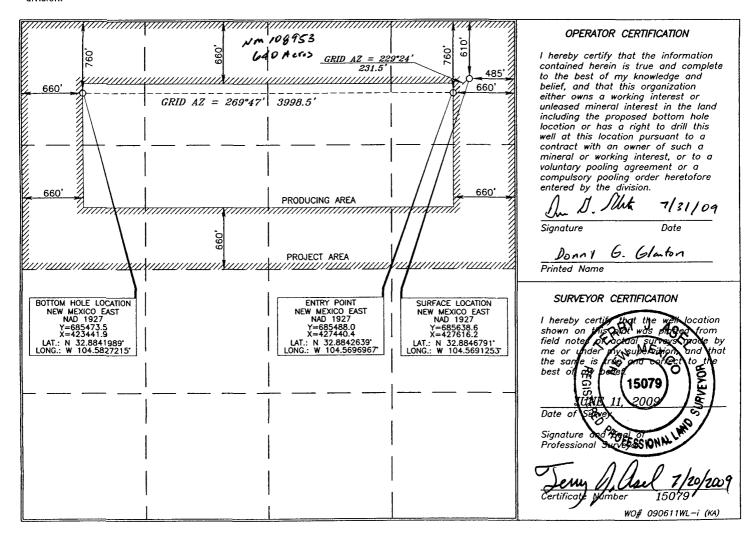

LOCATION VERIFICATION MAP

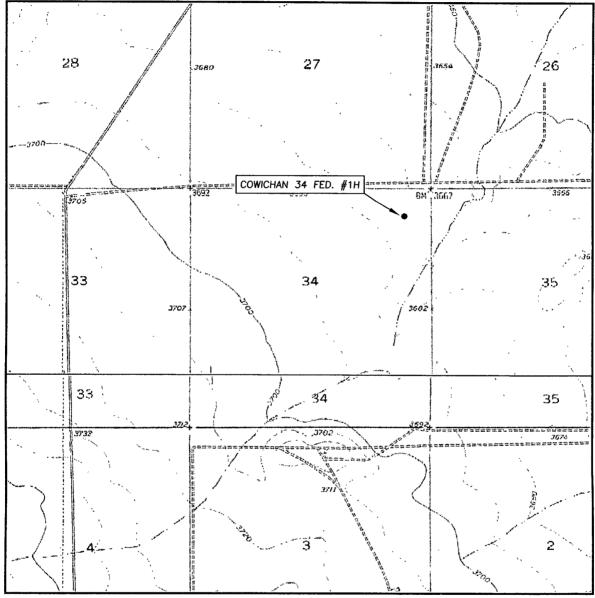

SCALE: 1" = 2000'

CONTOUR INTERVAL: 10'


3LC. <u>34</u> 1WF. 10	0-3 RGE. 24-E
SURVEY	N.M.P.M.
COUNTY	EDDY
DESCRIPTION 610'	FNL & 485' FEL
ELEVATION	3674.7'
OPERATOR EOG	RESOURCES INC.
LEASE COWICH	AN 34 FED. #1H
U.S.G.S. TOPOGRA	PHIC MAP

Asel Surveying

P.O. BOX 393 - 310 W. TAYLOR HOBBS, NEW MEXICO - 575-393-9146



VICINITY MAP

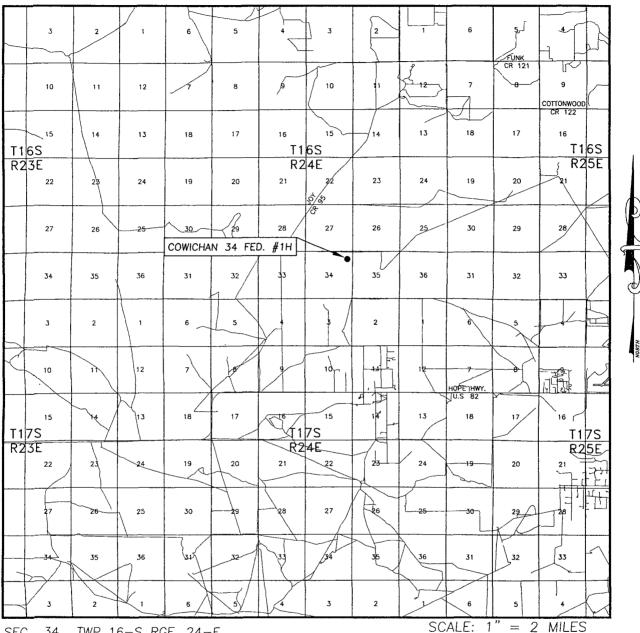

SEC. 34 TWP. 16-S RGE. 24-E

SURVEY N.M.P.M.

COUNTY EDDY

DESCRIPTION 610' FNL & 485' FEL

ELEVATION 3674.7'


OPERATOR EOG RESOURCES INC.


LEASE COWICHAN 34 FED. #1H

Asel Surveying

P.O. BOX 393 - 310 W. TAYLOR HOBBS, NEW MEXICO - 575-393-9146

DIRECTIONS BEGINNING IN ARTESIA AT THE INTERSECTION OF U.S. HWY. #285 AND U.S. HWY. #82, GO WEST ON U.S. HWY. #82 FOR 11.4 MILES, TURN RIGHT ON COUNTY ROAD #95 (JOY ROAD) AND GO NORTH FOR 3.0 MILES, TURN RIGHT AND GO NORTHEAST FOR 1.2 MILES, TURN RIGHT ON CALICHE ROAD AND GO EAST FOR 0.8 MILES, TURN RIGHT ON PROPOSED NEW ROAD AND GO SOUTH FOR 1.1 MILES, TURN RIGHT AND GO WEST FOR 295 FEET TO LOCATION.

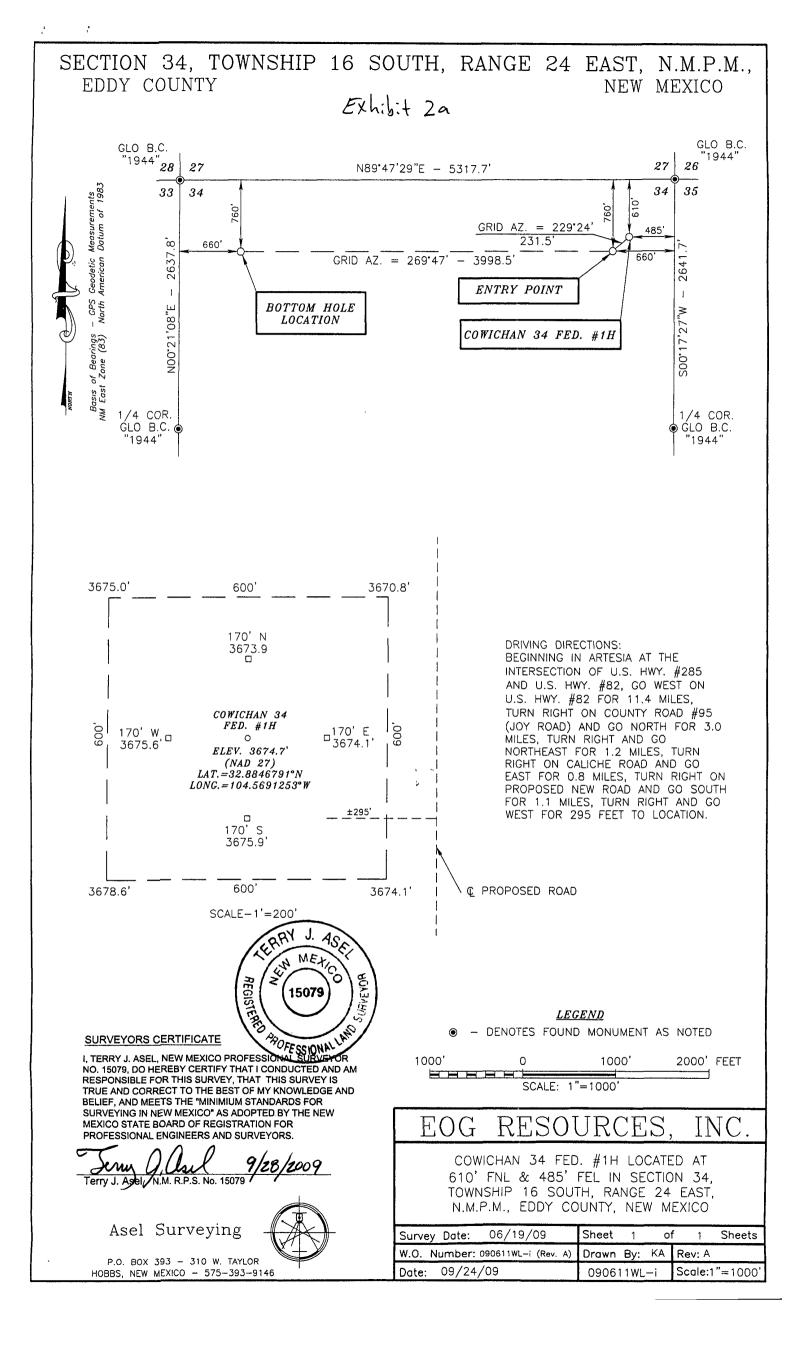

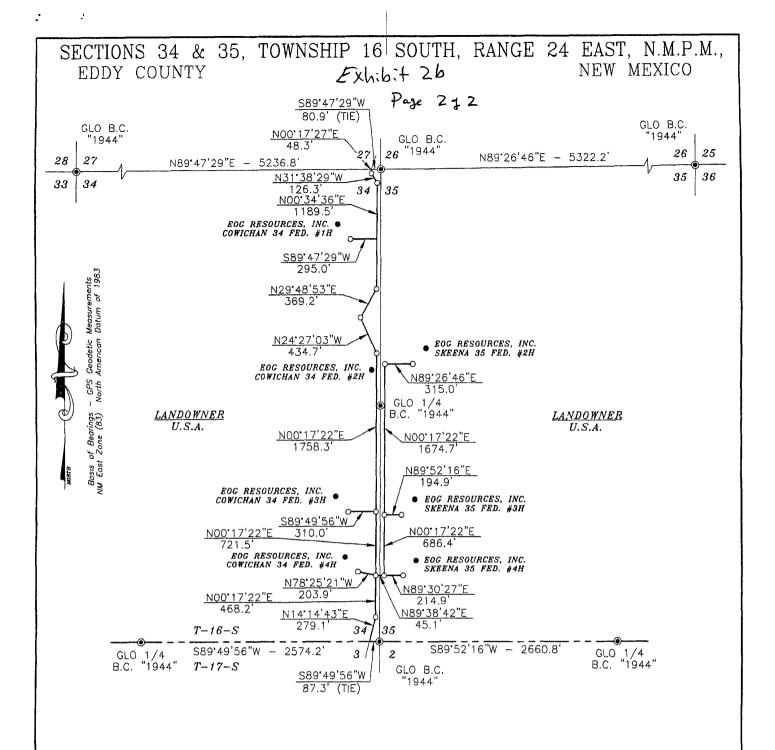

DESCRIPTION

A STRIP OF LAND 20.0 FEET WIDE AND 9335.0 FEET OR 1.768 MILES IN LENGTH CROSSING U.S.A. LAND IN SECTIONS 34 & 35, TOWNSHIP 16 SOUTH, RANGE 24 EAST, N.M.P.M., EDDY COUNTY, NEW MEXICO AND BEING 10.0 FEET LEFT AND 10.0 FEET RIGHT OF THE ABOVE PLATTED CENTERLINE SURVEY.



I, TERRY J. ASEL, NEW MEXICO PROFESSIONAL SURVEYOR NO. 15079, DO HEREBY CERTIFY THAT I CONDUCTED AND AM RESPONSIBLE FOR THIS SURVEY, THAT THIS SURVEY IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF, AND MEETS THE "MINIMIUM STANDARDS FOR SURVEYING IN NEW MEXICO" AS ADOPTED BY THE NEW MEXICO STATE BOARD OF REGISTRATION FOR PROFESSIONAL ENGINEERS AND SURVEYORS.

Serry J. Asel 21.M. R.P.S. No. 15079

Asel Surveying

P.O. BOX 393 - 310 W. TAYLOR HOBBS, NEW MEXICO - 575-393-9146

$\it LEGEND$


DENOTES FOUND MONUMENT AS NOTED



EOG RESOURCES, INC.

SURVEY FOR A ROAD EASEMENT CROSSING U.S.A. LAND IN SECTIONS 34 & 35, TOWNSHIP 16 SOUTH, RANGE 24 EAST, N.M.P.M., EDDY COUNTY, NEW MEXICO

Survey Date: 07/10/09	Sheet 3 of 5 Sheets
W.O. Number: 090811RD	Drawn By: KA
Date: 08/12/09	090811RD.DWG Scale:1"=1000'

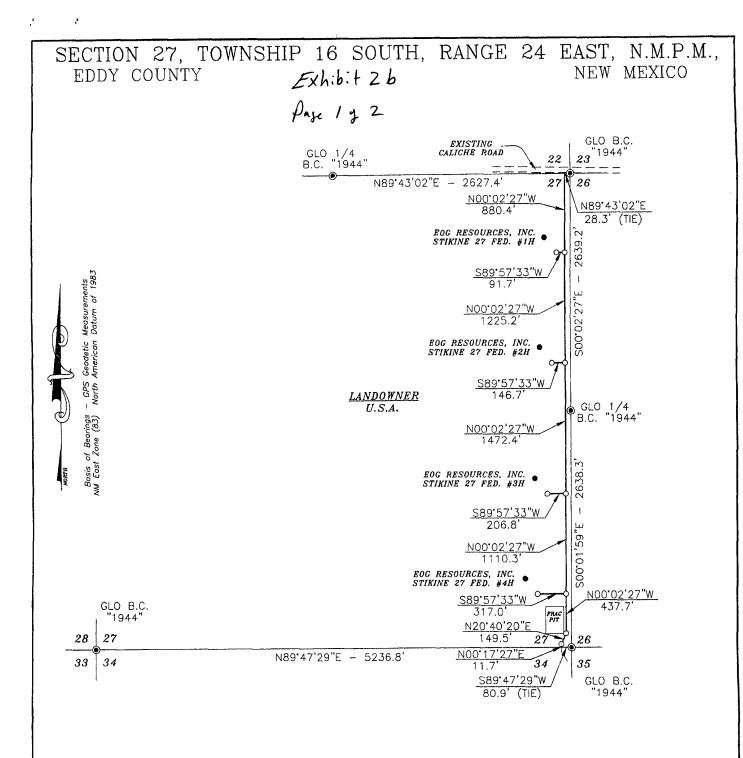

DESCRIPTION

A STRIP OF LAND 20.0 FEET WIDE AND 6049.4 FEET OR 1.146 MILES IN LENGTH CROSSING U.S.A. LAND IN SECTION 27, TOWNSHIP 16 SOUTH, RANGE 24 EAST, N.M.P.M., EDDY COUNTY, NEW MEXICO AND BEING 10.0 FEET LEFT AND 10.0 FEET RIGHT OF THE ABOVE PLATTED CENTERLINE SURVEY.



SURVEYORS CERTIFICATE

I, TERRY J. ASEL, NEW MEXICO PROFESSIONAL SURVEYOR NO. 15079, DO HEREBY CERTIFY THAT I CONDUCTED AND AM RESPONSIBLE FOR THIS SURVEY, THAT THIS SURVEY IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF, AND MEETS THE "MINIMIUM STANDARDS FOR SURVEYING IN NEW MEXICO" AS ADOPTED BY THE NEW MEXICO STATE BOARD OF REGISTRATION FOR PROFESSIONAL ENGINEERS AND SURVEYORS.

Jenn Jack 3/18/2009
Terry J. Asel N.M. R.P.S. No. 15078
Asel Surveying

P.O. BOX 393 - 310 W. TAYLOR HOBBS, NEW MEXICO - 575-393-9146 *LEGEND*

DENOTES FOUND MONUMENT AS NOTED


1000' 0 1000' 2000' FEET

SCALE: 1"=1000'

EOG RESOURCES, INC.

SURVEY FOR A ROAD EASEMENT CROSSING U.S.A. LAND IN SECTION 27, TOWNSHIP 16 SOUTH, RANGE 24 EAST, N.M.P.M., EDDY COUNTY, NEW MEXICO

Survey Date: 07/10/09	Sheet 4 of 5 Sheets
W.O. Number: 090811RD	Drawn By: KA
Date: 08/12/09	090811RD.DWG Scale:1"=1000'

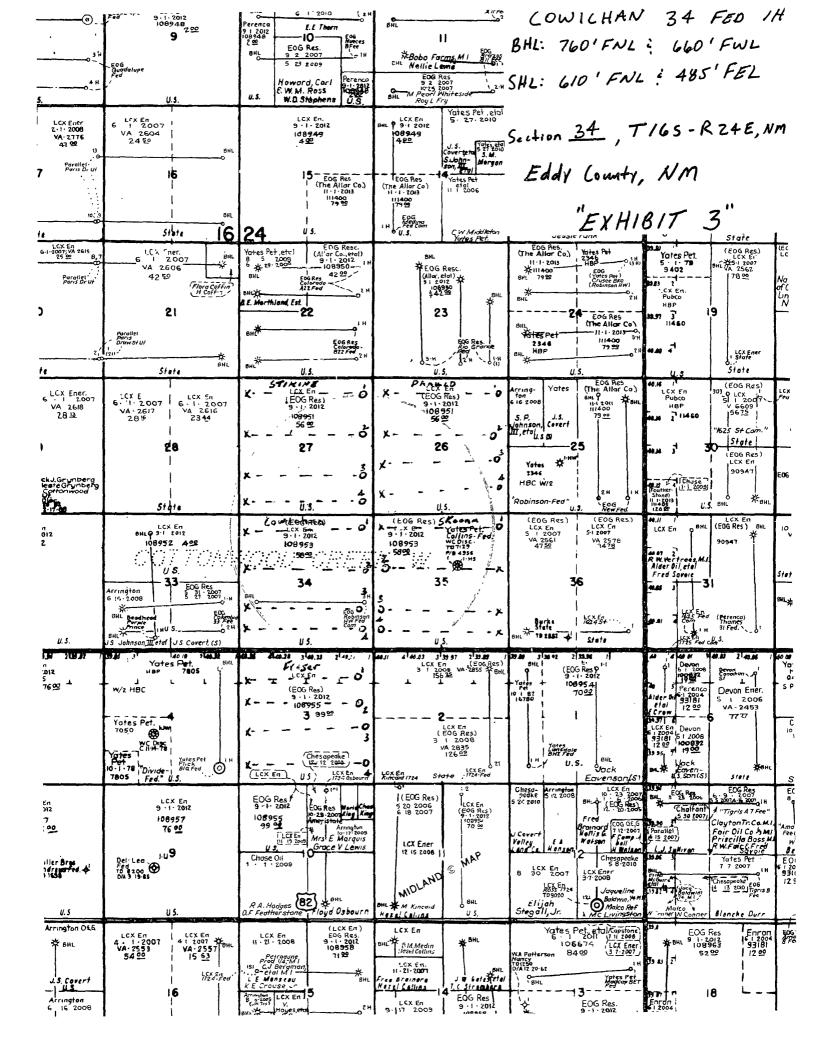


Cowichan 34 Fed #1H Thames Field Eddy County, New Mexico

610' FNL 485' FEL Section 34 T-16-S, R-24-E

Proposed Wellbore

API: 30-015-

KB: 3,693.7' GL: 3,674.7'

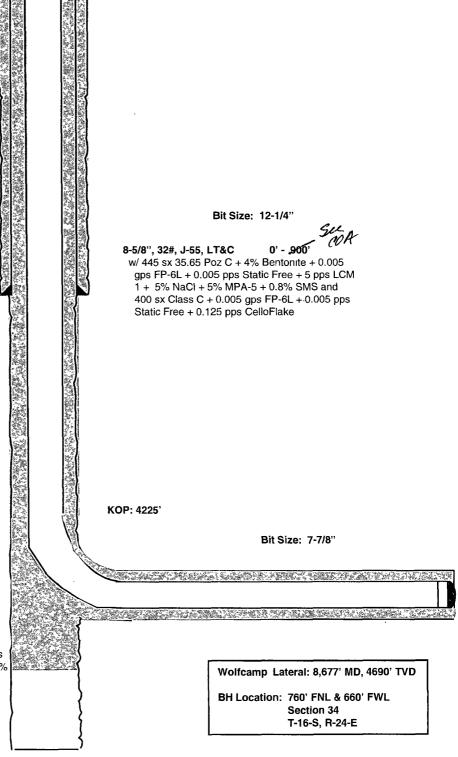

Bit Size: 7-7/8"

5-1/2", 17# , N-80, LT&C @ 8,677"

w 630 sx 50:50 Poz C + 10% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free +0.125 pps CelloFlake

745 sx 50:50 Poz C + 2% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free + 5% NaCl + 0.3% FL-52A + 0 2% CD-32 + 0.05% R-3

TVD Vertical Well: 5100'

Permit Information:

Well Name: Cowichan 34 Fed #1H

Location:

SL 610' FNL & 485' FEL, Section 34, T-16-S, R-24-E, Eddy Co., N.M.

BHL 760' FNL & 660' FWL, Section 34, T-16-S, R-24-E, Eddy Co., N.M.

Casing Program:

Casing	Setting Depth	Hole Size	Casing Size	Casing Weight	Casing Grade	Desired TOC
Surface	900'	12-1/4"	8-5/8"	32#	J-55	Surface
Production	8,677	7-7/8"	5 1/2"	17#	N-80	Surface

Cement Program:

Depth	No.	Slurries:
	Sacks	
9 90,	345	Lead: 35:65 Poz C + 4% Bentonite+ 0.005 gps FP-6L + 0.005 pps Static Free + 5 pps LCM-1 + 5% NaCl + 5% MPA-5 + 0.8% SMS
	400	Tail: Class C + 0.005 gps FP-6L + 0.005 pps Static Free + 0.125 pps CelloFlake
8,677'	630	Lead: 50:50 Poz:Class C + 0.005 gps FP-6L + 10% Bentonite + 0.005 pps Static Free + 0.125 pps CelloFlake
	745	Tail: 50:50 Poz:Class C + 2% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free + 5% NaCl + 0.3% FL-2A + 0.2% CD-32 + 0.05% R-3

Mud Program:

Depth	Туре	Weight (ppg)	Viscosity	Water Loss
0 - 900' 500'	Fresh - Gel	8.6-8.8	28-34	N/c
900' - 4,400'	Cut Brine	8.8-9.2	28-34	N/c
4,400' - 5,100'	Cut Brine	8.6-9.2	28-34	10-15
4,225' - 8,677'	Polymer (Lateral)	8.8-9.4	35-45	10-20

EOG RESOURCES, INC. COWICHAN 34 FED 1H

1. GEOLOGIC NAME OF SURFACE FORMATION:

Quaternary Alluvium

0-200

2. ESTIMATED TOPS OF IMPORTANT GEOLOGICAL MARKERS:

San Andres	400'
Glorieta	1,400'
Tubb	3,020'
Abo Shale	3,640'
Wolfcamp Pay	4,700'

3. ESTIMATED DEPTHS OF ANTICIPATED FRESH WATER, OIL OR GAS:

Quaternary Alluvium	0- 200'	Fresh Water
San Andres	400'	Oil
Glorieta	1,400'	Oil/Gas
Tubb	3,020'	Oil/Gas
Abo/Wolfcamp Pay	4,700'	Gas

No other Formations are expected to give up oil, gas or fresh water in measurable quantities. Surface fresh water sands will be protected by setting 8.625" casing at 1,200' and circulating cement back to surface.

4. CASING PROGRAM - NEW

							Collapse	Burst	<u>lension</u>
		500					Design	Design	Design
	<u>Hole</u>	<u>Interval</u>	OD Csg	Weight	<u>Grade</u>	Conn.	<u>Factor</u>	<u>Factor</u>	<u>Factor</u>
See COA	12.250"	0-900'	8.625"	24#32	J-55	LT&C	4.76	2.62	7.40
	7.875"	0-8,677	5.5"	17#	N-80	LT&C	3.07	1.29	2.36

Cementing Program:

8.625" Surface Casing: Cement to surface, Lead: 345 sx 35:65 Poz C + 0.005

pps Static Free + 5% NaCl + 5 pps LCM-1 + 0.005 gps FP-6L + 4% Bentonite + 5% MPA-5 + 0.8% SMS,

12.7 ppg, 2.02 yield

Tail: 400 sx Prem Plus C + 0.125 pps CelloFlake + 0.005 FP-6L + 0.005 pps Static Free, 14.8 ppg, 1.33

yield

EOG RESOURCES, INC. COWICHAN 34 FED 1H

5.50" Production Casing:

Cement to surface, Lead: 630 sx 50:50 Poz C + 0.005 pps Static Free + 0.125 pps CelloFlake + 0.005 gps FP-

6L + 10% Bentonite, 11.8 ppg, 2.29 yield

Tail: 745 sx 50:50 Poz C + 2% Bentonite + 0.005 gps FP-6L + 0.005 pps Static Free + 5% NaCl + 0.05% R-3 + 0.2% CD-32 + 0.3% FL-52A, 14.2 ppg, 1.30 yield

5. MINIMUM SPECIFICATIONS FOR PRESSURE CONTROL:

(SEE EXHIBIT #1)

The blowout preventer equipment (BOP) shown in Exhibit #1 will consist of a double ram-type (5000 psi WP) preventer and an annular preventer (5000-psi WP). Units will be hydraulically operated and the ram-type will be equipped with blind rams on bottom and drill pipe rams on top. All BOP's and accessory equipment will be tested in accordance with Onshore Oil & Gas order No. 2. for a 3M system

Pipe rams will be operationally checked each 24-hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets.

EOG Resources requests a variance to eliminate the stipulation requiring a BOPE test within 500' of the Wolfcamp. The Wolfcamp is not expected to be abnormally pressured (approx 1,800 lbs.) and the BOPE will be tested to the appropriate pressure requirements as per Onshore Order No. 2 prior to drilling out of the surface casing.

6. TYPES AND CHARACTERISTICS OF THE PROPOSED MUD SYSTEM:

The well will be drilled to TD with a combination of brine, cut brine, and polymer mud system. The applicable depths and properties of this system are as follows:

		Wt	Viscosity	Waterloss
Depth //	<u>Type</u>	<u>(PPG)</u>	(sec)	<u>(cc)</u>
Depth 0-200'	Fresh – Gel	8.6-8.8	28-34	N/c
,900'-4,400'	Cut Brine	8.8-9.2	28-34	N/c
4,400'-5,100'	Cut Brine	8.6-9.2	28-34	10-15
4,225'-8,677'	Polymer (Lateral)	8.8-9.4	35-45	10-20

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept at the wellsite at all times.

EOG RESOURCES, INC. COWICHAN 34 FED 1H

7. AUXILIARY WELL CONTROL AND MONITORING EQUIPMENT:

- (A) A kelly cock will be kept in the drill string at all times.
- (B) A full opening drill pipe-stabbing valve (inside BOP) with proper drill pipe connections will be on the rig floor at all times.

8. LOGGING, TESTING AND CORING PROGRAM: See COA

Open-hole logging is anticipated in the 7-7/8" production hole. The logging suites for this hole section are listed below:

Electric logging will consist of GR-Dual Laterlog and GR-Compensated Density-Neutron from +/-1,200' to TVD.

Possible sidewall cores based on shows. Possible FMI.

9. ABNORMAL CONDITIONS, PRESSURES, TEMPERATURES AND POTENTIAL HAZARDS:

The estimated bottom hole temperature (BHT) at TD is 125 degrees F with an estimated maximum bottom-hole pressure (BHP) at TD of 2000 psig. No hydrogen sulfide or other hazardous gases or fluids have been encountered, reported or are known to exist at this depth in this area. No major loss circulation zones have been reported in offsetting wells.

10. ANTICIPATED STARTING DATE AND DURATION OF OPERATIONS:

The drilling operation should be finished in approximately one month. If the well is productive, an additional 30-60 days will be required for completion and testing before a decision is made to install permanent facilities.



EOG Resources, Inc.


Eddy County Cowichan 34 Fed #1H OH

Plan: Plan #1

Pathfinder X & Y Planning Report

11 January, 2010



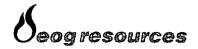

Pathfinder X & Y Planning Report



Company: EOG Resources, Inc. Project: Eddy County

Site: Cowichan 34 Fed

Well: Wellbore: OH Design: Plan #1 Local Co-ordinate Reference: Well #1H

TVD Reference: WELL @:3693.70ft (19' KB) WELL @ 3693,70ft (19' KB) MD Reference:

Grid North Reference:

Minimum Curvature Survey Calculation Method: Database: Midland Database

Project ... Eddy County

Map System: US State Plane 1927 (Exact solution) Geo Datum:

NAD 1927 (NADCON CONUS) New Mexico East 3001

System Datum:

Mean Sea Level

Cowichan 34 Fed

Site Position: From:

Мар

Northing: Easting:

685,638,600 ft 427,616 200 ft Latitude: Longitude:

32° 53' 4 845 N 104° 34' 8.851 W

Position Uncertainty:

Map Zone:

0.00 ft

Slot Radius:

Grid Convergence:

-0 13 °

Well Position +N/-S +E/-W

Position Uncertainty

0.00 ft 0 00 ft 0.00 ft

Northing: Easting:

685,638.600 ft 427,616.200 ft

Latitude: Longitude:

32° 53' 4.845 N 104° 34' 8 851 W

Ground Level: 3,674 70 ft

Wellbore

Magnetics* Sample Date (°)

60 65 IGRF2010 01/11/2010 8 27 49.039

Wellhead Elevation:

Audit Notes:

Version:

PLAN

Tie On Depth:

0 00

Vertical Section: Depth From (TVD) Direction 0 00 0.00 0.00 267.74

Phase:

Survey Tool Program Date 01/11/2010

(ft)

0.00

Survey (Wellbore)

8,676.70 Plan #1 (OH)

Tool Name

Description

MWD

MWD - Standard



Pathfinder X & Y Planning Report



Company: EOG Resources, Inc.

Project: Eddy County
Site: Cowichan 34 Fed

Well: #1H Wellbore: OH Design: Plan #1 Local Co-ordinate Reference: Well #1H

TVD Reference: WELL @ 3693.70ft (19' KB)
MD Reference: WELL @ 3693.70ft (19' KB)

North Reference: Grid

Survey Calculation Method: Minimum Curvature
Database: Midland Database

Planned Survey	and the second of the second o	236 3 med 2019 before 6 men 19 13 pm/cm 242	entro de la compaña de la c La compaña de la compaña d	etter gere er er er er er er	.NC SHELL CT TITE THE TAX PATA C	seguigisens in in include		TELEFORMAL TOTAL TOTAL	C. 1. 79. 3 S. 1. 555 286 2755 586	
	Inc (°)	and the transfer of the best of the	TVD	TVDSS	STATES AND THE PROPERTY OF MICHAEL STATES	the time at the same of the sa	ent to the second of the secon)Leg 100ft)	Northing (ft)	Easting (#\
(ft) 0 00	0.00	0 00	(ft) 0 00	(ft) -3,693.70	(ft) 0 00	(ft) 0.00	0.00	0 00	685,638 60	(ft) 427,616 20
100.00	0.00	0.00	100.00	-3,593.70	0.00	0.00	0.00	0.00	685.638 60	427,616 20
200.00	0 00	0 00	200 00	-3.493 70	0.00	0 00	0 00	0.00	685,638.60	427,616.20
300.00	0 00	0.00	300.00	-3,393 70	0 00	0.00	0 00	0.00	685,638,60	427,616.20
400.00	0.00	0.00	400.00	-3,293.70	0.00	0 00	0 00	0.00	685,638.60	427,616.20
500 00	0.00	0.00	500.00	-3.193.70	0.00	0 00	0.00	0 00	685.638 60	427,616 20
600.00	0 00	0 00	600.00	-3,093.70	0.00	0.00	0.00	0 00	685,638.60	427,616.20
700.00	0.00	0 00	700.00	-2,993.70	0.00	0 00	0 00	0 00	685,638 60	427,616 20
800 00	0.00	0.00	800.00	-2,893 70	0.00	0 00	0 00	0 00	685,638 60	427,616.20
900.00	0 00	0 00	900.00	-2,793 70	0.00	0.00	0.00	0.00	685,638.60	427,616.20
1,000 00	0.00	0.00	1,000.00	-2,693.70	0.00	0 00	0 00	0.00	685,638.60	427,616.20
1,100.00	0.00	0 00	1,100 00	-2,593.70	0.00	0 00	0 00	0.00	685,638 60	427,616 20
1,200.00	0 00	0.00	1,200.00	-2,493.70	0.00	0 00	0 00	0.00	685,638 60	427,616 20
1,300 00	0.00	0.00	1,300.00	-2,393 70	0.00	0.00	0.00	0.00	685,638 60	427,616.20
1,400.00	0.00	0.00	1,400 00	-2,293.70	0.00	0.00	0.00	0.00	685,638.60	427,616.20
1,500 00	0.00	0.00	1,500.00	-2,193.70	0 00	0 00	0.00	0 00	685,638.60	427,616.20
1,600.00	0.00	0 00	1,600.00	-2,093.70	0 00	0.00	0.00	0.00	685,638.60	427,616.20
1,700 00	0.00	0.00	1,700.00	-1,993 70	0.00	0.00	0.00	0.00	685,638.60	427,616.20
1,800.00	0.00	0 00	1,800 00	-1,893.70	0.00	0 00	0 00	0 00	685,638.60	427,616.20
1,900.00	0.00	0.00	1,900.00	-1,793.70	0 00	0.00	0 00	0 00	685,638.60	427,616 20
2,000.00	0 00	0 00	2,000 00	-1,693.70	0.00	0.00	0 00	0.00	685,638.60	427,616 20
2,100.00	0.00	0.00	2,100 00	-1,593.70	0 00	0 00	0 00	0.00	685,638 60	427,616 20
2,200 00	0.00	0.00	2,200 00	-1,493 70	0 00	0.00	0.00	0.00	685,638 60	427,616 20
2,300.00	0.00	0 00	2,300 00	-1,393 70	0.00	0 00	0 00	0 00	685,638.60	427,616.20
2,400.00	0.00	0.00	2,400.00	-1,293.70	0.00	0 00	0.00	0 00	685,638 60	427,616.20
2,500.00	0 00	0 00	2,500 00	-1,193 70	0 00	0.00	0.00	0 00	685,638.60	427,616.20
2,600 00	0.00	0.00	2,600 00	-1,093 70	0.00	0 00	0.00	0.00	685,638.60	427,616.20



Pathfinder X & Y Planning Report



Company: EOG Project: Eddy

EOG Resources, Inc.

Site: ুর্ভার জিলি Well: প্রতিষ্ঠিত (#1H

Wellbore: Design: Local Co-ordinate Reference:

MD Reference:

North Reference: Survey Calculation Method: Database: .∮Well#1H 🕛

WELL @ 3693.70ft (19' KB)
WELL @ 3693.70ft (19' KB)

Grid

Minimum Curvature
Midland Database

MD	The still a still the second restored	en e	enter tenne fra en	ontroverse the latter of			Tractalis in the S	and the last of the last the a			History and property
(P)	Planned Survey	gan Raine in Publicati L	Paragraphic of the Section of the Se	and the control of the section	FIGURES IN THE PROPERTY OF THE PARTY OF		Balannerali langunilan	1 100 Maria 12 an 12	ar del energy ar text		aranieranie and Arie
(P)											
2,700.00 0 0 0 0.00 2,700.00 993.70 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 2,800.00 0 0 0 0.00 0.00 0.00 0.00 0.00 0	LTD LCSD's A LESS FOR EASIER SECTION OF A SECTION		C. N. 440 1 (0) 1 (1) 1005 Y - 105 (4) 10 2 (4) 10 10 10 10 10 10 10 10 10 10 10 10 10	SHOW I SEE THE THE THE SECOND							
2,800.00	Maria and the day of the state	The state of the s	Later Committee that he had been	i lal-liai artary taoni siloan		trick or handlighterskilling strikerned brief in	article of the state Cashing Carlotters of the state of	etti voimmen pares, aki parestati taita ain metamine, se ett	three Bullion are "In the plant of the first of the second training and training and the second training and the second training and an articular and an articular and an articula	Charles Charles Herrica Charles Company Company Company	a regional consequent regardating, extend of the standard of the
3,000 00 0,00 0,00 0,00 3,000 00 -693,70 0,00 0,00 0,00 0,00 0,00 685,638,60 427,616,20 3,200,00 0,00 0,00 0,00 0,00 0,00 0,	2,800.00	0 00	0.00	2,800 00	-893 70	0.00	0.00	0.00	0 00	685,638 60	427,616.20
3,100.00 0.00 0.00 3,100.00 -593.70 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,200.00 0.00 0.00 0.00 3,200.00 -493.70 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,400.00 0.00 0.00 0.00 3,300.00 -293.70 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,400.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	2,900.00	0 00	0.00	2,900 00	-793.70	0 00	0 00	0.00	0 00	685,638 60	427,616.20
3,200.00 0 0 0 0 0,00 3,200 0 493.70 0 0 0 0 0 0 0 0 0 0 685,638.60 427,616.20 3,400.00 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	3,000 00	0.00	0.00	3,000.00	-693.70	0.00	0.00	0 00	0 00	685,638.60	427,616.20
3,300.00 0.00 0.00 3,300.00 -393.70 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,400.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,500.00 0.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,500.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	3,100.00	0.00	0.00	3,100.00	-593 70	0.00	0.00	0.00	0.00	685,638.60	427,616.20
3,400.00 0.00 0.00 3,400.00 .293.70 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,500.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,600.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,700.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	3,200.00	0 00	0.00	3,200 00	-493.70	0 00	0 00	0.00	0 00	685,638 60	427,616.20
3,500.00 0 0 0 0 0 0 3,500.00 -193.70 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,600.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	3,300.00	0.00	0.00	3,300.00	-393.70	0.00	0.00	0 00	0.00	685,638.60	427,616.20
3,600.00 0.00 0.00 3,600.00 -93.70 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,700.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	3,400.00	0.00	0.00	3,400 00	-293 70	0.00	0.00	0.00	0 00	685,638.60	427,616.20
3,700 00 0.00 0.00 3,700 00 6.30 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 3,800.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	3,500.00	0 00	0 00	3,500 00	-193 70	0.00	0.00	0.00	0 00	685,638.60	427,616.20
3,800.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	3,600.00	0.00	0.00	3,600.00	-93.70	0 00	0.00	0.00	0.00	685,638.60	427,616.20
3,900 00 0.00 0.00 3,900.00 266.30 0.00 0.00 0.00 0.00 685,638 60 427,616.20 4,000 00 0.00 0.00 0.00 0.00 0.00 0.00	3,700 00	0.00	0.00	3,700 00	6.30	0.00	0.00	0.00	0 00	685,638.60	427,616.20
4,000 00 0 00 0.00 4,000.00 306.30 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,100.00 0.00 0.00 4,100 00 406.30 0 00 0.00 0.00 0.00 685,638.60 427,616.20 4,200.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,212 50 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,225.00 1.50 256.45 4,225.00 531.30 -0.04 -0.16 0.16 12.00 685,638.56 427,616.20 4,250.00 4.50 256.45 4,249.96 556.26 -0.34 -1.43 1.44 12.00 685,638.26 427,614.23 4,275.00 7.50 256.45 4,274.82 581.12 -0.96 -3.97 4.01 12.00 685,636.73 427,618.43 4,300.00 10.50 256.45 4,299.51 605.81 -1.87	3,800.00	0.00	0 00	3,800 00	106 30	0.00	0.00	0.00	0.00	685,638.60	427,616 20
4,100.00 0.00 0.00 4,100.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,200.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,212.50 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,225.00 1.50 256.45 4,225.00 531.30 -0.04 -0.16 0.16 12.00 685,638.56 427,616.20 4,250.00 4.50 256.45 4,249.96 556.26 -0.34 -1.43 1.44 12.00 685,638.26 427,614.77 4,275.00 7.50 256.45 4,249.96 556.26 -0.34 -1.43 1.44 12.00 685,638.76 427,614.77 4,275.00 7.50 256.45 4,249.95 581.12 -0.96 -3.97 4.01 12.00 685,637.64 427,614.77 4,300.00 10.50 256.45 4,299.51 605.81 -1.87 -7.77 7.84 12.00 685,63	3,900 00	0.00	0 00	3,900.00	206.30	0.00	0.00	0 00	0.00	685,638 60	427,616.20
4,200,00 0.00 0.00 4,200,00 506 30 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,212 50 0.00 0.00 0.00 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,225 00 1.50 256 45 4,225 00 531.30 -0.04 -0.16 0.16 12 00 685,638.56 427,616.04 4,250 00 4.50 256 45 4,249.96 556 26 -0.34 -1.43 1.44 12.00 685,638.26 427,614.77 4,275 00 7.50 256 45 4,274.82 581.12 -0.96 -3.97 4.01 12.00 685,638.73 427,612.23 4,300.00 10.50 256.45 4,299.51 605.81 -1.87 -7.77 7.84 12.00 685,636.73 427,608.43 4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12.82 12.94 12.00 685,633.99 427,597.09 4,375.00 19.50 256.45 4,348.11 654.41 -4.61 -19.11 19.28 12.00 <th>4,000 00</th> <th>0 00</th> <th>0.00</th> <th>4,000.00</th> <th>306.30</th> <th>0.00</th> <th>0.00</th> <th>0.00</th> <th>0.00</th> <th>685,638.60</th> <th>427,616.20</th>	4,000 00	0 00	0.00	4,000.00	306.30	0.00	0.00	0.00	0.00	685,638.60	427,616.20
4,212 50 0.00 0.00 4,212.50 518 80 0.00 0.00 0.00 0.00 685,638.60 427,616.20 4,225.00 1.50 256 45 4,225 00 531.30 -0.04 -0 16 0 16 12 00 685,638.60 427,616.20 4,250 00 4.50 256 45 4,249 96 556 26 -0 34 -1.43 1.44 12.00 685,638 26 427,614.77 4,275 00 7.50 256 45 4,274 82 581.12 -0.96 -3.97 4.01 12.00 685,638.76 427,612.23 4,300.00 10.50 256.45 4,299 51 605.81 -1.87 -7.77 7.84 12.00 685,635.73 427,608.43 4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12.82 12.94 12.00 685,633.99 427,597.09 4,375.00 19.50 256.45 4,348.11 654.41 -4.61 -19.11 19.28 12.00 685,632.18 427,589.58 4,400.00 22.50 256.45 4,395.22 701.52 -8.51 -35.33	4,100.00	0.00	0.00	4,100 00	406.30	0 00	0.00	0.00	0.00	685,638.60	427,616.20
4,225.00 1.50 256 45 4,225 00 531.30 -0.04 -0 16 0 16 12 00 685,638 56 427,616.04 4,250 00 4.50 256 45 4,249 96 556 26 -0 34 -1.43 1.44 12.00 685,638 26 427,614.77 4,275 00 7.50 256 45 4,274 82 581.12 -0.96 -3.97 4.01 12.00 685,637 64 427,612.23 4,300.00 10.50 256.45 4,299 51 605.81 -1.87 -7.77 7.84 12.00 685,636.73 427,608.43 4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12 82 12 94 12.00 685,635.51 427,603.38 4,350.00 16.50 256 45 4,348.11 654.41 -4.61 -19.11 19.28 12.00 685,632.18 427,589.58 4,400.00 22.50 256 45 4,395.22 701.52 -8.51 -35.33 35.64 12.00 685,632.18 427,589.58 4,425 00 25.50 256.45 4,418.05 724.35 -10.90 -45.21 </th <th>4,200.00</th> <th>0.00</th> <th>0 00</th> <th>4,200.00</th> <th>506 30</th> <th>0 00</th> <th>0.00</th> <th>0.00</th> <th>0 00</th> <th>685,638.60</th> <th>427,616.20</th>	4,200.00	0.00	0 00	4,200.00	506 30	0 00	0.00	0.00	0 00	685,638.60	427,616.20
4,250 00 4.50 256 45 4,249 96 556 26 -0 34 -1.43 1.44 12.00 685,638 26 427,614.77 4,275 00 7.50 256 45 4,274 82 581.12 -0.96 -3.97 4.01 12.00 685,637 64 427,612.23 4,300.00 10.50 256.45 4,299 51 605.81 -1.87 -7.77 7.84 12.00 685,636.73 427,608.43 4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12 82 12 94 12.00 685,635.51 427,603.38 4,350.00 16.50 256 45 4,348.11 654 41 -4.61 -19.11 19.28 12.00 685,633.99 427,597.09 4,375.00 19.50 256 45 4,371.88 678.18 -6.42 -26.62 26.86 12.00 685,632.18 427,589.58 4,400.00 22.50 256 45 4,395.22 701.52 -8.51 -35.33 35.64 12.00 685,630.09 427,580.87 4,425.00 25.50 256.45 4,418.05 724.35 -10.90 -45.2	4,212 50	0.00	0.00	4,212.50	518 80	0.00	0.00	0.00	0.00	685,638.60	427,616.20
4,275 00 7.50 256 45 4,274 82 581.12 -0.96 -3.97 4.01 12.00 685,637 64 427,612.23 4,300.00 10.50 256.45 4,299 51 605.81 -1.87 -7.77 7.84 12.00 685,636.73 427,608.43 4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12 82 12 94 12.00 685,635 51 427,603.38 4,350.00 16.50 256 45 4,348.11 654 41 -4.61 -19.11 19.28 12.00 685,633.99 427,597.09 4,375.00 19.50 256 45 4,371.88 678.18 -6.42 -26.62 26.86 12.00 685,632.18 427,589.58 4,400.00 22.50 256 45 4,395.22 701.52 -8.51 -35.33 35.64 12.00 685,630.09 427,589.87 4,425.00 25.50 256.45 4,418.05 724.35 -10.90 -45.21 45.61 12.00 685,627.70 427,570.99	4,225.00	1.50	256 45	4,225 00	531.30	-0.04	-0 16	0 16	12 00	685,638 56	427,616.04
4,300.00 10.50 256.45 4,299 51 605.81 -1.87 -7.77 7.84 12.00 685,636.73 427,608.43 4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12.82 12.94 12.00 685,635.51 427,603.38 4,350.00 16.50 256.45 4,348.11 654.41 -4.61 -19.11 19.28 12.00 685,633.99 427,597.09 4,375.00 19.50 256.45 4,371.88 678.18 -6.42 -26.62 26.86 12.00 685,632.18 427,589.58 4,400.00 22.50 256.45 4,395.22 701.52 -8.51 -35.33 35.64 12.00 685,630.09 427,580.87 4,425.00 25.50 256.45 4,418.05 724.35 -10.90 -45.21 45.61 12.00 685,627.70 427,570.99	4,250 00	4.50	256 45	4,249 96	556 26	-0 34	-1.43	1.44	12.00	685,638 26	427,614.77
4,325.00 13.50 256.45 4,323.96 630.26 -3.09 -12.82 12.94 12.00 685,635.51 427,603.38 4,350.00 16.50 256.45 4,348.11 654.41 -4.61 -19.11 19.28 12.00 685,633.99 427,597.09 4,375.00 19.50 256.45 4,371.88 678.18 -6.42 -26.62 26.86 12.00 685,632.18 427,589.58 4,400.00 22.50 256.45 4,395.22 701.52 -8.51 -35.33 35.64 12.00 685,630.09 427,580.87 4,425.00 25.50 256.45 4,418.05 724.35 -10.90 -45.21 45.61 12.00 685,627.70 427,570.99	4,275 00	7.50	256 45	4,274 82	581.12	-0.96	-3.97	4.01	12.00	685,637 64	427,612.23
4,350 00 16.50 256 45 4,348.11 654 41 -4.61 -19.11 19.28 12.00 685,633.99 427,597.09 4,375 00 19.50 256 45 4,371 88 678.18 -6 42 -26.62 26.86 12 00 685,632.18 427,589.58 4,400.00 22.50 256 45 4,395 22 701.52 -8 51 -35.33 35.64 12.00 685,630.09 427,580.87 4,425 00 25.50 256.45 4,418.05 724.35 -10 90 -45.21 45.61 12 00 685,627.70 427,570.99	4,300.00	10.50	256.45	4,299 51	605.81	-1.87	-7.77	7.84	12.00	685,636.73	427,608.43
4,375 00 19.50 256 45 4,371 88 678.18 -6 42 -26.62 26.86 12 00 685,632.18 427,589.58 4,400.00 22.50 256 45 4,395 22 701.52 -8 51 -35.33 35.64 12.00 685,630.09 427,580.87 4,425 00 25.50 256.45 4,418.05 724.35 -10 90 -45.21 45.61 12 00 685,627.70 427,570.99	4,325.00	13.50	256.45	4,323.96	630.26	-3.09	-12 82	12 94	12.00	685,635 51	427,603.38
4,400.00 22.50 256.45 4,395.22 701.52 -8.51 -35.33 35.64 12.00 685,630.09 427,580.87 4,425.00 25.50 256.45 4,418.05 724.35 -10.90 -45.21 45.61 12.00 685,627.70 427,570.99	4,350 00	16.50	256 45	4,348.11	654 41	-4.61	-19.11	19.28	12.00	685,633.99	427,597.09
4,425 00 25.50 256.45 4,418.05 724.35 -10 90 -45.21 45.61 12 00 685,627.70 427,570.99	4,375 00	19.50	256 45	4,371 88	678.18	-6 42	-26.62	26.86	12 00	685,632.18	427,589.58
	4,400.00	22.50	256 45	4,395 22	701.52	-8 51	-35.33	35.64	12.00	685,630.09	427,580.87
4,450.00 28.50 256.45 4,440.33 746.63 -13.56 -56.25 56.74 12.00 685,625.04 427,559.95	·		256.45	4,418.05	724.35	-10 90	-45.21	45.61	12 00	685,627.70	427,570.99
	4,450.00	28.50	256.45	4,440.33	746 63	-13.56	-56.25	56.74	12 00	685,625.04	427,559.95



Pathfinder X & Y Planning Report



Company: Project:

Design:

EOG Resources, Inc.

Eddy County Cowichan 34 Fed

Site: Well: Wellbore:

#1H

ОН Plan #1 Local Co-ordinate Reference:
TVD Reference:

MD Reference:

North Reference:

Survey Calculation Method: Database:

Well#1H

WELL @ 3693.70ft (19' KB) WELL @ 3693.70ft (19' KB)

Grid

Minimum Curvature Midland Database

Planned Survey:		CONTRACTOR DE LA CONTRA	Chip of the French Commission	CONTRACTOR OF THE PARTY OF THE				DESCRIPTION OF THE PERSON	CONTRACTOR	
MD	Inc		TVD	TVDSŠ	N/S	E/W	V. Sec	Diag	Northing	Easting
(ft)	linc (°)	Azi (°)	(ft)	(ft)	(ft)	(ft)	10 m 2 m 2 m 1 m 2 m 2 m 2 m 2 m 2 m 2 m 2	DLeg /100ft)	(ft)	(ft)
4,475.00	31 50	256.45	4,461 98	768 28	-16.48	-68.40	68.99	12.00	685,622 12	427,547 80
4,500 00	34.50	256.45	4,482.94	789 24	-19 67	-81 63	82.34	12 00	685,618.93	427,534 57
4,525 00	37 50	256.45	4,503.17	809.47	-23.12	-95.91	96.75	12.00	685,615.48	427,520 29
4,550.00	40.50	256.45	4,522.59	828.89	-26.80	-111 21	112 18	12.00	685,611 80	427,504.99
4,575 00	43.50	256 45	4,541 17	847.47	-30 72	-127 47	128 58	12.00	685,607 88	427,488.73
4,600 00	46 50	256.45	4,558.85	865.15	-34.86	-144.65	145.91	12.00	685,603.74	427,471 55
4,625.00	49.50	256.45	4,575.57	881.87	-39.21	-162.71	164 13	12 00	685,599 39	427,453.49
4,650.00	52 50	256.45	4,591 31	897 61	-43.76	-181.59	183.18	12.00	685,594 84	427,434.61
4,675 00	55 50	256.45	4,606 00	912 30	-48.50	-201 25	203.01	12.00	685,590.10	427,414.95
4,700.00	58 50	256 45	4,619.62	925 92	-53.41	-221 63	223 57	12.00	685,585 19	427,394.57
4,725.00	61 50	256 45	4,632 12	938.42	-58 49	-242 68	244.80	12.00	685,580 11	427,373.52
4,750.00	64 50	256.45	4,643.47	949 77	-63.70	-264.33	266.64	12.00	685,574 90	427,351 87
4,775 00	67.50	256 45	4,653 64	959.94	-69 05	-286 53	289.03	12.00	685,569.55	427,329.67
4,800.00	70.49	256 45	4,662.60	968.90	-74.52	-309.21	311.92	12.00	685,564.08	427,306 99
4,825.00	73.49	256 45	4,670.32	976.62	-80.09	-332.32	335.23	12.00	685,558 51	427,283.88
4,850 00	76.49	256 45	4,676 80	983 10	-85 75	-355 80	358.91	12 00	685,552 85	427,260.40
4,875 00	79.49	256.45	4,682.00	988.30	-91.48	-379 57	382.89	12.00	685,547.12	427,236.63
4,900.00	82.49	256.45	4,685 91	992 21	-97 26	-403.57	407.10	12.00	685,541 34	427,212 63
4,925 00	85 49	256.45	4,688 52	994 82	-103.09	-427.74	431 48	12.00	685,535 51	427,188.46
4,950.00	88.49	256 45	4,689.83	996 13	-108.93	-452 00	455.96	12 00	685,529.67	427,164 20
4,962 56	90.00	256 45	4,690.00	996 30	-111 88	-464.21	468.27	12 00	685,526.72	427,151.99
5,000.00	90.00	257.57	4,690 00	996.30	-120.29	-500.70	505 06	3.00	685,518 31	427,115.50
5,100 00	90.00	260 57	4,690.00	996 30	-139 24	-598 87	603.91	3 00	685,499 36	427,017.33
5,200 00	90 00	263.57	4,690.00	996.30	-153 03	-697.90	703.41	3 00	685,485.57	426,918.30
5,300.00	90.00	266.57	4,690 00	996.30	-161.62	-797.52	803.29	3 00	685,476.98	426,818.68
5,400 00	90.00	269 57	4,690.00	996 30	-164.98	-897 46	903 27	3.00	685,473.62	426,718.74
5,414.18	90.00	270 00	4,690.00	996.30	-165 03	-911.64	917.45	3.00	685,473 57	426,704 56



Pathfinder X & Y Planning Report



Company: EOG Resources, Inc.

Project: Eddy County Site: Cowichan 34 Fed

Well: #1H Wellbore: OH
Design: Plan #1

8,000.00

8,100.00

90 00

90.00

270.00

270 00

4,690 00

4,690 00

Local Co-ordinate Reference: Well #1H

TVD Reference: MD Reference:

3,501 25

3,601.17

0.00

0.00

685,473.51

685,473.51

424,118.74

424,018.74

North Reference: Survey Calculation Method:

Database:

WELL @ 3693.70ft (19' KB) WELL @ 3693.70ft (19' KB)

Grid

Minimum Curvature Midland Database

Planned Survey								o marenar respectante aspez antal controllati Sulla della controllation della controllation con		
										2
MD (ft)	Inc (°)	Azi (°)	TVD (ft)	TVDSS (ft)	N/S (ft)	E/W (ft)		DLeg (100ft)	Northing (ft)	Easting (ft)
5,500.00	90.00	270.00	4,690 00	996.30	-165.04	-997.46	1,003.20	0 00	685,473.56	426,618 74
5,600.00	90.00	270.00	4,690.00	996.30	-165.04	-1,097.46	1,103.12	0.00	685,473.56	426,518.74
5,700.00	90 00	270 00	4,690.00	996 30	-165 04	-1,197.46	1,203.04	0.00	685,473 56	426,418.74
5,800.00	90.00	270 00	4,690 00	996.30	-165.04	-1,297 46	1,302.96	0 00	685,473.56	426,318.74
5,900.00	90 00	270 00	4,690 00	996.30	-165.04	-1,397.46	1,402.89	0 00	685,473 56	426,218.74
6,000.00	90 00	270.00	4,690 00	996 30	-165.05	-1,497.46	1,502.81	0 00	685,473.55	426,118.74
6,100 00	90.00	270 00	4,690.00	996.30	-165.05	-1,597.46	1,602.73	0.00	685,473.55	426,018.74
6,200.00	90.00	270 00	4,690.00	996.30	-165 05	-1,697 46	1,702.65	0.00	685,473.55	425,918.74
6,300.00	90 00	270 00	4,690.00	996 30	-165.05	-1,797 46	1,802 57	0.00	685,473 55	425,818.74
6,400 00	90 00	270 00	4,690.00	996 30	-165 05	-1,897.46	1,902 50	0 00	685,473.55	425,718.74
6,500 00	90 00	270.00	4,690.00	996.30	-165 06	-1,997.46	2,002 42	0 00	685,473.54	425,618.74
6,600 00	90.00	270 00	4,690.00	996.30	-165.06	-2,097 46	2,102.34	0.00	685,473.54	425,518 74
6,700.00	90 00	270.00	4,690.00	996 30	-165 06	-2,197 46	2,202.26	0.00	685,473.54	425,418.74
6,800.00	90.00	270 00	4,690 00	996.30	-165.06	-2,297.46	2,302.18	0 00	685,473.54	425,318.74
6,900.00	90 00	270.00	4,690 00	996 30	-165 06	-2,397 46	2,402.11	0 00	685,473.54	425,218.74
7,000 00	90.00	270 00	4,690.00	996.30	-165.07	-2,497.46	2,502.03	0.00	685,473 53	425,118.74
7,100.00	90 00	270.00	4,690 00	996.30	-165.07	-2,597.46	2,601 95	0 00	685,473.53	425,018.74
7,200 00	90 00	270 00	4,690.00	996.30	-165.07	-2,697.46	2,701.87	0 00	685,473.53	424,918.74
7,300.00	90 00	270.00	4,690 00	996 30	-165.07	-2,797.46	2,801 79	0.00	685,473.53	424,818.74
7,400 00	90.00	270 00	4,690.00	996 30	-165 07	-2,897 46	2,901.72	0 00	685,473.53	424,718.74
7,500.00	90 00	270.00	4,690.00	996 30	-165.08	-2,997 46	3,001.64	0 00	685,473.52	424,618 74
7,600 00	90 00	270 00	4,690.00	996.30	-165.08	-3,097.46	3,101 56	0 00	685,473.52	424,518 74
7,700.00	90.00	270.00	4,690 00	996 30	-165 08	-3,197.46	3,201.48	0.00	685,473.52	424,418.74
7,800.00	90 00	270 00	4,690 00	996 30	-165 08	-3,297 46	3,301.40	0 00	685,473 52	424,318.74
7,900.00	90 00	270.00	4,690.00	996.30	-165.08	-3,397.46	3,401 33	0 00	685,473 52	424,218.74

-165.09

-165.09

-3,497.46

-3,597 46

996 30

996.30

Pathfinder X & Y Planning Report



Company: EOG Resources, Inc

Project: Eddy County Site: Cowichan 34 Fed Well: #1H

Wellbore: OH Design: Plan #1

Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference: Survey Calculation Method:

Well #1H

WELL @ 3693.70ft (19' KB) WELL @ 3693 70ft (19' KB)


Grid

Minimum Curvature Midland Database

	PBHĽ(COW#1H)	į					,				
į	8,676.84	90 00	270.00	4,690.00	996.30	-165.10	-4,174.30	4,177.56	0 00	685,473 50	423,441 90
	8,600.00	90.00	270.00	4,690.00	996.30	-165 10	-4,097.46	4,100 78	0.00	685,473 50	423,518 74
İ	8,500.00	90.00	270.00	4,690 00	996 30	-165.10	-3,997 46	4,000 86	0 00	685,473.50	423,618.74
	8,400 00	90.00	270.00	4,690.00	996.30	-165 09	-3,897.46	3,900.94	0 00	685,473.51	423,718.74
	8,300.00	90.00	270.00	4,690.00	996.30	-165 09	-3,797 46	3,801.01	0.00	685.473.51	423,818 74
	8,200.00	90.00	270.00	4,690.00	996.30	-165.09	-3,697 46	3,701 09	0.00	685,473 51	423,918.74
	MD It	ic °)	Azi (°)	TVD (ft)	TVDSS. (ft)	N/S (ft)	E/W (ft)	E. C. D. C. C. C. C. L. C.	DLeg /100ft)	Northing (ft)	Easting (ft)

17.3	argets arget Name - hit/miss,target Dip'An - Shape (3)	igle :	Dip\Dir.	TVD	+N/-S	+E/-W	Northing	Easting		A Translation of the Control of the
J.	- Shape	Samma		(ft)	(ft)	(ft)	(ft)	(ft)	Latitude	Longitude 🐇 💮
P	BHL(COW#1H) - plan hits target center - Point	0.00	0 00	4,690 00	-165 10	-4,174.30	685,473 500	423,441.900	32° 53′ 3.116 N	104° 34' 57 798 W

Checked By:	Approved Du	D.	nto:
Checked by.	Approved Bv:	Dr	ate:
,			

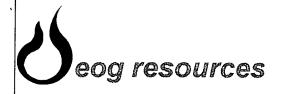



Azimuths to Grid North True North: 0.13° Magnetic North: 8.39°


Magnetic Field Strength: 49039.0snT Dip Angle: 60.65° Date: 01/11/2010 Model: IGRF2010

Name



West(-)/East(+) (200 ft/in)

Project: Eddy County Site: Cowichan 34 Fed Well: #1H Wellbore: OH Plan: Plan #1 (#1H/OH)

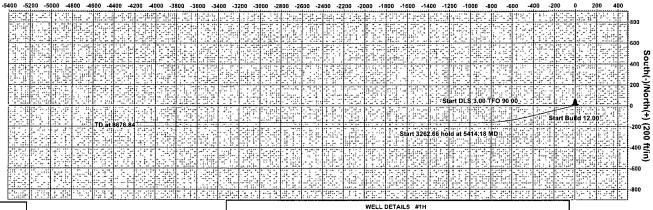

| SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DETAILS | SECTION DE


WELL DETAILS #1H

Ground Elevation: 36474 (3693 70ft (19' KB)
RKB Elevation. WELL @ 3693 70ft (19' KB)
Rig Name 19' KB

+N/-S +E/-W Northing Easting Latitude Longitude Slot
0 00 0 00 685638 600 427616 200 32° 53' 4 845 N 104° 34' 8 851 W

WELLBORE TARGET DETAILS (MAP CO-ORDINATES)

TVD +N/-S +E/-W Northing Easting Shat
PBHL(COW#1H) 4690 00 -165 10 -4174 30 685473 500 423441 900 Poin

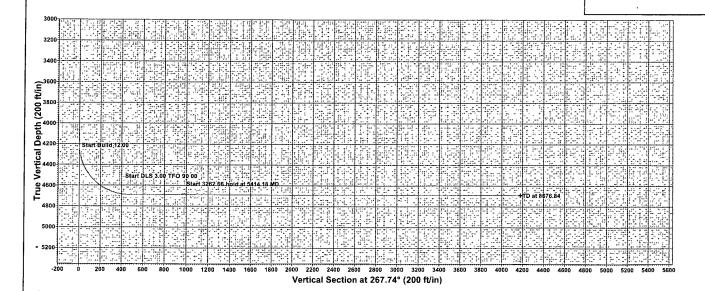


LEGEND

◆ Plan #1

PROJECT DETAILS: Eddy County
Geodetic System: US State Plane 1927 (Exact solution)
Datum: NAD 1927 (NADCON CONUS)
Ellipsoid: Clarke 1866
Zone: New Mexico East 3001
System Datum: Mean Sea Level
Local North: Grid

	Plan Plan #1 (#1H/OH)									
Created By	Nate Bingham	Date	15 48, January 11 2010							
Checked		Date								

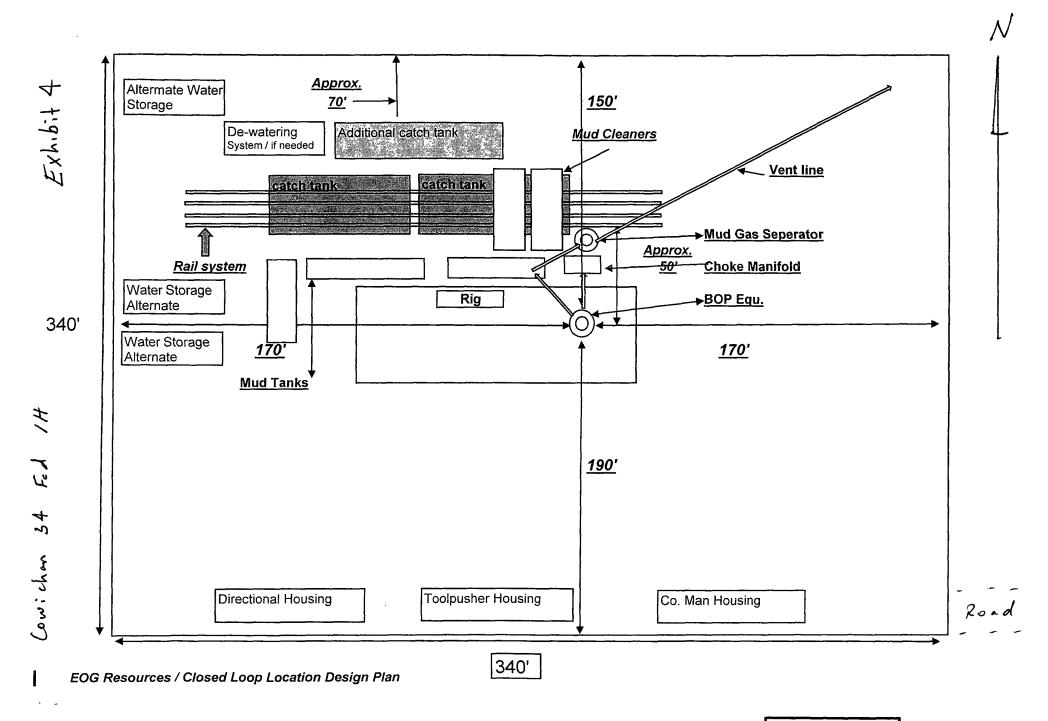

Not to scale


EOG RESOURCES, INC. COWICHAN 34 FED 1H


ATTACHMENT TO EXHIBIT #1

- 1. Wear ring to be properly installed in head.
- 2. Blow out preventer and all fittings must be in good condition, 5000 psi W.P. minimum. Exhibit #1.
- 3. All fittings to be flanged
- 4. Safety valve must be available on rig floor at all times with proper connections, valve to be full bore 5000 psi W.P. minimum.
- 5. All choke and fill lines to be securely anchored especially ends of choke lines.
- 6. Equipment through which bit must pass shall be at least as large as the diameter of the casing being drilled through.
- 7. Kelly cock on kelly.
- 8. Extension wrenches and hand wheels to be properly installed.
- 9. Blow out preventer control to be located as close to driller's position as feasible.
- 10. Blow out preventer closing equipment to include minimum 40-gallon accumulator, two independent sources of pump power on each closing unit installation, and meet all API specifications.

EOG Resources, Inc.

Cowichan 34 Fed 1H

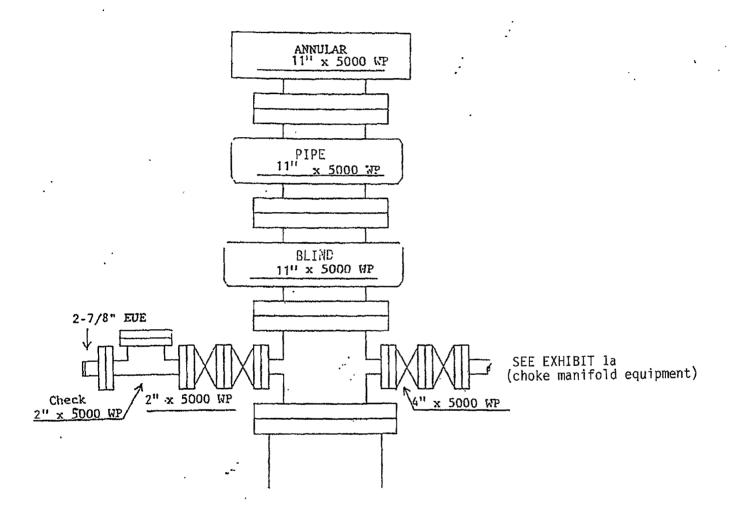


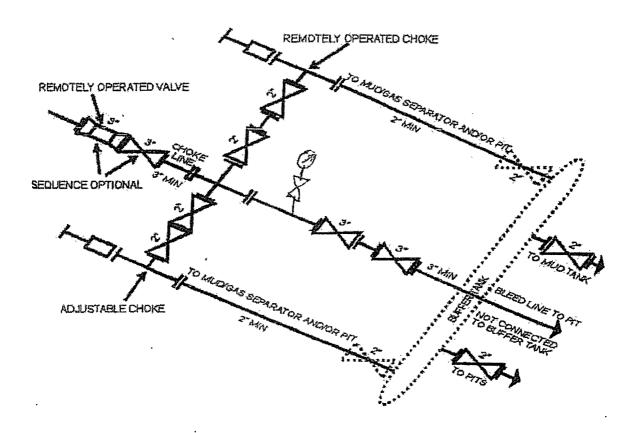


5M CHOKE MANIFOLD EQUIPMENT - CONFIGURATION OF CHOKES MAY VARY


Although not required for any of the choke manifold systems, buffer tanks are sometimes installed downstream of the choke assemblies for the purpose of manifolding the bleed lines together. When buffer tanks are employed, valves shall be installed upstream to isolate a failure or malfunction without interrupting flow control. Though not shown on 2M, 3M, 10M, OR 15M drawings, it would also be applicable to those situations.

[54 FR 39528, Sept. 27, 1989]

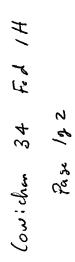


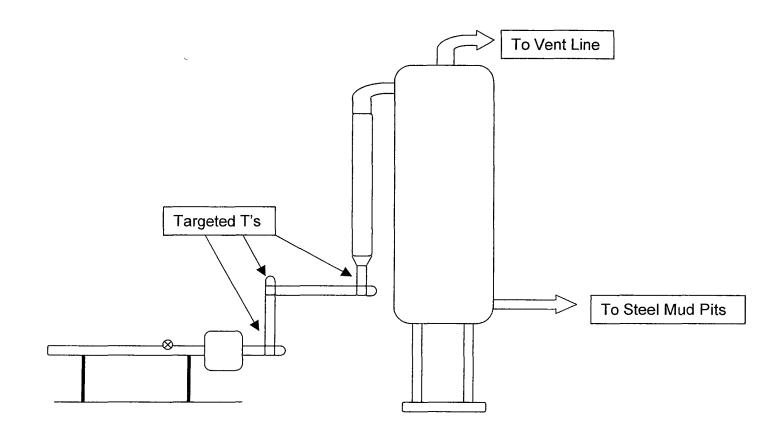

Aerial View of the Piping from the Choke Manifold to the Mud Gas Separator

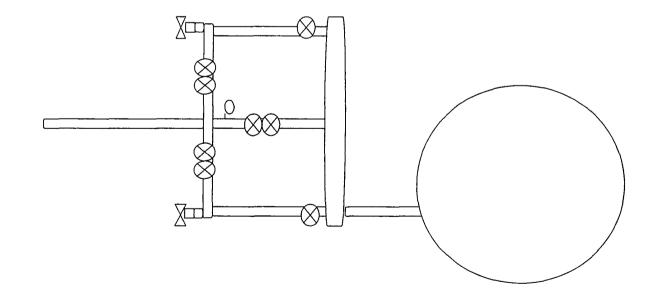

Production Facility Layout

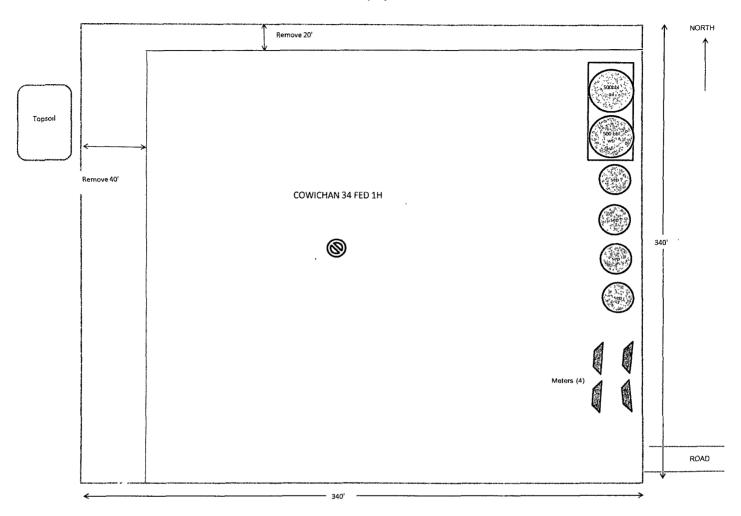

NOT TO SCALE


EOG Resources, Inc.

Legal's:

Cowichan 34 Fed. Wells

Eddy Co. New Mexico

H₂S "Contingency Plan"

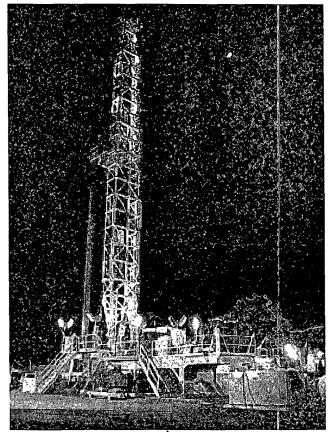



Safety Solutions, LLC 3222 Commercial Dr.

(432) 686-8555 Midland, TX 79701

Legal's:

Cowichan 34 Fed. #1H

Eddy Co. New Mexico

610' FNL & 485' FEL Surface Location

85' FEL Surface Location
Section 34

T-16-S, R-24-E

Lat: N 32.8846791 Long: W 104.5691253 760' FNL & 660' FWL Bottom Hole Location

Section 34

T-16-S, R-24-E Lat: N 32.8841989

Long: W 104.5827215

Legal's:

Cowichan 34 Fed. #2H

Eddy Co. New Mexico

2243' FNL & 100' FEL Surface Location

40001

1880' FNL & 660' FWL Bottom Hole Location

Section 34

T-16-S, R-24-E Lat: N 32.8801967

Long: W 104.5678863

Section 34 T-16-S, R-24-E Lat: N 32.8811204

Long: W 104.5827353

Legal's:

Cowichan 34 Fed. #3H

Eddy Co. New Mexico

1630' FSL & 500' FEL Surface Location

Section 34

T-16-S, R-24-E

Lat: N 32.8763245 Long: W 104.5692022 1880' FSL & 660' FWL Bottom Hole Location

Section 34

T-16-S, R-24-E

Lat: N 32.8769566

Long: W 104.5827538

Legal's:

Cowichan 34 Fed. #4H

Eddy Co. New Mexico

950' FSL & 390' FEL Surface Location

Section 34

T-16-S, R-24-E

Lat: N 32.8744570

Long: W 104.5688501

760' FSL & 660' FWL Bottom Hole Location

Section 34

T-16-S, R-24-E

Lat: N 32.8738782

Long: W 104.5827674

Table of Contents

1. H₂S Contingency Plan

- a. Scope
- b. Objective
- c. Discussion of Plan

II. Emergency Procedures

- a. Emergency Procedures
- b. Emergency Reaction Steps
- c. Simulated Blowout Control Drills

III. Ignition Procedures

- a. Responsibility
- b. Instructions

IV. Training Requirements

V. Emergency Equipment

VI. Check Lists

- a. Status Check List
- b. Procedural Check List

VII. Briefing Procedures

VIII. Evacuation Plan

- a. General Plan
- b. Emergency Phone Lists

IX. Maps and Plats

- a. Location Plat
- b. Map to Location
- c. Radius of Exposure

X. General Information

- a. Drilling/Re-entry Permits
- b. H-9 Permit
- c. H₂S Permissible Limits
- d. Toxicity Table
- e. Physical Properties
- f. Respirator Use
- g. Emergency Rescue

H₂S CONTINGENCY PLAN SECTION

Scope:

This contingency plan provides an organized plan of action for alerting and protecting the public within an area of exposure prior to an intentional release, or following the accidental release of a potentially hazardous volume of hydrogen sulfide. The plan establishes guidelines for all personnel whose work activity may involve exposure to Hydrogen Sulfide Gas (H_2S).

Objective:

Prevent any and all accidents, and prevent the uncontrolled release of H₂S into the atmosphere.

Provide proper evacuation procedures to cope with emergencies.

Provide immediate and adequate medical attention should an injury occur.

Discussion of Plan:

Suspected Problem Zones:

Implementation: This plan, with all details, is to be fully implemented 1000' before drilling into the first sour zone.

Emergency Response Procedure: This section outlines the conditions and denotes steps to be taken in the event of an emergency.

Emergency Equipment and Procedure: This section outlines the safety and emergency equipment that will be required for the drilling of this well.

Training Provisions: This section outlines the training provisions that must be adhered to 1000' before drilling into the first sour zone.

Emergency call list: Included are the telephone numbers of all persons that would need to be contacted, should an H₂S emergency occur.

Briefing: This section deals with the briefing of all persons involved with the drilling of this well.

Public Safety: Public Safety Personnel will be made aware of the drilling of this well.

Check Lists: Status check lists and procedural check lists have been included to ensure adherence to the plan.

General Information: A general information section has been included to supply support information.

EMERGENCY PROCEDURES SECTION

- I. In the event of any evidence of H₂S level above 10ppm, take the following steps immediately:
 - a. Secure breathing apparatus.
 - b. Order non-essential personnel out of the danger zone.
 - c. Take steps to determine if the H₂S level can be corrected or suppressed, and if so, proceed with normal operations.
- II. If uncontrollable conditions occur, proceed with the following:
 - a. Take steps to protect and/or remove any public downwind of the rig, including partial evacuation or isolation. Notify necessary public safety personnel and the New Mexico Oil Conservation Division of the situation.
 - b. Remove all personnel to the Safe Briefing Area.
 - Notify public safety personnel for help with maintaining roadblocks and implementing evacuation.
 - d. Determine and proceed with the best possible plan to regain control of the well. Maintain tight security and safety measures.

III. Responsibility:

- a. The Company Approved Supervisor shall be responsible for the total implementation of the plan.
- b. The Company Approved Supervisor shall be in complete command during any emergency.
- c. The Company Approved Supervisor shall designate a back up Supervisor in the event that he/she is not available.

EMERGENCY PROCEDURE IMPLEMENTATION

I. Drilling or Tripping

a. All Personnel

- i. When alarm sounds, don escape unit and report to upwind Safe Briefing Area..
- ii. Check status of other personnel (buddy system).
- iii. Secure breathing apparatus.
- iv. Wait for orders from supervisor.

b. Drilling Foreman

- i. Report to the upwind Safe Briefing Area.
- **ii.** Don Breathing Apparatus and return to the point of release with the Tool Pusher or Driller (buddy system).
- iii. Determine the concentration of H₂S.
- iv. Assess the situation and take appropriate control measures.

c. Tool Pusher

- i. Report to the upwind Safe Briefing Area.
- **ii.** Don Breathing Apparatus and return to the point of release with the Drilling Foreman or the Driller (buddy system).
- iii. Determine the concentration of H₂S.
- iv. Assess the situation and take appropriate control measures.

d. Driller

- i. Check the status of other personnel (in a rescue attempt, always use the buddy system).
- ii. Assign the least essential person to notify the Drilling Foreman and Tool Pusher, in the event of their absence.
- **iii.** Assume the responsibility of the Drilling Foreman and the Tool Pusher until they arrive, in the event of their absence.

e. Derrick Man and Floor Hands

i. Remain in the upwind Safe Briefing Area until otherwise instructed by a supervisor.

f. Mud Engineer

- i. Report to the upwind Safe Briefing Area.
- ii. When instructed, begin check of mud for pH level and H₂S level.

g. Safety Personnel

- i. Don Breathing Apparatus.
- ii. Check status of personnel.
- iii. Wait for instructions from Drilling Foreman or Tool Pusher.

II. Taking a Kick

- a. All Personnel report to the upwind Safe Briefing Area.
- **b.** Follow standard BOP procedures.

III. Open Hole Logging

- a. All unnecessary personnel should leave the rig floor.
- **b.** Drilling Foreman and Safety Personnel should monitor the conditions and make necessary safety equipment recommendations.

IV. Running Casing or Plugging

- a. Follow "Drilling or Tripping" procedures.
- **b.** Assure that all personnel have access to protective equipment.

SIMULATED BLOWOUT CONTROL DRILLS

All drills will be initiated by activating alarm devices (air horn). One long blast, on the air horn, for ACTUAL and SIMULATED Blowout Control Drills. This operation will be performed by the Drilling Foreman or Tool Pusher at least one time per week for each of the following conditions, with each crew:

Drill #1 Bottom Drilling

Drill #2 Tripping Drill Pipe

In each of these drills, the initial reaction time to shutting in the well shall be timed as well as the total time for the crew to complete its entire pit drill assignment. The times must be recorded on the IADC Driller's Log as "Blowout Control Drill".

Drill No .:

Reaction Time to Shut-In:

minutes,

seconds.

Total Time to Complete Assignment:

minutes,

seconds.

I. Drill Overviews

- a. Drill No. 1 Bottom Drilling
 - i. Sound the alarm immediately.
 - ii. Stop the rotary and hoist Kelly joint above the rotary table.
 - iii. Stop the circulatory pump.
 - iv. Close the drill pipe rams.
 - v. Record casing and drill pipe shut-in pressures and pit volume increases.
- b. Drill No. 2 Tripping Drill Pipe
 - i. Sound the alarm immediately.
 - ii. Position the upper tool joint just above the rotary table and set the slips.
 - iii. Install a full opening valve or inside blowout preventer tool in order to close the drill pipe.
 - iv. Close the drill pipe rams.
 - v. Record the shut-in annular pressure.

II. Crew Assignments

a. Drill No. 1 - Bottom Drilling

i. Driller

- 1. Stop the rotary and hoist Kelly joint above the rotary table.
- 2. Stop the circulatory pump.
- 3. Check Flow.
- 4. If flowing, sound the alarm immediately
- 5. Record the shit-in drill pipe pressure
- 6. Determine the mud weight increase needed or other courses of action.

ii. Derrickman

- 1. Open choke line valve at BOP.
- 2. Signal Floor Man #1 at accumulator that choke line is open.
- 3. Close choke and upstream valve after pipe tam have been closed.
- 4. Read the shut-in annular pressure and report readings to Driller.

iii. Floor Man #1

- 1. Close the pipe rams after receiving the signal from the Derrickman.
- 2. Report to Driller for further instructions.

iv. Floor Man #2

- 1. Notify the Tool Pusher and Operator representative of the H₂S alarms.
- 2. Check for open fires and, if safe to do so, extinguish them.
- 3. Stop all welding operations.
- 4. Turn-off all non-explosions proof lights and instruments.
- 5. Report to Driller for further instructions.

v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all crews.

- 3. Compile and summarize all information.
- 4. Calculate the proper kill weight.
- 5. Ensure that proper well procedures are put into action.

vi. Operator Representative

- 1. Notify the Drilling Superintendent.
- 2. Determine if an emergency exists and if so, activate the contingency plan.

b. Drill No. 2 - Tripping Pipe

i. Driller

- Sound the alarm immediately when mud volume increase has been detected.
- 2. Position the upper tool joint just above the rotary table and set slips.
- 3. Install a full opening valve or inside blowout preventer tool to close the drill pipe.
- 4. Check flow.
- 5. Record all data reported by the crew.
- 6. Determine the course of action.

ii. Derrickman

- 1. Come down out of derrick.
- 2. Notify Tool Pusher and Operator Representative.
- 3. Check for open fires and, if safe to do so, extinguish them.
- 4. Stop all welding operations.
- 5. Report to Driller for further instructions.

iii. Floor Man #1

- 1. Pick up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #2).
- 2. Tighten valve with back-up tongs.

- 3. Close pipe rams after signal from Floor Man #2.
- 4. Read accumulator pressure and check for possible high pressure fluid leaks in valves or piping.
- 5. Report to Driller for further instructions.

iv. Floor Man #2

- 1. Pick-up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #1).
- 2. Position back-up tongs on drill pipe.
- 3. Open choke line valve at BOP.
- 4. Signal Floor Man #1 at accumulator that choke line is open.
- 5. Close choke and upstream valve after pipe rams have been closed.
- 6. Check for leaks on BOP stack and choke manifold.
- 7. Read annular pressure.
- 8. Report readings to the Driller.

v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all of the crews.
- 3. Compile and summarize all information.
- 4. See that proper well kill procedures are put into action.

vi. Operator Representative

- 1. Notify Drilling Superintendent
- 2. Determine if an emergency exists, and if so, activate the contingency plan.

IGNITION PROCEDURES

Responsibility:

The decision to ignite the well is the responsibility of the DRILLING FOREMAN in concurrence with the STATE POLICE. In the event the Drilling Foreman is incapacitated, it becomes the responsibility of the RIG TOOL PUSHER. This decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope of controlling the blowout under the prevailing conditions.

If time permits, notify the main office, but do not delay if human life is in danger. Initiate the first phase of the evacuation plan.

Instructions for Igniting the Well:

- 1. Two people are required for the actual igniting operation. Both men must wear self-contained breathing apparatus and must use a full body harness and attach a retrievable safety line to the D-Ring in the back. One man must monitor the atmosphere for explosive gases with the LEL monitor, while the Drilling Foreman is responsible for igniting the well.
- 2. The primary method to ignite is a 25mm flare gun with a range of approximately 500 feet.
- 3. Ignite from upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best suited for protection and which offers an easy escape route.
- 5. Before igniting, check for the presence of combustible gases.
- 6. After igniting, continue emergency actions and procedures as before.
- 7. All unassigned personnel will limit their actions to those directed by the Drilling Foreman.

Note: After the well is ignited, burning Hydrogen Sulfide will convert to Sulfur Dioxide, which is also highly toxic. Do not assume the area is safe after the well is ignited.

TRAINING PROGRAM

When working in an area where Hydrogen Sulfide (H_2S) might be encountered, definite training requirements must be carried out. The Company Supervisor will ensure that all personnel, at the well site, have had adequate training in the following:

- 1. Hazards and characteristics of Hydrogen Sulfide.
- 2. Physicals effects of Hydrogen Sulfide on the human body.
- 3. Toxicity of Hydrogen Sulfide and Sulfur Dioxide.
- 4. H₂S detection, Emergency alarm and sensor location.
- 5. Emergency rescue.
- 6. Resuscitators.
- 7. First aid and artificial resuscitation.
- 8. The effects of Hydrogen Sulfide on metals.
- 9. Location safety.

Service company personnel and visiting personnel must be notified if the zone contains H₂S, and each service company must provide adequate training and equipment for their employees before they arrive at the well site.

EMERGENCY EQUIPMENT REQUIREMENTS

Lease Entrance Sign:

Should be located at the lease entrance with the following information:

CAUTION – POTENTIAL POISON GAS HYDROGEN SULFIDE NO ADMITTANCE WITHOUT AUTHORIZATION

Respiratory Equipment:

- Fresh air breathing equipment should be placed at the safe briefing areas and should include the following:
- Two SCBA's at each briefing area.
- Enough air line units to operate safely, anytime the H₂S concentration reaches the IDLH level (100 ppm).
- Cascade system with enough breathing air hose and manifolds to reach the rig floor, the derrickman and the other operation areas.

Windsocks or Wind Streamers:

- A minimum of two 10" windsocks located at strategic locations so that they may be seen from any point on location.
- Wind streamers (if preferred) should be placed at various locations on the well site to ensure wind consciousness at all times. (Corners of location).

Hydrogen Sulfide Detector and Alarms:

- 1 Four channel H₂S monitor with alarms.
- Four (4) sensors located as follows: #1 Rig Floor, #2 Bell Nipple, #3 Shale Shaker, #4 Mud Pits.
- Gastec or Draeger pump with tubes.
- Sensor test gas.

Well Condition Sign and Flags:

The Well Condition Sign w/flags should be placed a minimum of 150' before you enter the location. It should have three (3) color coded flags (green, yellow and red) that will be used to denote the following location conditions:

GREEN – Normal Operating Conditions YELLOW – Potential Danger RED – Danger, H₂S Gas Present

Auxiliary Rescue Equipment:

- Stretcher
- 2 100' Rescue lines.
- First Aid Kit properly stocked.

Mud Inspection Equipment:

Garret Gas Train or Hach Tester for inspection of Hydrogen Sulfide in the drilling mud system.

Fire Extinguishers:

Adequate fire extinguishers shall be located at strategic locations.

Blowout Preventer:

- The well shall have hydraulic BOP equipment for the anticipated BHP.
- The BOP should be tested upon installation.
- BOP, Choke Line and Kill Line will be tested as specified by Operator.

Confined Space Monitor:

There should be a portable multi-gas monitor with at least 3 sensors (O_2 , LEL H_2S). This instrument should be used to test the atmosphere of any confined space before entering. It should also be used for atmospheric testing for LEL gas before beginning any type of Hot Work. Proper calibration documentation will need to be provided.

Communication Equipment:

- Proper communication equipment such as cell phones or 2-way radios should be available at the rig.
- Radio communication shall be available for communication between the company man's trailer, rig floor and the tool pusher's trailer.

Communication equipment shall be available on the vehicles.

Special Control Equipment:

- Hydraulic BOP equipment with remote control on the ground.
- Rotating head at the surface casing point.

Evacuation Plan:

- Evacuation routes should be established prior to spudding the well.
- Should be discussed with all rig personnel.

Designated Areas:

Parking and Visitor area:

- All vehicles are to be parked at a pre-determined safe distance from the wellhead.
- Designated smoking area.

Safe Briefing Areas:

- Two Safe Briefing Areas shall be designated on either side of the location at the maximum
 allowable distance from the well bore so they offset prevailing winds or they are at a 180 degree
 angle if wind directions tend to shift in the area.
- Personal protective equipment should be stored at both briefing areas or if a moveable cascade trailer is used, it should be kept upwind of existing winds. When wind is from the prevailing direction, both briefing areas should be accessible.

Note:

- Additional equipment will be available at the Safety Solutions, LLC office.
- Additional personal H₂S monitors are available for all employees on location.
- Automatic Flare Igniters are recommended for installation on the rig.

CHECK LISTS

Status Check List

Note: Date each item as they are implemented.

1.	Sign at location entrance.
2.	Two (2) wind socks (in required locations).
3.	Wind Streamers (if required).
4.	SCBA's on location for all rig personnel and mud loggers.
5.	Air packs, inspected and ready for use.
6.	Spare bottles for each air pack (if required).
7.	Cascade system for refilling air bottles.
8.	Cascade system and hose line hook up.
9.	Choke manifold hooked-up and tested. (before drilling out surface casing.)
10.	Remote Hydraulic BOP control (hooked-up and tested before drilling out surface casing).
11.	BOP tested (before drilling out surface casing).
12.	Mud engineer on location with equipment to test mud for H ₂ S.
13.	Safe Briefing Areas set-up
14.	Well Condition sign and flags on location and ready.
15.	Hydrogen Sulfide detection system hooked -up & tested.
16.	Hydrogen Sulfide alarm system hooked-up & tested.
17.	Stretcher on location at Safe Briefing Area.
18.	2 – 100' Life Lines on location.
19.	1 – 20# Fire Extinguisher in safety trailer.
20.	Confined Space Monitor on location and tested.
21.	All rig crews and supervisor trained (as required).

22. Access restricted for unauthorized personnel.	
23. Drills on H ₂ S and well control procedures.	
24. All outside service contractors advised of potential H ₂ S on the well.	
25. NO SMOKNG sign posted.	
26. H ₂ S Detector Pump w/tubes on location.	
27. 25mm Flare Gun on location w/flares.	
28. Automatic Flare Igniter installed on rig.	

Procedural Check List

Perform the following on each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to insure that they have not been tampered with.
- 3. Check pressure on the supply air bottles to make sure they are capable of recharging.
- 4. Make sure all of the Hydrogen Sulfide detection systems are operative.

Perform the following each week:

- 1. Check each piece of breathing equipment to make sure that they are fully charged and operational. This requires that the air cylinder be opened and the mask assembly be put on and tested to make sure that the regulators and masks are properly working. Negative and Positive pressure should be conducted on all masks.
- 2. BOP skills.
- 3. Check supply pressure on BOP accumulator stand-by source.
- 4. Check all breathing air mask assemblies to see that straps are loosened and turned back, ready for use.
- 5. Check pressure on cascade air cylinders to make sure they are fully charged and ready to use for refill purposes if necessary.
- 6. Check all cascade system regulators to make sure they work properly.
- 7. Perform breathing drills with on-site personnel.
- 8. Check the following supplies for availability:
 - Stretcher
 - Safety Belts and Ropes
 - Spare air Bottles
 - Spare Oxygen Bottles (if resuscitator required)
 - Gas Detector Pump and Tubes
 - Emergency telephone lists
- 9. Test the Confined Space Monitor to verify the batteries are good

BRIEFING PROCEDURES

The following scheduled briefings will be held to ensure the effective drilling and operation of this project:

Pre-Spud Meeting

Date: Prior to spudding the well.

Attendance: Drilling Supervisor

Drilling Engineer
Drilling Foreman
Rig Tool Pushers
Rig Drillers
Mud Engineer
All Safety Personnel

Key Service Company Personnel

Purpose: Review and discuss the well program, step-by-step, to insure complete understanding of

assignments and responsibilities.

EVACUATION PLAN

General Plan

The direct lines of action prepared by SAFETY SOLUTIONS, LLC to protect the public from hazardous gas situations are as follows:

- 1. When the company approved supervisor (Drilling Foreman, Tool Pusher or Driller) determine that Hydrogen Sulfide gas cannot be limited to the well location, and the public will be involved, he will activate the evacuation plan. Escape routes are noted on the area map.
- 2. Company safety personnel or designee will notify the appropriate local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company approved safety personnel that have been trained in the use of the proper emergency equipment will be utilized.
- 4. Law enforcement personnel (State Police, Local Police Department, Fire Department, and the Sheriff's Department) will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- NOTE: Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.
 - 5. After the discharge of gas has been controlled, "Company" safety personnel will determine when the area is safe for re-entry.

See Emergency Action Plan

Emergency Assistance Telephone List

Kent Waller Fire Department: Carlsbad (575) 885-3125 Artesia (575) 746-5050 Hospitals: Carlsbad (575) 887-4121 Artesia (575) 748-3333 Hobbs (575) 392-1979 Dept. of Public Safety/Carlsbad (575) 885-3281 New Mexico Oil Conservation (575) 885-3281 New Mexico Oil Conservation (575) 887-1174 EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432)894-1226 Drilling Superintendent	PUBLIC SAFETY:	9:
Fire Department:	Eddy County Sheriff's Department	(575) 887-7551
Carlsbad Artesia (575) 885-3125 Artesia (575) 746-5050 Hospitals: Carlsbad (575) 748-3333 Hobbs (575) 748-3718 Highway Department (575) 885-3281 New Mexico Oil Conservation U.S. Dept. of Labor (575) 887-1174 EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 884-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432) 894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3705 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 686-8555	Kent Waller	
Artesia (575) 746-5050 Hospitals: Carlsbad (575) 887-4121 Artesia (575) 748-3333 Hobbs (575) 392-1979 Dept. of Public Safety/Carlsbad (575) 748-9718 Highway Department (575) 885-3281 New Mexico Oil Conservation (575) 476-3440 U.S. Dept. of Labor (575) 887-1174 EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432) 894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 894-1226 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 894-9789	Fire Department:	
Carlsbad	Carlsbad	(575) 885-3125
Carlsbad Artesia Artesia (575) 887-4121 Artesia (575) 748-3333 Hobbs (575) 392-1979 Dept. of Public Safety/Carlsbad (575) 885-3281 New Mexico Oil Conservation U.S. Dept. of Labor EOG Resources, Inc. EOG / Midland Company Drilling Consultants: Danny Kiser Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432) 894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 686-8555 Cell (432) 686-8555 Cell (432) 686-8555 Cell (575) 370-5620	Artesia	(575) 746-5050
Artesia	Hospitals:	
Hobbs (575) 392-1979 Dept. of Public Safety/Carlsbad (575) 748-9718 Highway Department (575) 885-3281 New Mexico Oil Conservation (575) 476-3440 U.S. Dept. of Labor (575) 887-1174 EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432) 894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 894-9789	Carlsbad	(575) 887-4121
Dept. of Public Safety/Carlsbad (575) 748-9718 Highway Department (575) 885-3281 New Mexico Oil Conservation (575) 476-3440 U.S. Dept. of Labor (575) 887-1174 EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432) 894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 686-8555 Cell (432) 686-8555	Artesia	(575) 748-3333
Highway Department	Hobbs	(575) 392-1979
New Mexico Oil Conservation	Dept. of Public Safety/Carlsbad	(575) 748-9718
### EOG Resources, Inc. ###################################	Highway Department	(575) 885-3281
EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432)894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 686-8555	New Mexico Oil Conservation	(575) 476-3440
EOG Resources, Inc. EOG / Midland Office (432) 686-3600 Company Drilling Consultants: Danny Kiser Cell (281) 833-2749 Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432)894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 686-8555	U.S. Dept. of Labor	
Company Drilling Consultants: Danny Kiser Cell (281) 833-2749	·	, ,
Company Drilling Consultants: Danny Kiser Cell (281) 833-2749	EOG Resources, Inc.	
Danny Riser Cell (281) 833-2749		Office (432) 686-3600
Danny Kiser Cell (281) 833-2749	·	, ,
Drilling Engineer Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Cell (432) 894-1256 Cell (432) 894-1256 Cell (432) 686-3705 Cell (432) 894-1226 Cell (432) 894-1226 Cell (432) 894-1226 Cell (432) 894-1226 Cell (432) 254-9056 Cell (432) 254-9056 Cell (432) 254-9056 Cell (432) 386-0592 Cell (432) 386-0592 Cell (432) 386-0592 Cell (432) 894-9789 Cell (575) 370-5598 Cell (575) 370-5598 Cell (575) 370-5598 Cell (575) 370-5620 Cell (575) 370-5620 Cell (432) 686-8555 Cell (432) 894-9789 Cell (432) 8		Cell (281) 833-2749
Steve Munsell Office (432) 686-3609 Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432)894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 694-9789	•	,
Cell (432) 894-1256 Operations Manager Joel Pettit Office (432) 686-3705 Cell (432)894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592	Drilling Engineer	
Operations Manager Joel Pettit Office (432) 686-3705 Cell (432)894-1226 Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling / Hobbs Office (575) 397-3311 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cell (432) 894-9789	Steve Munsell	Office (432) 686-3609
Doel Pettit		Cell (432) 894-1256
Doel Pettit	Operations Manager	
Drilling Superintendent Barney Thompson Office (432) 686-3678 Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	Joel Pettit	Office (432) 686-3705
Barney Thompson		Cell (432)894-1226
Cell (432) 254-9056 Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	Drilling Superintendent	
Field Drilling Superintendent Ron Welch Cell (432) 386-0592 McVay Drilling McVay Drilling / Hobbs McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Cliff Strasner Cell (432) 686-8555 Cell (432) 894-9789	Barney Thompson	Office (432) 686-3678
McVay Drilling Office (575) 397-3311 McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Safety Consultants Cell (575) 370-5620 Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789		Cell (432) 254-9056
McVay Drilling Office (575) 397-3311 McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Safety Consultants Cell (575) 370-5620 Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	Field Drilling Superintendent	
McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789		Cell (432) 386-0592
McVay Drilling / Hobbs Office (575) 397-3311 McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789		
McVay Drilling Rig #4 Rig (575) 370-5598 Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	McVay Drilling	
Tool Pusher: Terry Johnson Cell (575) 370-5620 Safety Consultants Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	McVay Drilling / Hobbs	Office (575) 397-3311
Terry Johnson Cell (575) 370-5620 Safety Consultants Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	McVay Drilling Rig #4	Rig (575) 370-5598
Terry Johnson Cell (575) 370-5620 Safety Consultants Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789		
Safety Consultants Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	Tool Pusher:	
Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789	Terry Johnson	Cell (575) 370-5620
Safety Solutions, LLC Office (432) 686-8555 Cliff Strasner Cell (432) 894-9789		
Cliff Strasner Cell (432) 894-9789	Safety Consultants	
•	Safety Solutions, LLC	Office (432) 686-8555
Craig Strasner Cell (432) 894-0341	Cliff Strasner	Cell (432) 894-9789
	Craig Strasner	Cell (432) 894-0341

Affected Notification List

(within a 65' radius of exposure @100ppm)

The geologic zones that will be encountered during drilling are known to contain hazardous quantities of H_2S . The accompanying map illustrates the affected areas of the community. The residents within this radius will be notified via a hand delivered written notice describing the activities, potential hazards, conditions of evacuation, evacuation drill siren alarms and other precautionary measures.

Evacuee Description:

Residents: THERE ARE NO RESIDENTS WITHIN 3000' ROE.

Notification Process:

A continuous siren audible to all residence will be activated, signaling evacuation of previously notified and informed residents.

Evacuation Plan:

All evacuees will migrate lateral to the wind direction.

The Oil Company will identify all home bound or highly susceptible individuals and make special evacuation preparations, interfacing with the local and emergency medical service as necessary.

Toxic Effects of H₂S Poisoning

Hydrogen Sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 PPM, which is .001% by volume. Hydrogen Sulfide is heavier than air (specific gravity -1.192) and is colorless and transparent. Hydrogen Sulfide is almost as toxic as Hydrogen Cyanide and is 5-6 times more toxic than Carbon Monoxide. Occupational exposure limits for Hydrogen Sulfide and other gases are compared below in Table 1. Toxicity table for H_2S and physical effects are shown in Table 2.

Table 1
Permissible Exposure Limits of Various Gases

Common Name	Symbol	Sp. Gravity	TLV	STEL	IDLH
Hydrogen Cyanide	HCN	.94	4.7 ppm	С	
Hydrogen Sulfide	H ₂ S	1.192	10 ppm	15 ppm	100 ppm
Sulfide Dioxide	SO ₂	2.21	2 ppm	5 ppm	
Chlorine	CL	2.45	.5 ppm	1 ppm	
Carbon Monoxide	со	.97	25 ppm	200 ppm	
Carbon Dioxide	CO ₂	1.52	5000 ppm	30,000 ppm	
Methane	CH ₄	.55	4.7% LEL	14% UEL	

Definitions

- A. TLV Threshold Limit Value is the concentration employees may be exposed based on a TWA (time weighted average) for eight (8) hours in one day for 40 hours in one (1) week. This is set by ACGIH (American Conference of Governmental Hygienists) and regulated by OSHA.
- B. STEL Short Term Exposure Limit is the 15 minute average concentration an employee may be exposed to providing that the highest exposure never exceeds the OEL (Occupational Exposure Limit). The OEL for H₂S is 19 PPM.
- C. IDLH Immediately Dangerous to Life and Health is the concentration that has been determined by the ACGIH to cause serious health problems or death if exposed to this level. The IDLH for H_2S is 100 PPM.
- D. TWA Time Weighted Average is the average concentration of any chemical or gas for an eight (8) hour period. This is the concentration that any employee may be exposed based on an TWA.

TABLE 2				
D + 0/	0044	Toxicity Table of H ₂ S		
Percent %	PPM	Physical Effects		
.0001	1	Can smell less than 1 ppm.		
.001	10	TLV for 8 hours of exposure.		
.0015	15	STEL for 15 minutes of exposure.		
.01	100	Immediately Dangerous to Life & Health. Kills sense of smell in 3 to 5 minutes.		
.02	200	Kills sense of smell quickly, may burn eyes and throat.		
.05	500	Dizziness, cessation of breathing begins in a few minutes.		
.07	700	Unconscious quickly, death will result if not rescued promptly.		
.10	1000	Death will result unless rescued promptly. Artificial resuscitation may be necessary.		

PHYSICAL PROPERTIES OF H₂S

The properties of all gases are usually described in the context of seven major categories:

COLOR

ODOR

VAPOR DENSITY

EXPLOSIVE LIMITS

FLAMMABILITY

SOLUBILITY (IN WATER)

BOILING POINT

Hydrogen Sulfide is no exception. Information from these categories should be considered in order to provide a fairly complete picture of the properties of the gas.

COLOR -- TRANSPARENT

Hydrogen Sulfide is colorless so it is invisible. This fact simply means that you can't rely on your eyes to detect its presence. In fact that makes this gas extremely dangerous to be around.

ODOR - ROTTEN EGGS

Hydrogen Sulfide has a distinctive offensive smell, similar to "rotten eggs". For this reason it earned its common name "sour gas". However, H₂S, even in low concentrations, is so toxic that it attacks and quickly impairs a victim's sense of smell, so it could be fatal to rely on your nose as a detection device.

VAPOR DENSITY - SPECIFIC GRAVITY OF 1.192

Hydrogen Sulfide is heavier than air so it tends to settle in low-lying areas like pits, cellars or tanks. If you find yourself in a location where H_2S is known to exist, protect yourself. Whenever possible, work in an area upwind and keep to higher ground.

EXPLOSIVE LIMITS - 4.3% TO 46%

Mixed with the right proportion of air or oxygen, H₂S will ignite and burn or explode, producing another alarming element of danger besides poisoning.

FLAMMABILITY

Hydrogen Sulfide will burn readily with a distinctive clear blue flame, producing Sulfur Dioxide (SO₂), another hazardous gas that irritates the eyes and lungs.

SOLUBILITY – 4 TO 1 RATIO WITH WATER

Hydrogen Sulfide can be dissolved in liquids, which means that it can be present in any container or vessel used to carry or hold well fluids including oil, water, emulsion and sludge. The solubility of H_2S is dependent on temperature and pressure, but if conditions are right, simply agitating a fluid containing H_2S may release the gas into the air.

BOILING POINT – (-76 degrees Fahrenheit)

Liquefied Hydrogen Sulfide boils at a very low temperature, so it is usually found as a gas.

RESPIRATOR USE

The Occupational Safety and Health Administration (OSHA) regulate the use of respiratory protection to protect the health of employees. OSHA's requirements are written in the Code of Federal Regulations, Title 29, Part 1910, Section 134, Respiratory Protection. This regulation requires that all employees who might be required to wear respirators, shall complete a OSHA mandated medical evaluation questionnaire. The employee then should be fit tested prior to wearing any respirator while being exposed to hazardous gases.

Written procedures shall be prepared covering safe use of respirators in dangerous atmospheric situations, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available respirators.

Respirators shall be inspected prior to and after each use to make sure that the respirator has been properly cleaned, disinfected and that the respirator works properly. The unit should be fully charged prior to being used.

Anyone who may use respirators shall be properly trained in how to properly seal the face piece. They shall wear respirators in normal air and then in a test atmosphere. (Note: Such items as facial hair (beard or sideburns) and eyeglass temple pieces will not allow a proper seal.) Anyone that may be expected to wear respirators should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses. Contact lenses should not be allowed.

Respirators shall be worn during the following conditions:

- A. Any employee who works near the top or on the top of any tank unless tests reveal less than 20 ppm of H₂S.
- B. When breaking out any line where H₂S can reasonably be expected.
- C. When sampling air in areas where H₂S may be present.
- D. When working in areas where the concentration of H_2S exceeds the Threshold Limit Value for H_2S (10 ppm).
- E. At any time where there is a doubt as to the H₂S level in the area to be entered.

EMERGENCY RESCUE PROCEDURES

DO NOT PANIC!!!

Remain Calm - Think

- 1. Before attempting any rescue you must first get out of the hazardous area yourself. Go to a safe briefing area.
- 2. Sound alarm and activate the 911 system.
- 3. Put on breathing apparatus. At least two persons should do this, when available use the buddy system.
- 4. Rescue the victim and return them to a safe briefing area.
- 5. Perform an initial assessment and begin proper First Aid/CPR procedures.
- 6. Keep victim lying down with a blanket or coat, etc.., under the shoulders to keep airway open. Conserve body heat and do not leave unattended.
- 7. If the eyes are affected by H₂S, wash them thoroughly with potable water. For slight irritation, cold compresses are helpful.
- 8. In case a person has only minor exposure and does not lose consciousness totally, it's best if he doesn't return to work until the following day.
- 9. Any personnel overcome by H₂S should always be examined by medical personnel. They should always be transported to a hospital or doctor.

EOG RESOURCES, INC. COWICHAN 34 FED 1H

SURFACE USE PLAN OF OPERATION

SHL: 610' FNL & 485' FEL, Unit A, Section 34, T16S-R24E, N.M.P.M., Eddy, NM BHL: 760' FNL & 660' FWL, Unit D, Section 34, T16S-R24E, N.M.P.M., Eddy, NM

1. EXISTING ROADS:

- a. The well site and elevation plat for the proposed well are reflected on the well site layout; Form C-102. The well was staked by Terry Asel, RPL 15079.
- b. All roads into the location are depicted on Exhibit 2, 2a & 2b.
- c. <u>Directions to Locations:</u> From the Intersection of U.S. Hwy 82 & U.S. Hwy 285, Go west on Hwy 82 for 11.4 miles; turn right, go north on County Road No. 95 (Joy Road) for 4.2 miles; turn right, go east on County Road No. 75 for 0.8 miles; turn right, go south on proposed new road for 1.1 miles, turn right and go 295 feet to location.

2. NEW OR RECONSTRUCTED ACCESS ROAD:

- a. The well site layout, Exhibit 2a shows the layout. A new access road will be constructed of compact caliche a distance of 295 feet (See Exhibit 2b).
- b. The maximum width of the road will be 15'. It will be crowned and made of 6' of rolled and compacted caliche. Water will be deflected, as necessary, to avoid accumulation and prevent soil erosion.
- **c.** Surface material will be native caliche. This material will be obtained from a BLM approved pit nearest in proximity to the location. The average grade will be approximately 1%. No cattleguards, gates or fence cuts will be required. No turnouts are planned.

3. LOCATION OF EXISTING WELLS:

Exhibit #3 shows all existing wells within a one-mile radius of this well.

4. LOCATION OF EXISTING AND/OR PROPOSED PRODUCTION FACILITIES:

- a. In the event the well is found to be productive, the necessary production equipment will be installed on location and will serve as a CTB for other wells in Section 34. See diagram.
- b. As a proposed gas well, no electric power is required.
- c. All flow lines will adhere to API standards.
- d. Refer to b above.
- e. If the well is productive, rehabilitation plans are as follows:
 - i. The location shall be reduced as depicted by the Production Facilities

 Layout. The interim reclamation will be performed when optimal conditions

EOG RESOURCES, INC. COWICHAN 34 FED 1H

- exist during the growing season as per the interim reclamation guidelines of the BLM.
- ii. The original topsoil from the well site will be returned to the location. The location will be contoured as close as possible to match the original topography.

5. LOCATION AND TYPE OF WATER SUPPLY:

This location will be drilled using a combination of water mud systems (outlined in the drilling program). The water will be obtained from commercial water stations in the area and hauled to location by transport truck using existing and proposed roads shown in Exhibit 2, 2a and 2b. On occasion, water will be obtained from existing water wells. In these cases where a poly pipeline is used to transport water for drilling purposes, proper authorizations will be secured. If poly pipeline is used to transport fresh water to the location, proper authorization will be secured by the contractor.

6. Construction Materials:

Obtaining Mineral Material – Caliche utilized for the drilling pad and proposed access road will be obtained either from an existing approved pit, or by benching into a hill which will allow the pad to level with existing caliche from cut, or extracted by "flipping" the location. A caliche permit shall be obtained from the BLM prior to excavating any caliche on Federal Lands. Amount will vary for each pad. The procedure for "flipping" the location is as follows:

- 1. An adequate amount of topsoil for final reclamation will be stripped from the well location surface and stockpiled along the edge of the location as shown in the well site layout.
- 2. An area will be used within the proposed well site to excavate caliche.
- 3. The subsoil will then be removed and stockpiled within the footages of the well location.
- 4. Once caliche/mineral material is found, the material will be excavated and stockpiled within the footages of the well location.
- 5. The subsoil will then be placed back in the excavated hole.
- 6. Caliche/mineral material will then be placed over the entire pad and/or road to be compacted.

In the event that caliche is not found on site, a permit will be acquired if caliche is obtained from a BLM approved caliche pit.

7. METHODS OF HANDLING WASTE MATERIALS

EOG RESOURCES, INC. COWICHAN 34 FED 1H

- a. Drill cuttings shall be disposed of in a steel cuttings bin (catch tanks) on the drilling pad (behind the steel mud tanks). The bin and cuttings shall be hauled to an approved cuttings dumpsite.
 - At the site, the cuttings shall be removed from the bin & the bin shall be returned to the drilling site for reuse.
- b. All trash, junk, and other waste material shall be contained in trash cages or trash bins to prevent scattering. When a job is completed, all contents shall be removed and disposed of in an approved landfill.
- c. The supplier, including broken sacks, shall pick up salts remaining after completion of well.
- d. If necessary, a porto-john shall be provided for the rig crews. This equipment shall be properly maintained during the drilling and completion operations and shall be removed when all operations are complete.
- e. Remaining drilling fluids shall be hauled off by transports to a state approved disposal site. Water produced during completion shall be put in storage tanks and disposed of in a state approved disposal. Oil and condensate produced shall be put in a storage tank and sold.
- f. Disposal of fluids to be transported by the following companies:
 - i. RGB TRUCKING
 - ii. LOBO TRUCKING
 - iii. I & W TRUCKING
 - iv. CRANE HOT OIL & TRANSPORT
 - v. JWS
 - vi. QUALITY TRUCKING

8. ANCILLARY FACILITIES:

a. No airstrip, campsite, or other facilities will be built.

9. WELL SITE LAYOUT:

- a. Exhibit 4 shows the proposed location of reserve and sump pits, living facilities and well site layout with dimensions of the pad layout.
- b. Mud pits in the active circulating system shall be steel pits and the catch tanks shall be steel tanks set in shallow sumps behind the steel circulating tanks and sumps.
- c. The area where the catch tanks are placed shall be reclaimed and the surface vegetation restored to as or near the same condition that existed prior to operations.

10. PLANS FOR SURFACE RECLAMATION:

EOG RESOURCES, INC. COWICHAN 34 FED 1H

- a. After concluding the drilling and/or completion operations, if the well is found non-commercial, the caliche shall be removed from the pad and transported to the original caliche pit or used for other drilling locations and roads. The road shall be reclaimed and the surface vegetation restored to as or near the same condition that existed prior to operations. The original topsoil shall again be returned to the pad and contoured, as close as possible, to the original topography.
- b. After the well is plugged and abandoned, the location and road shall be reclaimed and the surface vegetation restored to as or near the same condition that existed prior to operations.
- c. If the well is deemed commercially productive, the catch tank area shall be restored as described in 4(e)(i). Caliche from areas of the pad site not required for operations shall be reclaimed. The original topsoil shall be returned to the area of the drill pad not necessary to operate the well. These unused areas of the drill pad shall be contoured, as close as possible, to match the original topography.

11. SURFACE OWNERSHIP

The surface is owned by the Bureau of Land Management. The surface is multiple use with the primary uses of the region for the grazing of livestock and the production of oil and gas.

12. OTHER INFORMATION:

- a. The area surrounding the well is cactus and tar brush. The topsoil is sandy in nature. The vegetation is moderately sparse with native prairie grass, cactus and shinnery oak. No wildlife was observed but it is likely that deer, rabbits, coyotes, birds and rodents transverse the area.
- b. There are not dwellings within 2 miles of location.
- c. There is no permanent or live water within 0.8 miles of the location.
- d. Cultural Resources Examination will be conducted by Danny Boone and registered with the CFO.

13. BOND COVERAGE:

a. Bond Coverage is Nationwide; Bond No. NM 2308

EOG RESOURCES, INC. COWICHAN 34 FED 1H

COMPANY REPRESENTATIVES:

Representatives responsible for ensuring compliance of the surface use plan are listed below:

Permitting & Land

Mr. Donny G. Glanton Senior Lease Operations ROW Representative EOG Resources, Inc. P.O. Box 2267 Midland, TX 79702 (432) 686-3642 Office (432) 770-0602 Cell

<u>Drilling</u>	Operations
-----------------	-------------------

Mr. Steve Munsell	Mr. Howard Kemp
Drilling Engineer	Production Manager
EOG Resources, Inc.	EOG Resources, Inc
P.O. Box 2267	P.O. Box 2267
Midland, TX 79702	Midland, TX 79702
(432) 686-3609 Office	(432) 686-3704 Office
(432) 894-1256 Cell	(432) 634-1001 Cell

EOG RESOURCES, INC. COWICHAN 34 FED 1H

ATTACHMENT TO EXHIBIT #1

- 1. Wear ring to be properly installed in head.
- 2. Blow out preventer and all fittings must be in good condition, 5000 psi W.P. minimum. Exhibit #1.
- 3. All fittings to be flanged
- 4. Safety valve must be available on rig floor at all times with proper connections, valve to be full bore 5000 psi W.P. minimum.
- 5. All choke and fill lines to be securely anchored especially ends of choke lines.
- 6. Equipment through which bit must pass shall be at least as large as the diameter of the casing being drilled through.
- 7. Kelly cock on kelly.
- 8. Extension wrenches and hand wheels to be properly installed.
- 9. Blow out preventer control to be located as close to driller's position as feasible.
- 10. Blow out preventer closing equipment to include minimum 40-gallon accumulator, two independent sources of pump power on each closing unit installation, and meet all API specifications.

OPERATOR CERTIFICATION

I certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions that presently exist; that I have full knowledge of State and Federal Laws applicable to this operation; that the statements made in this APD package are, to the best of my knowledge, true, and correct; and that the work associated with the operations proposed herein will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of false statements. Executed this 11th day of March 2010.

Name: Donny G. Glanton

Position: Sr. Lease Operations ROW Representative

Address: P.O. Box 2267 Midland, TX 79705

Telephone: <u>432-686-3642</u>

Email: donny_glanton@eogresources.com

Signed: On I. Muy

• PECOS DISTRICT CONDITIONS OF APPROVAL

OPERATOR'S NAME:
LEASE NO.:
WELL NAME & NO.:
SURFACE HOLE FOOTAGE:
BOTTOM HOLE FOOTAGE
LOCATION:
COUNTY:
EOG Resources
NM-108953
Cowichan 34 Fed #1H
610' FNL & 485' FEL
760' FNL & 660' FWL
Section 34, T. 16 S., R 24 E., NMPM
Eddy County, New Mexico

TABLE OF CONTENTS

Standard Conditions of Approval (COA) apply to this APD. If any deviations to these standards exist or special COAs are required, the section with the deviation or requirement will be checked below.

General Provisions
Permit Expiration
Archaeology, Paleontology, and Historical Sites
Noxious Weeds
Special Requirements
Aplomado Falcon
Range Improvement Projects
⊠ Construction
Notification
Topsoil
Closed Loop System
Federal Mineral Material Pits
Well Pads
Roads
Road Section Diagram
☑ Drilling
Casing Depth Change
Logging Requirements
⊠ Production (Post Drilling)
Well Structures & Facilities
☐ Interim Reclamation
Final Ahandonment & Reclamation

I. GENERAL PROVISIONS

The approval of the Application For Permit To Drill (APD) is in compliance with all applicable laws and regulations: 43 Code of Federal Regulations 3160, the lease terms, Onshore Oil and Gas Orders, Notices To Lessees, New Mexico Oil Conservation Division (NMOCD) Rules, National Historical Preservation Act As Amended, and instructions and orders of the Authorized Officer. Any request for a variance shall be submitted to the Authorized Officer on Form 3160-5, Sundry Notices and Report on Wells.

II. PERMIT EXPIRATION

If the permit terminates prior to drilling and drilling cannot be commenced within 60 days after expiration, an operator is required to submit Form 3160-5, Sundry Notices and Reports on Wells, requesting surface reclamation requirements for any surface disturbance. However, if the operator will be able to initiate drilling within 60 days after the expiration of the permit, the operator must have set the conductor pipe in order to allow for an extension of 60 days beyond the expiration date of the APD. (Filing of a Sundry Notice is required for this 60 day extension.)

III. ARCHAEOLOGICAL, PALEONTOLOGY & HISTORICAL SITES

Any cultural and/or paleontological resource discovered by the operator or by any person working on the operator's behalf shall immediately report such findings to the Authorized Officer. The operator is fully accountable for the actions of their contractors and subcontractors. The operator shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery shall be made by the Authorized Officer to determine the appropriate actions that shall be required to prevent the loss of significant cultural or scientific values of the discovery. The operator shall be held responsible for the cost of the proper mitigation measures that the Authorized Officer assesses after consultation with the operator on the evaluation and decisions of the discovery. Any unauthorized collection or disturbance of cultural or paleontological resources may result in a shutdown order by the Authorized Officer.

IV. NOXIOUS WEEDS

The operator shall be held responsible if noxious weeds become established within the areas of operations. Weed control shall be required on the disturbed land where noxious weeds exist, which includes the roads, pads, associated pipeline corridor, and adjacent land affected by the establishment of weeds due to this action. The operator shall consult with the Authorized Officer for acceptable weed control methods, which include following EPA and BLM requirements and policies.

V. SPECIAL REQUIREMENT(S)

Conditions-of-Approval for Drilling in Aplomado Falcon Habitat

- No yuccas or trees over 5 feet in height will be damaged, to protect nesting structures.
- All active raptor nests will be avoided by a minimum of 400 meters by all activities or curtail activities until fledging is complete. All inactive raptor nests will be avoided by a minimum of 200 meters by all activities.
- Well pad size will not exceed 300 ft. x 390 ft (2.69 acres).
- All roads associated with well development will not exceed 30 ft in width
- All unused portions of the well pad associated with producing wells will be reclaimed following the abandoned well protocol below
- Final abandonment protocol: Remove all caliche from well pads and roads that are plugged and abandoned. Reclamation will consist of disking, mulching, seeding with a drill (See seed mixture below), and application of water to encourage seed germination.

Buffalograss (Buchloe dactyloides)	4 lbs/acre
Blue grama (Bouteloua gracilis)	1 lbs/acre
Cane bluestem (Bothriochloa barbinodis)	5 lbs/acre
Sideoats grama (Boutelou curtipendula)	5 lbs/acre
Plains bristlegrass (Setaria macrostachya)	6 lbs/acre

Livestock Watering Requirement

Structures that provide water to livestock, such as windmills, pipelines, drinking troughs, and earthen reservoirs, will be avoided by moving the proposed action.

Cattleguards

An appropriately sized cattleguard(s) sufficient to carry out the project shall be installed and maintained at fence crossing(s). Any existing cattleguard(s) on the access road shall be repaired or replaced if they are damaged or have deteriorated beyond practical use. The operator shall be responsible for the condition of the existing cattleguard(s) that are in place and are utilized during lease operations. A gate shall be constructed on one side of the cattleguard and fastened securely to H-braces.

Fence Requirement

Where entry is required across a fence line, the fence shall be braced and tied off on both sides of the passageway prior to cutting. Once the work is completed, the fence will be restored to its prior condition, or better. The operator shall notify the private surface landowner or the grazing allotment holder prior to crossing any fence(s).

VI. CONSTRUCTION

A. NOTIFICATION

The BLM shall administer compliance and monitor construction of the access road and well pad. Notify the Carlsbad Field Office at (575) 234-5972 at least 3 working days prior to commencing construction of the access road and/or well pad.

When construction operations are being conducted on this well, the operator shall have the approved APD and Conditions of Approval (COA) on the well site and they shall be made available upon request by the Authorized Officer.

B. TOPSOIL

The operator shall stockpile the topsoil in a low profile manner in order to prevent wind/water erosion of the topsoil. The topsoil to be stripped is approximately 6 inches in depth. The topsoil will be used for interim and final reclamation.

C. CLOSED LOOP SYSTEM

Tanks are required for drilling operations: No Pits.

The operator shall properly dispose of drilling contents at an authorized disposal site.

D. FEDERAL MINERAL MATERIALS PIT

Payment shall be made to the BLM prior to removal of any federal mineral materials. Call the Carlsbad Field Office at (575) 234-5972.

E. WELL PAD SURFACING

Surfacing of the well pad is not required.

If the operator elects to surface the well pad, the surfacing material may be required to be removed at the time of reclamation.

The well pad shall be constructed in a manner which creates the smallest possible surface disturbance, consistent with safety and operational needs.

F. ON LEASE ACCESS ROADS

Road Width

The access road shall have a driving surface that creates the smallest possible surface disturbance and does not exceed fourteen (14) feet in width. The maximum width of surface disturbance, when constructing the access road, shall not exceed thirty (30) feet.

Surfacing

Surfacing material is not required on the new access road driving surface. If the operator elects to surface the new access road or pad, the surfacing material may be required to be removed at the time of reclamation.

Where possible, no improvements should be made on the unsurfaced access road other than to remove vegetation as necessary, road irregularities, safety issues, or to fill low areas that may sustain standing water.

The Authorized Officer reserves the right to require surfacing of any portion of the access road at any time deemed necessary. Surfacing may be required in the event the road deteriorates, erodes, road traffic increases, or it is determined to be beneficial for future field development. The surfacing depth and type of material will be determined at the time of notification.

Crowning


Crowning shall be done on the access road driving surface. The road crown shall have a grade of approximately 2% (i.e., a 1" crown on a 14' wide road). The road shall conform to Figure 1; cross section and plans for typical road construction.

Ditching

Ditching shall be required on both sides of the road.

Turnouts

Vehicle turnouts shall be constructed on the road. Turnouts shall be intervisible with interval spacing distance less than 1000 feet. Turnouts shall be constructed on all blind curves. Turnouts shall conform to the following diagram:

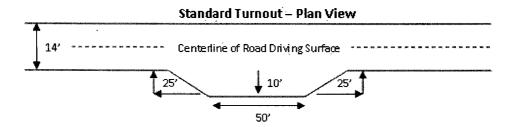


Drainage

Drainage control systems shall be constructed on the entire length of road (e.g. ditches, sidehill outsloping and insloping, lead-off ditches, culvert installation, and low water crossings).

A typical lead-off ditch has a minimum depth of 1 foot below and a berm of 6 inches above natural ground level. The berm shall be on the down-slope side of the lead-off ditch.

Cross Section of a Typical Lead-off Ditch

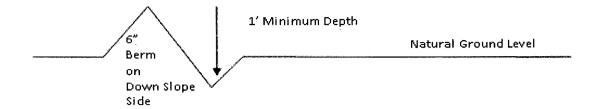

All lead-off ditches shall be graded to drain water with a 1 percent minimum to 3 percent maximum ditch slope. The spacing interval are variable for lead-off ditches and shall be determined according to the formula for spacing intervals of lead-off ditches, but may be amended depending upon existing soil types and centerline road slope (in %);

Formula for Spacing Interval of Lead-off Ditches

Example - On a 4% road slope that is 400 feet long, the water flow shall drain water into a lead-off ditch. Spacing interval shall be determined by the following formula:

400 foot road with 4% road slope:
$$\frac{400'}{4\%}$$
 + 100' = 200' lead-off ditch interval


Culvert Installations

Appropriately sized culvert(s) shall be installed at the deep waterway channel flow crossing.

Public Access

Public access on this road shall not be restricted by the operator without specific written approval granted by the Authorized Officer.

Figure 1 - Cross Sections and Plans For Typical Road Sections

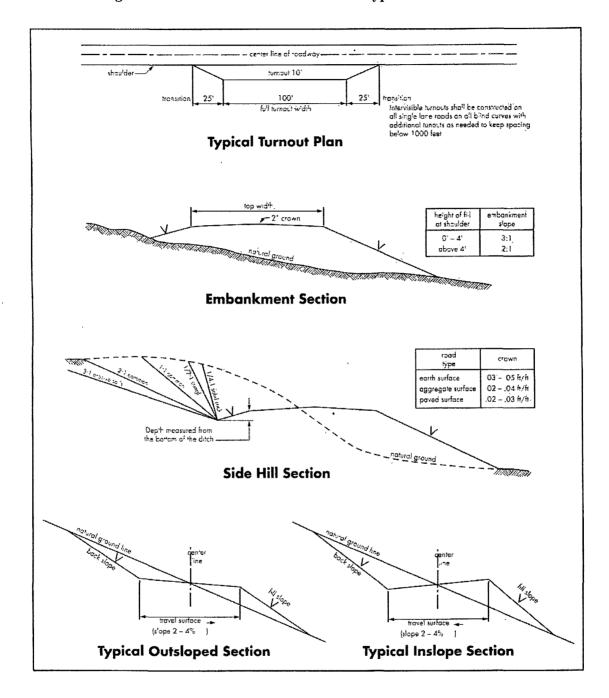

VII. DRILLING

A. DRILLING OPERATIONS REQUIREMENTS

The BLM is to be notified a minimum of 4 hours in advance for a representative to witness:

- a. Spudding well
- b. Setting and/or Cementing of all casing strings
- c. BOPE tests

⊠ Eddy County

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- 1. Although Hydrogen Sulfide has not been reported in this section, it is always a possible hazard. It has been reported in the Township to the east. If Hydrogen Sulfide is encountered, please report measured amounts and formations to the BLM.
- 2. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
- 3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 4. The record of the drilling rate along with the CAL/GR/N well log run from TD to surface will be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies.

B. CASING

Changes to the approved APD casing and cement program require submitting a sundry and receiving approval prior to work. Failure to obtain approval prior to work will result in an Incident of Non-Compliance being issued.

Centralizers required on surface casing per Onshore Order 2.III.B.1.f.

Wait on cement (WOC) time for a primary cement job will be a minimum 18 hours for a water basin, 24 hours in the potash area, or 500 pounds compressive strength, whichever is greater for all casing strings. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. See individual casing strings for details regarding lead cement slurry requirements.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

Possible lost circulation in the Grayburg and San Andres Formations.

- 1. The 8-5/8 inch surface casing shall be set at approximately 500 feet and cemented to the surface.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with a surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
 - b. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Pilot hole is required to have a plug at the bottom of the hole. If two plugs are set, the BLM is to be contacted (575-361-2822) prior to tag of bottom plug, which must be a minimum of 150' in length. Operator can set one plug from bottom of pilot hole to kick-off point and save the WOC time for tagging the first plug.

Centralizers required on horizontal leg, must be type for horizontal service and minimum of one every other joint.

2. The minimum required fill of cement behind the 5-1/2 inch production casing is:

•		1		U
Cement to surface. office.	If cement does not circulate,	contact	the approp	oriate BLM

3. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

C. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi. Operator installing a 5M system but testing as a 3M.
- 3. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. Casing cut-off and BOP installation will not be initiated until the cement has had a minimum of 8 hours setup time for a water basin. The casing shall remain stationary and under pressure for at least eight hours after the operator places the cement. In the potash area, the minimum time is 12 hours and the casing shall remain stationary and under pressure during this time period. Casing shall be under pressure if the operator uses some acceptable means of holding pressure or if the operator employs one or more float valves to hold the cement in place. Testing the BOP/BOPE against a plug can commence after meeting the above conditions plus the BOP installation time.
 - b. The tests shall be done by an independent service company utilizing a test plug.
 - c. The results of the test shall be reported to the appropriate BLM office.
 - d. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
 - e. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug.

f. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the **Wolfcamp** formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

D. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the **Wolfcamp** formation, and shall be used until production casing is run and cemented.

E. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

CRW 040510

VIII. PRODUCTION (POST DRILLING)

A. WELL STRUCTURES & FACILITIES

Placement of Production Facilities

Production facilities should be placed on the well pad to allow for maximum interim recontouring and revegetation of the well location.

Containment Structures

The containment structure shall be constructed to hold the capacity of the entire contents of the largest tank, plus 24 hour production, unless more stringent protective requirements are deemed necessary by the Authorized Officer.

Painting Requirement

All above-ground structures including meter housing that are not subject to safety requirements shall be painted a flat non-reflective paint color Shale Green, Munsell Soil Color Chart # 5Y 4/2

IX. INTERIM RECLAMATION

During the life of the development, all disturbed areas not needed for active support of production operations should undergo interim reclamation in order to minimize the environmental impacts of development on other resources and uses.

Within six (6) months of well completion, operators should work with BLM surface management specialists (Jim Amos: 575-234-5909) to devise the best strategies to reduce the size of the location. Interim reclamation should allow for remedial well operations, as well as safe and efficient removal of oil and gas.

During reclamation, the removal of caliche is important to increasing the success of revegetating the site. Removed caliche that is free of contaminants may be used for road repairs, fire walls or for building other roads and locations. In order to operate the well or complete workover operations, it may be necessary to drive, park and operate on restored interim vegetation within the previously disturbed area. Disturbing revegetated areas for production or workover operations will be allowed. If there is significant disturbance and loss of vegetation, the area will need to be revegetated. Communicate with the appropriate BLM office for any exceptions/exemptions if needed.

All disturbed areas after they have been satisfactorily prepared need to be reseeded with the seed mixture provided below.

Upon completion of interim reclamation, the operator shall submit a Sundry Notices and Reports on Wells, Subsequent Report of Reclamation (Form 3160-5).

X. FINAL ABANDONMENT & RECLAMATION

At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land are restored.

Earthwork for final reclamation must be completed within six (6) months of well plugging. All pads, pits, facility locations and roads must be reclaimed to a satisfactory revegetated, safe, and stable condition, unless an agreement is made with the landowner or BLM to keep the road and/or pad intact.

After all disturbed areas have been satisfactorily prepared; these areas need to be revegetated with the seed mixture provided below. Seeding should be accomplished by drilling on the contour whenever practical or by other approved methods. Seeding may need to be repeated until revegetation is successful, as determined by the BLM.

Operators shall contact a BLM surface protection specialist prior to surface abandonment operations for site specific objectives (Jim Amos: 575-234-5909).

Northern Aplomado Falcon Habitat Seed Mixture

Buffalograss (Buchloe dactyloides)	4 lbs/acre
Blue grama (Bouteloua gracilis)	1 lbs/acre
Cane bluestem (Bothriochloa barbinodis)	5 lbs/acre
Sideoats grama (Boutelou curtipendula)	5 lbs/acre
Plains bristlegrass (Setaria macrostachya)	6 lbs/acre