

Submit 1 copy to appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
NMOCD ARTESIA
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
October 13, 2009

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-02655
1. Type of Well: Oil Well ☐ Gas Well ☒ Other <u>Water Injection</u>		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator <u>Doral Energy Corp</u>		6. State Oil & Gas Lease No. <u>E-7179</u>
3. Address of Operator <u>415 N. Wall Suite 500 Midland, Tx 79701</u>		7. Lease Name or Unit Agreement Name <u>West Arksic Grayburg Unit</u>
4. Well Location Unit Letter <u>K</u> : <u>1650'</u> feet from the <u>South</u> line and <u>1650'</u> feet from the <u>West</u> line Section <u>B</u> Township <u>18S</u> Range <u>28E</u> NMPM <u>NE 1/4</u> County <u>Artesia Co - GR - SA</u>		8. Well Number <u>11</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) <u>3603' GR</u>		9. OGRID Number <u>261198</u>
		10. Pool name or Wildcat <u>Arksic Co - GR - SA</u>

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. P&A as follows:

1. All portions of the well not filled with cement are to be filled with mud.
2. Verify perforations with CCL log. Set CIBP @ estimated 2,190'. Cap CIBP with 35 feet of cement.
3. Determine freepoint on 5 1/2" 15.5 ppt casing. Cut & pull free casing est 1,500'.
4. Spot cement plug from 1,350' - 1,550' (150' above stub & 50' inside stub). 80 sk. Tag plug.
5. Spot 100' cement plug in open hole from 1,100' - 1,200'. 50 sk. WOC & tag plug.
6. Spot 200' cement plug from 400' - 600' (100' above & 100' above casing shoe). Tag plug.
7. Perf casing @ 350' & circ cement to surface. 100 sk.
8. Spot cement plug from 60' to surface. 25 sk.
9. Set P&A marker & cleanup location.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature]

TITLE Vice President of Operations DATE 06/10/10

Type or print name C.M. Bloodworth

E-mail address: martyb@doralenergy.com PHONE: 432-789-1180

For State Use Only

APPROVED BY: [Signature]

TITLE DATE 6/16/2010


Conditions of Approval (if any):

Approval Granted providing work
is complete by 7/16/2010

Lease/Well No. WAGU # 11 WIW
 Location 1650' FSL & 1650' FWL
 K, SEC 8, T18S, R28E
 EDDY CO, NM
 LEASE NO TRACT 5 - E 7179
 API No. 30-015-02655

ELEVATION KB
 GL 3603'
 FIELD ARTESIA; Q.GB,SA
 Spudded 12/12/58
 Completed 01/17/58

LAT
 LONG

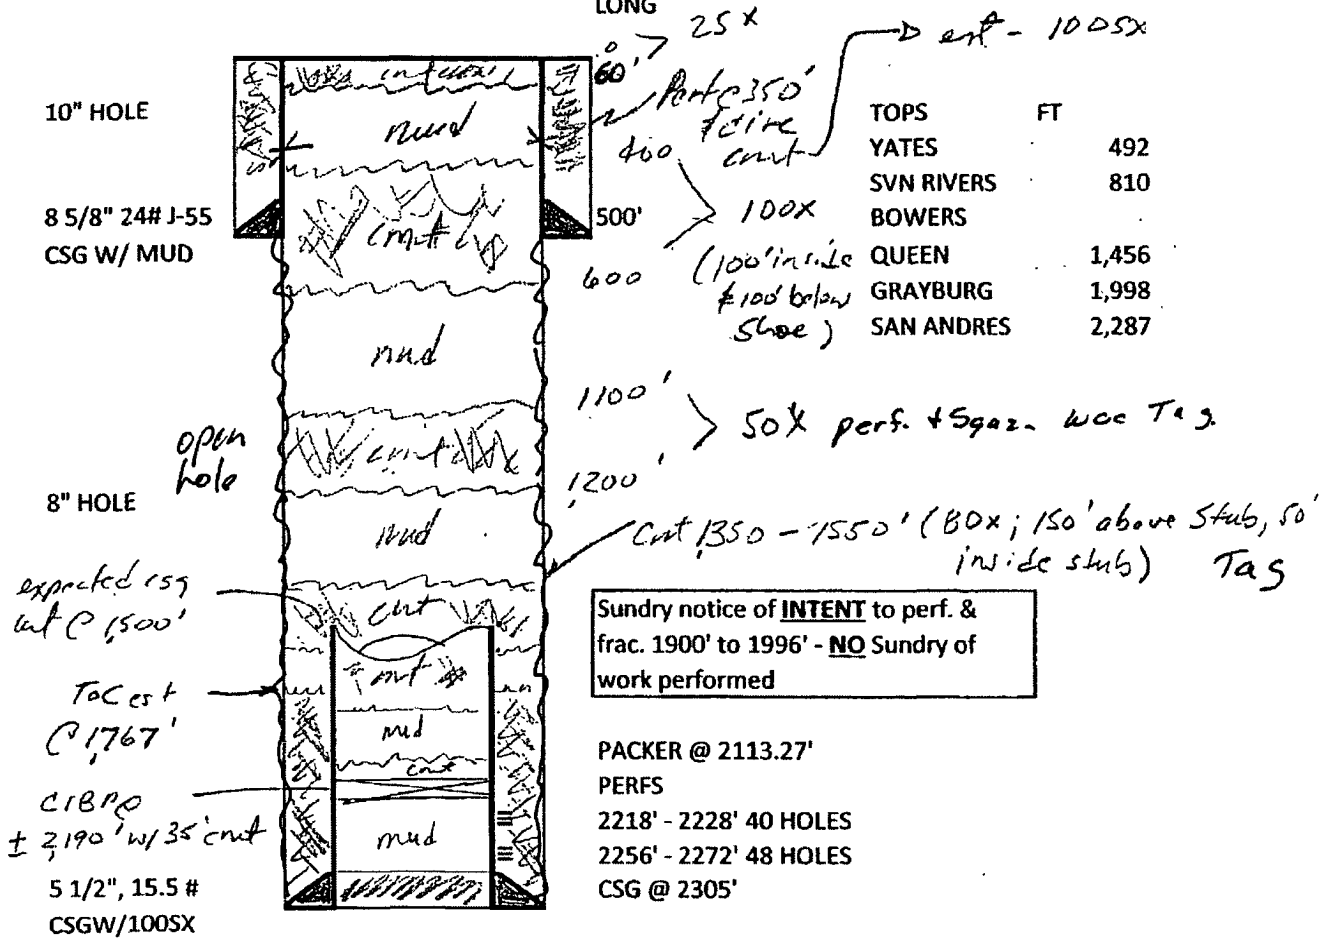

CMR 10/05/09 Proposed P&A
 MB 06/10/10