## 0/0

N.M. Oil Cons. DIV-Dist. 2 1301 W. Grand Avenue

9 2018 UNITED STATES 1301 VV. GIANG AVENUA PRINTED STATES Artesia. NM 88210

FORM APPROVED OMB No 1004-0135 xpires March 31, 2007

AUU BUR	EAN OF LAND MANAGE	MENT A 1651a	, I AIAI O	OZ IO	pires March 31, 2007		
BUREAN OF LAND MANAGEMENT AT COOK, 1919 OOC SUNDAY DETICES AND REPORTS ON WELLS NMOC be not use this form for proposals to drill or re enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				5 Lease Serial No	5 Lease Serial No NA 0284972a 6. If Indian, Allottee or Tribe Name		
				6 If Indian Allotte			
abandoned well. Use Form 3160-3 (APD) for such proposals.					6. If mulan, Allottee of Thoe Name		
*	CATE - Other instr	uctions on revers	e side	7. If Unit or CA/Ag	reement, Name and/or No		
1 Type of Well  X Oil Well Gas Well Other					8. Well Name and No.		
Name of Operator				s. luckey lake to	:#1 <b>C</b>		
TANDEM ENERGY CORPORATION							
3b Phone No (include area				e) 30-005-60303			
11490 WESTHEIMER, STE 1000 HC	325-573-0705	<del></del>	10. Field and Poo	I, or Exploratory Area			
Location of Well (Footage, Sec. T., R., M.	, OR Survey Description)						
				chaves CO, NM	chaves CO, NM		
980' FNL, 330' FWL, SEC 27							
12. CHECK APPROPRI	ATE BOX(ES) TO II	NDICATE NATU	RE OF NOT	ICE, REPORT, OR	OTHER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION						
	Acidize	Deepen	Pr	oduction (Start/Resume)	Water Shut-Off		
X Notice of Intent	Alter Casing	Fracture Treat	Re	eclamation	Well Integrity		
		<del>     </del>	一		$\Box$		
Subsequent Report	Casing Repair	New Construc	<del>  </del>	ecomplete	Other		
	Change Plans	X Plug and Aban	don Te	mporarily Abandon	rily Abandon		
Final Abandonment Notice	Convert to Injectio	n Plug Back	w	ater Disposal			
If the proposal is to deepen directionally or rec Attach the Bond under which the work will be following completion of the involved operation testing has been completed. Final Abandonin determined that the site is ready for final inspection.  1. MIRU - PLUGGING EQUIPMEN 2. ND WELL HEAD - NU BOP 3. RIH SET CIBP @ 1693' SPOT 2 4. PERF AND SPOT 2 SACKS @ 5 PERF AND SPOT 2 SACKS @ 7. CUT OFF WELLHEAD, INSTAL	performed or provide the Bond is if the operation results in a minent Notices shall be filed only a otton)  T AND STEEL PITS  SSACKS @ 1747' - CIR(1747' - (TAG))  TOTAL	No on file with BLM/BIA. Re nultiple completion or recomple after all requirements, including CULATE PLUGGING I	equired subsequent netion in a new interval preclamation, have but the preclamation of	reports shall be filed within 30 at a Form 3160-4 shall be filed been completed, and the operator of the completed of the operator of the	days once ir has		
			<u> </u>	7 2010	<u> مُحَادِينِ بِيَنْ الْكَانِ بَسُمُ سُمِّعِينَا</u>		
I hereby certify that the foregoing is true Name (Printed/Typed)	and correct	T			<u> </u>		
MARK HOSKINS		Title	AGENT				
Signature Mil	Hol		July 14, 2010	, )			
Oignature .	7:110 00400	FOR FEDERAL OR ST					

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willbully to make to any department or agency of the United


SEE ATTACHED FOR CONDITIONS OF APPROVAL

which would entitle the applicant to conduct operations thereon

Conditions of approval, if any, are attached Approval of this notice does not warrant or

Well Name API #30-005-60303 south lucky lake queen unit # 1C

7/15/2010

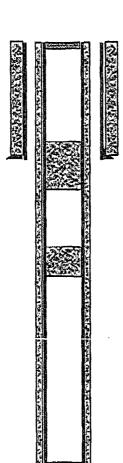

25 SX @ 60' TO SURFACE'

25 SX @ 353' Surface Casing @ 303'

25 SACKS @ 1247'

25 SX TOP OF CIBP @ 1747'

Company Name:

TANDEM

## BUREAU OF LAND MANAGEMENT

Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action.
- 2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours call (575) 627-0205 or after office hours call (575) 420-2832. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. Monument: Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.