Form 3160-5 (ugust 2007)

(Instructions on page 2)

DEPARTMENT OF THE INTERIORCD-ARTESIA BUREAU OF LAND MANAGEMENT UNITED STATES


FORM APPROVED OMB No 1004-0137 Expires. July 31, 2010

5. Lease Serial No. NMLO029419B


6. If Indian, Allottee or Tribe Name

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals

abandoned well.								
SUBMIT IN TRIPLICATE – Other instructions on page 2.					7. If Unit of CA/Agreement, Name and/or No. NMNM71030X			
1. Type of Well					8. Well Name and No.			
Oil Well Gas W	ector			SKELLY UNIT #96				
2. Name of Operator SANDRIDGE EXPL AND PROD. LLC					9. API Well No. 30-015-05424			
3a. Address 3b. Phone No 2130 W. BENDER 575-738-173			,)	10. Field and Pool or Exploratory Area GRAYBURG JACKSON; SR-Q-G-SA			
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description)					11. Country or Parish, State			
JLF SEC 27 T17S R31E 1980' FNL 1980' FWL . '					EDDY			
12. CHEC	K THE APPROPRIATE BO	X(ES) TO INDICA	TE NATURE (OF NOTIC	CE, REPORT OR OTHER DA	ATA		
TYPE OF SUBMISSION	TYPE OF ACT				ION			
Notice of Intent	Acidize Alter Casing	Deepen Fracture T	reat 'reat	_	uction (Start/Resume)		Shut-Off ntegrity	
Subsequent Report	Casing Repair Change Plans	☐ New Cons ✓ Plug and A			mplete oorarily Abandon	Other	,	
Final Abandonment Notice	Convert to Injection	Plug Back		☐ Wate	r Disposal		· · · · · · · · · · · · · · · · · · ·	
 RIH & tag @2335', cap w/5 sx c Perf & squeeze @2125' w/30 sx Perf & squeeze @1750' w/30 sx Perf & squeeze @776' w/30 sx c circulate class C cement to surface. Set surface plug 50' to surface v Cut off wellhead and anchors, in 	class C cement, leaving particles C cement, leaving particles C cement, leaving to the coutside 5 1/2"csg. Work class C cement.	olug in casing @16 p of plug @676'.(DC & TAG	550'. (base of Top of Salt)	salt) WC	OC & TAG	nulus, w	vill pump 125 sxs &	
\			CON	DITI	ONS OF APPR	QVA	ECFIVED	
						"	OCT 06 2010	
) 	1710N 8000F01ID#					1		
	ATION PROCEDURE Attached			St A	UBJE CT TO LIKE PPROVAL BY ST.	AHP	OCD ARTESI	
4 I hereby certify that the foregoing is to	rue and correct. Name (Printe	d/Typed)		· · · · · ·				
Colleen Robinson			Title Regulatory Analyst					
Signature altobras	Da	Date 08/25/2010						
	THIS SPACE	FOR FEDERA	L OR ST	TE OF	APPROVED	1		
Approved by conditions of approval, if any, are attached that the applicant holds legal or equitable to intitle the applicant to conduct operations	itle to those rights in the subject thereon	ct lease which would	Office	<u>, L.</u>	OCT 5 2010Pate Dustin Winkler			
Title 18 U.S.C. Section 1001 and Title 43 actitious or fraudulent statements or repre			knowingly and	willially.	ARLSBAD FIELD OFFICE	ency of t	the United States any false,	

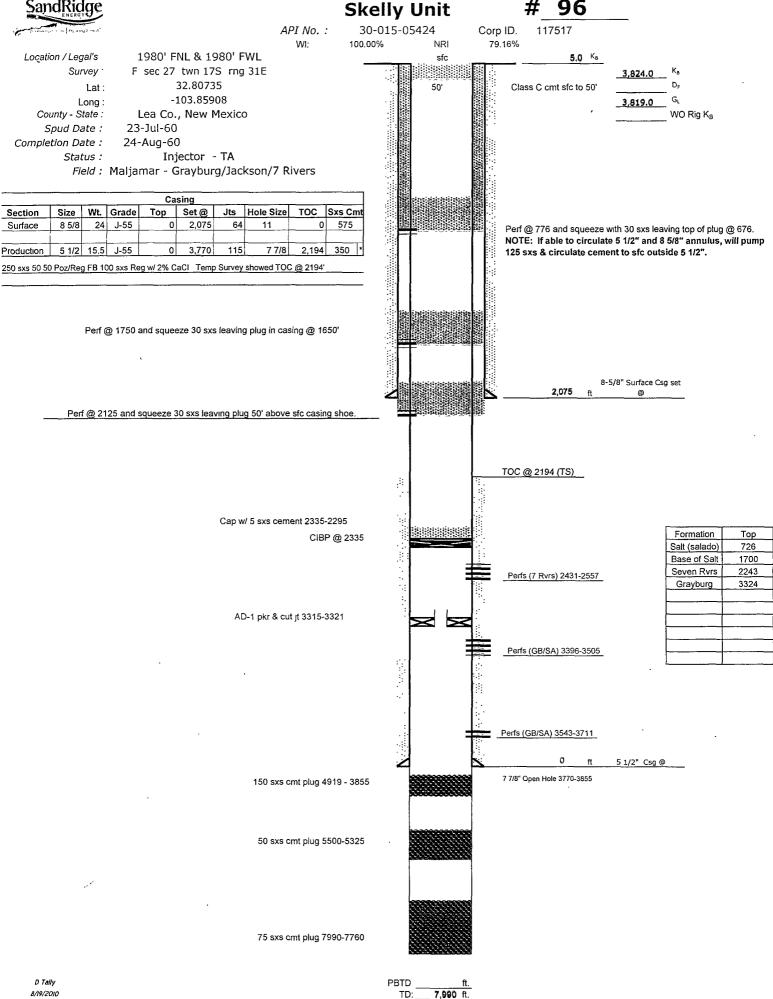

8/19/2010 8/30/2010

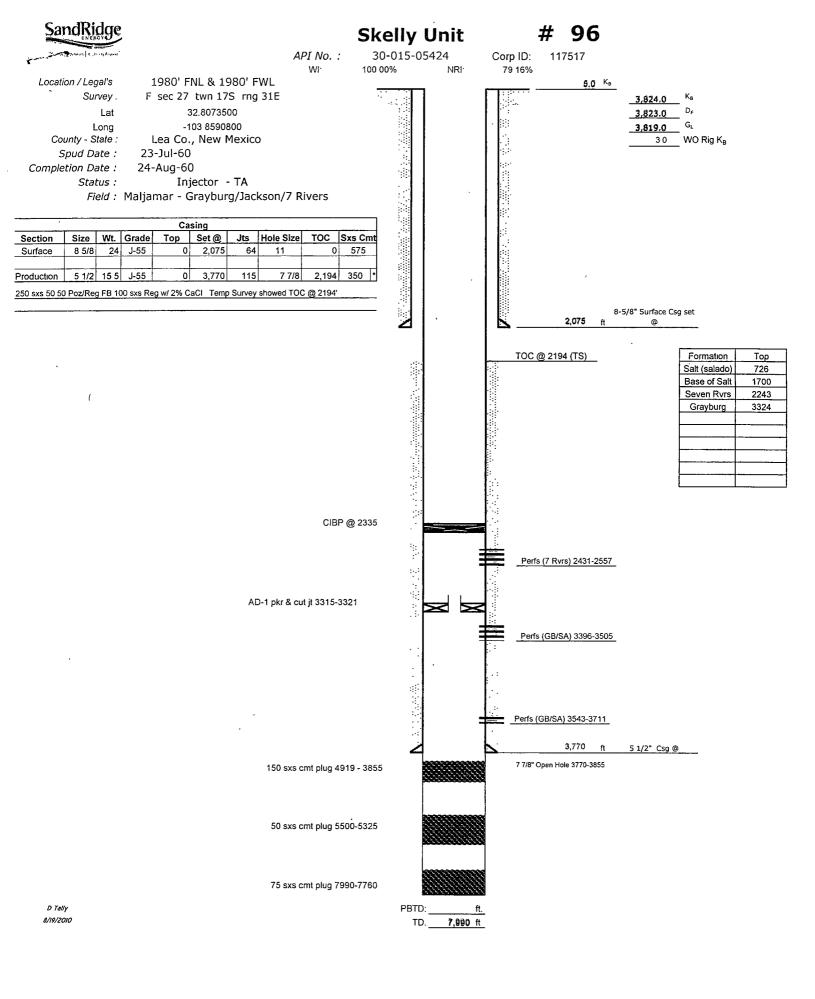

SandRidge E&P, LLC NMLC-029419-B: Skelly Unit #96 API: 30-015-05424 Eddy County, New Mexico

RE: Plugging and Abandonment Requirements, Conditions of Approval

H2S monitoring equipment is to be on site. All plugs, except surface, to be a minimum of 25sx.

- 1. Minimum 35' bailed or 25sx pumped Otherwise OK (Perfs)
- 2. Tag at 2005' or shallower Otherwise OK (Casing shoe)
- 3. Tag at 1630' or shallower Otherwise OK (BOS)
- 4. Tag at 666' or shallower Otherwise OK (TOS)
- 5. If cement did not circulate to surface, perf will be required Otherwise OK (Surface)
- 6. Verify cement to surface in all annuluses. Ground level dry hole marker required at this location: **Requirements** Attached Otherwise OK
- 7. Submit subsequent report to the BLM.

See attached standard COAs.

DHW 092710

Requirements for ground level dry hole markers <u>Well Identification Markers</u> Conditions of Approval (COA)

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers be placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

- 1. An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.
- 2. Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum ¼ inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
- 3. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engraved in a minimum 3/8 inch tall letter or number.
- 4. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
 - a. First row: Operators name
 - b. Second row: Well name and number
 - c. Third row: Legal location to include ¼ ¼, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the ¼ ¼ (example: 1980 FNL 1980 FWL) being on the top row.
 - d. Fourth row: Lease Number and API number.
 - i. Example marker plate: (attached)

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Any plug that requires a tag will have a minimum WOC time of 4 hours.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified when the wellhead is cut off to verify that cement is to surface in the casing and all annuluses.** The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

DHW 112309



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos

Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Terry Gregston

Environmental Protection Specialist 575-234-5958

Bobby Ballard

Environmental Protection Specialist

575-234-2230

Randy Rust

Natural Resource Specialist

575-234-5943

Linda Denniston

Environmental Protection Specialist

575-234-5974

Jennifer Van Curen

Environmental Protection Specialist

575-234-5905

Justin Frye

Environmental Protection Specialist

575-234-5922

Cody Layton

Natural Resource Specialist

575-234-5959

Trishia Bad Bear

Natural Resource Specialist

575-393-3612

Todd Suter

Surface Protection Specialist

575-234-5987

Doug Hoag

Civil Engineering Technician

575-234-5979

Tanner Nygren

Natural Resource Specialist

575-234-5975

John Fast

Natural Resource Specialist

575-2345996