

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

VISION

FORM APPROVED
2834 Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well <input type="checkbox"/> Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other	5. Lease Designation and Serial No. NM-19837
2. Name of Operator McCellan Oil Corp.	6. If Indian, Allottee or Tribe Name
3. Address and Telephone No. P.O. Drawer 730 Roswell, NM 88202 505-622-3200	7. If Unit or CA, Agreement Designation CA-NM061P3586C341
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 660 FSL & 660 FWL Sec 9 T4s R27e	8. Well Name and No. MOC White Fed. Com #1
	9. API Well No. 30-005-00216
	10. Field and Pool, or Exploratory Area W/C Mississippi
	11. County or Parish, State Chaves County NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water


(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) Set CIBP on w/L @ 6225' + 35' cement(w/bailer)
- 2) Circulate hole with brine gell
- 3) Spot 25 sxs class "C" @ 4752 - 4384'
- 4) Perf 4 sq holes @ 1535'
- 5) Spot 35 sxs class "C" + 3% CaCl2 @ 1553 - 1163'. Displace 4 bbls into perfs
WOC 2 hours Tag plug @ 1405'
- 6) Cut off 4-1/2 casing and 8-5/8" head
- 7) spot 15 sxs @ 50' to surface
- 8) Install marker, clean location and cover pit

Completed 6/17/98

*Post ID-2
7-24-98
PFA*

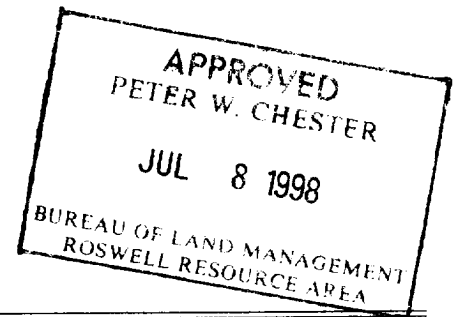

14. I hereby certify that the foregoing is true and correct
Signed William L. Honen Title Agent Date 06/18/98
(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any: