


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

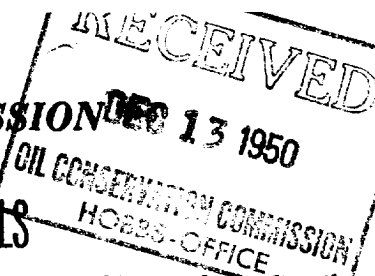

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL	X	REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL			

December 12, 1950

Lubbock, Texas

Date

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the DeKalb Agricultural Assn., Inc. & Vincent & Welch, Inc. J. P. White Co. Well No. 1-J in the Company or Operator Lease NW/4, SE/4 of Sec. 7, T. 10-S, R. 29-E, N. M. P. M., Wildcat Field, Chaves County.

The dates of this work were as follows: November 27, - December 8, 1950

Notice of intention to do the work was (~~was~~) submitted on Form C-103 on November 27 19 50 and approval of the proposed plan was (~~was~~) obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

Perf. 7982-8030' w/192 shots. Wash w/500 gal. acid. Swabbed in, gaged 4.5 M.M gas first day; gaged .5 MM gas fifth day. Shut in Pressure, 1200 psi down to 650 psi fifth day. Set Baker Bridge Plug @ 7950' w/15' cement cap. Perf. 7550'-7620' w/280 holes. Acidize w/2000 gal. Kicked off w/ swab. Flow started at rate of 2 MM gas decreased to 100 M gas second day. Set Baker Bridge Plug @ 7500' w/15' cement cap. Perforate 7410'-7460' w/200 holes. Acidize w/1000 gal. Flowed gas and load water for 5 hrs. - died. Swabbed dry. Re-acidized w/2000 gal. Swabbed dry w/ only slight show of gas. Set Baker Bridge Plug @ 7300' w/15' cement cap. Perforate 7205'-7240' w/140 holes. Acidize w/2000 gal. Swab dry w/only slight show of gas. Shut down waiting on orders.

Witnessed by _____

Name

Company

Title

Subscribed and sworn before me this 12

day of December 19 50

Clelia Parker

CLELIA PARKER

Notary Public

I hereby swear or affirm that the information given above is true and correct.

Name P. D. Miller

Position Production Superintendent

Representing DeKalb Agricultural Assn., Inc.

Company or Operator

My commission expires June 1951

Address 306 Lubbock Nat'l Bldg. - Lubbock, Texas

Remarks:

DEC 13 1950

Proy. Yorkhacegk
Name _____
Title _____

