

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

NEW OIL CONS. COMMISSION  
DRAWER DD  
SUBMIT IN TO LOCATE  
(Other instruc on re-  
lease) NM 00210

20-005-10021

Expires August 31, 1985

LEASE DESIGNATION AND SERIAL NO.

Fed. Lc-068127

IF INDIAN, ALLOTTEE OR TRIBE NAME

UNIT AGREEMENT NAME

Federal

FARM OR LEASE NAME

Federal

WELL NO.

2

FIELD AND POOL, OR WILDCAT

Linda San Andres

SEC., T., R., M., OR B.L. AND SURVEY OR AREA

Sec. 33, T6S, R26E

COUNTY OR PARISH

Chaves

STATE

New Mex.

SUNDRY NOTICES AND REPORTS ON WELLS  
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL  GAS WELL  OTHER

2. NAME OF OPERATOR  
H. E. Prince

3. ADDRESS OF OPERATOR  
Box 129, Roswell, New Mexico, 88201

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)  
At surface

330' F.S.L. & 2310' F. W. L.

14. PERMIT NO.

15. ELEVATIONS (Show whether at surface or at depth)  
3614 G. R.

RECEIVED BY  
FEB -9 1987  
P. C. D.  
ARTESIA, OFFICE

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF  FULL OR ALTER CASING   
FRACTURE TREAT  MULTIPLE COMPLETE   
SHOOT OR ACIDIZE  ABANDON   
REPAIR WELL  CHANGE PLANS   
(Other)


SUBSEQUENT REPORT OF:

WATER SHUT-OFF  REPAIRING WELL   
FRACTURE TREATMENT  ALTERING CASING   
SHOOTING OR ACIDIZING  ABANDONMENT   
(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Plugged well as follows:  
Ran 2" tubing to 1075' tagged bottom.  
Pumped 25 sacks of cement from bottom and tagged top of plug at 785' inside of 4 1/2" oil string.  
Pumped mud from 785' to 150' 9# per gallon.  
Tagged mud at 150' and pumped cement to surface inside and outside of 4 1/2" oil string.  
Set 4" X 5" marker with legal description welded on it.  
Cleaned and removed debris from well site.

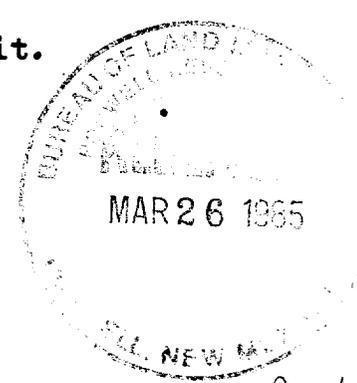

Post FD-2  
6-12-87  
P & A

18. I hereby certify that the foregoing is true and correct  
SIGNED H. E. Prince TITLE Operator DATE 3/23/85

(This space for Federal or State office use)  
APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY: Approved as to plugging of the well bore. Liability under bond is retained until surface restoration is completed.

APPROVED  
PETER W. CHESTER  
JAN 30 1987  
BUREAU OF LAND MANAGEMENT  
ROSWELL RESOURCE AREA

\*See Instructions on Reverse Side

15413235  
10-11  
C. L. G.  
1911