

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87504

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87504


C151
OP

Form C-103

Revised March 25, 1999

WELL API NO. 30-005-61286
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. L6773

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-103) FOR PROPOSALS.)		7. Lease Name or Unit Agreement Name: Eastland State
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other	8. Well No. 2	9. Pool name or Wildcat Four Ranch Wolfcamp
2. Name of Operator The Eastland Oil Company /		
3. Address of Operator P.O. Box 3488 Midland, TX 79702		
4. Well Location Unit Letter <u>K</u> <u>1980</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>13</u> Township <u>9-S</u> Range <u>26-E</u> NMPM County <u>Chaves</u>		
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3836 KB		

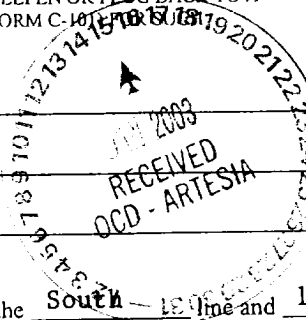

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Squeeze off. W.C. Perfs: ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1-2-4-03 Move in Well Service unit. Rig up wireline Set blanking plug. Get off Packer. Pump 50 bbls. PW to kill well. TOOH, TIH w/retrievable BP and set at 5855', spot 2 sacks sand on plug. TOOH, TIH w/ retainer and set at 5241'. Load hole & establish rate a 5BPM@ 260 lbs. pump 250 gals. of Super flush 100, 50 sacks of premium plus & 100 sacks of premium plus neat, squeezed perfs; to 4000lbs. Reversed out 2.75 bbls. cmt. to pit. TOOH
- 1-6-8-03 TIH tagged cmt @ 5190', drill cmt & retainer to 5297'. Pressure test csg. to 500 lbs. Test OK, wash sand off BP & pull. Run in hole with wireline to pull Blanking plug, put lower zone back on production at 3:00 P.M. 1-8-03.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Travis Reed TITLE Agent DATE 1-14-03
Type or print name Travis Reed Telephone No 915-683-6293
(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any:

Accepted for record - NMOCB