
·~	C151
Submit 3 Copies To Appropriate District State of New Mexico	Form C-103
Office District I Energy, Minerals and Natural Resources	Revised March 25, 1999
1625 N. French Dr., Hobbs, NM 88240 District II	WELL API NO. 30005-61603
811 South First, Artesia, NM 88210 OIL CONSERVATION DIVISION	5. Indicate Type of Lease
District III 2040 South Pacheco 1000 Rio Brazos Rd., Aztec, NM 87410	STATE FEE
District IV 2040 South Pacheco, Santa Fe, NM 87505	6. State Oil & Oas Lease No.
	7. Lease Name or Unit Agreement Name:
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name of Offit Agreement Name:
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	Twin Lakes San Andres Unit
1. Type of Well:	
Oil Well Gas Well Other Injection	7. Well No.
2. Name of Operator Concho Oil & Gas Corp.	93
3. Address of Operator	8. Pool name or Wildcat
110 W. Louisiana Ste 410; Midland, Tx 79701	Twin Lakes; San Andres (Assoc)
4. Well Location	
Unit Letter C: 330 Feet from the North line and 1650 feet	from the <u>West</u> line
Section 7 Township 9S Range 29E	NMPM Chaves County
Section 7 Township 9S Range 29E 10. Elevation (Show whether DR, RKB, RT, GR, or section)	
3929 GR	
11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
1.2	BSEQUENT REPORT OF: RK \to \to ALTERING CASING \to \text{
/	
TEMPORARILY ABANDON	RILLING OPNS. PLUG AND ABANDONMENT
PULL OR ALTER CASING ☐ MULTIPLE ☐ CASING TEST	
COMPLETION CEMENT JOB	
OTHER: OTHER:	
12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.	
of recompliation.	
Concho Oil & Gas Corp. respectfully request approval to plug & abandon the Twin Lakes San Andres Unit No. 93 according to the following procedure:	
1. Notify NMOCD Artesia 24 hrs prior to commencement of procedure.	
2. Set 150' plug @ 2555-2705' - TA9	RECEIVED OCD - ARTESIA 29
3. Circ hole w/ mud. ₁ 900' - 7000'	
4. Set 100' plug @ 1960-206 0'.	18 18 18 18 18 18 18 18 18 18 18 18 18 1
5. Set 100' plug @ 1560-1660'. 6. Cut csg @ 870' & POOH.	RECEIVED S
7. Set 100' plug @ 820-920'. WOC & tag.	RECEIVED 22 OCD - ARTESIA 200
8. Circ cmt from 226' to surface.	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\
Cut off wellhead & install dry hole marker.	999071
	1086.
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
XXIII XAA	
SIGNATURE TITLE Production Ar	DATE 10-18-01
Type or print name Terri Stathen Telephone No. 9	5/68 2 -7443
(This space for State use)	
APPPROVED BY TITLE	DATE 10-31-01
Conditions of approval, if any:	1

TLSAU #93

Formerly - Moonshine 7 #12

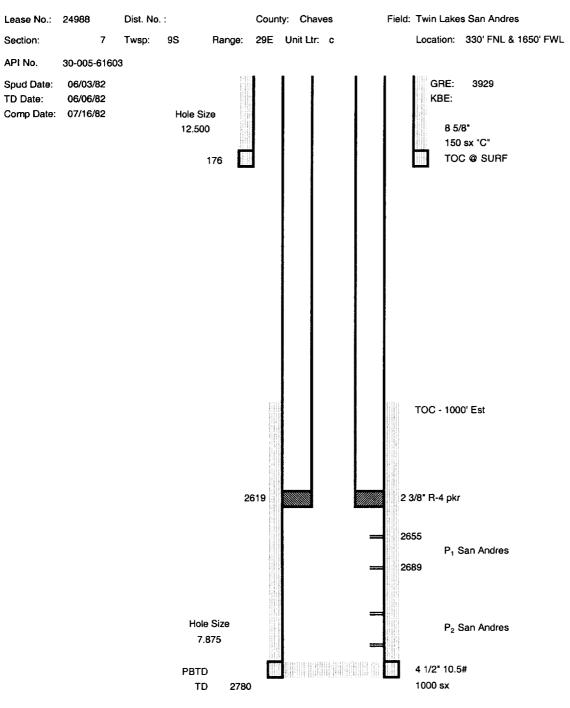

Original Perf Details:

P1: 2655, 56, 57, 61, 62, 63

5000 gals 20% acid

Jan-88

Add P1: 2670, 71, 72, 73, 74, 75, 76, 81, 82, 85, 86, 89

No treatment