


STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input checked="" type="checkbox"/>
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

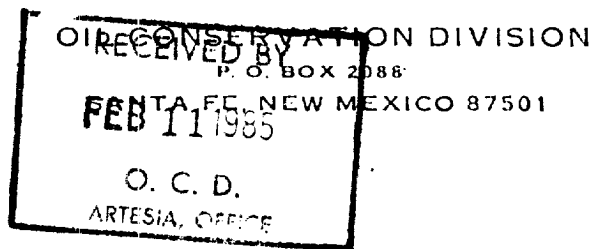

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Yates Petroleum Corporation	8. Farm or Lease Name Ramon "ABA"
3. Address of Operator 207 South 4th St., Artesia, NM 88210	9. Well No. 1
4. Location of Well UNIT LETTER <u>H</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>10</u> TOWNSHIP <u>1S</u> RANGE <u>19E</u> NMPM.	10. Field and Pool, or Wildcat Wildcat <u>ABA</u>
15. Elevation (Show whether DF, RT, GR, etc.) 5241' GR	12. County Lincoln

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <u>Plug back</u> <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 4200'. Set CIBP at 2870' w/35' of cement on top. WIH w/casing cutter to 2150'. Shot casing. Tried to pull, would not come. Shot casing at 2040' and tried to pull casing, would not come. Shot casing at 1840', tried to pull casing, would not come. Shot casing at 1000'. Pulled and laid down 25 joints of 4½" casing. Unable to get back in 4½" to spot plugs. 11:45 AM 2-8-85, Nelson Muncy, YPC, received verbal permission from Larry Brooks, NMOCD, Artesia, to spot plug from 1000' back to approximately 800' and tag.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Supervisor DATE 2-8-85

APPROVED BY [Signature] TITLE OIL AND GAS INSPECTOR DATE FEB 18 1985

CONDITIONS OF APPROVAL, IF ANY: