

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
NEW MEXICO OFFICE  
Alamosa, NM 88210


Expires August 31, 1985  
5. LEASE DERIVATION AND SERIAL NO.

LC-062029

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ WIW
2. NAME OF OPERATOR  
Marbob Energy Corporation ✓
3. ADDRESS OF OPERATOR  
P.O. Drawer 217, Artesia, N.M. 88210
4. LOCATION OF WELL (Report location clearly and in accordance with State Agency Office. See also space 17 below.)  
At surface  
1325 FSL 1325 FWL

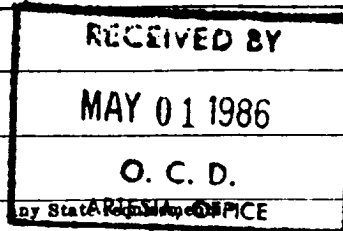

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME  
Brainard Tr. 4
9. WELL NO.  
9
10. FIELD AND POOL, OR WILDCAT  
Turkey Track SR Qn Grbg
11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA  
Sec. 34-T18S-R29E

14. PERMIT NO.
15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
3420' GR
12. COUNTY OR PARISH  
Eddy
13. STATE  
N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
(Other)

PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
ABANDON\* ☒  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐  
FRACTURE TREATMENT ☐  
SHOOTING OR ACIDIZING ☐  
(Other)

REPAIRING WELL ☐  
ALTERING CASING ☐  
ABANDONMENT\* ☐

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

We propose to plug and abandon as follows: Set cement plug from 2120' to 2020'; tag; shoot casing off @ 1400'; set 100' plug in and out of stub; tag; set 100' plug @ 1000'; tag; set 100' plug @ 410', 50' in and out of shoe; tag; 50' plug at surface; install dry hole marker.

18. I hereby certify that the foregoing is true and correct

SIGNED

*Caroline J. ...*

TITLE

Production Clerk

DATE

4/23/86

(This space for Federal or State office use)

Original

APPROVED BY


CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

4-29-86

\*See Instructions on Reverse Side

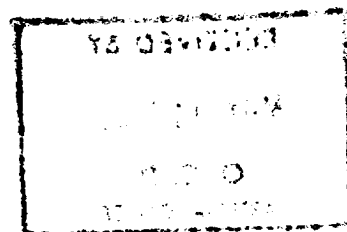

COMPANY Marbob  
LEASE & WELL NO 2041 and #19  
FORMATION \_\_\_\_\_  
COUNTY & STATE \_\_\_\_\_



Robert C. Chase  
Completion Supervisor

(505) 748-3303

P.O. Drawer 217  
Artesia, N.M.  
88211-0217

**marbob**  
energy corporation

7" 20# @ 362' C/100 sr

Top Salt 354  
Base Salt 955

Top Yates 1218'

Top 7 Rivers 1361' NO RECORDS

Top Queen 2086'

5% 2094-2108

PERFS 2097-2109

6 1/4

Top C/1328'

100% FILL

903' FILL

Top C/1511'

70% FILL

630' FILL

4 1/2 9.5 @ 2142 C/70 sr

TD 2146