

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPlicate
DATE: SEP 20 1982
SECTION

Form approved.
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

LC-049947 (a)

6. INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

RECEIVED

1. OIL WELL GAS WELL OTHER **WIW - TA** **SEP 2 1982**

7. UNIT AGREEMENT NAME

LOCO HILLS FLOOD

2. NAME OF OPERATOR **NEWMONT OIL COMPANY**

8. FARM OR LEASE NAME

YATES NO.

3. ADDRESS OF OPERATOR **P. O. BOX 1305 ARTESIA, NEW MEXICO 88210**

9. WELL NO.

5

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

10. FIELD AND POOL, OR WILDCAT
LOCO HILLS (Q. G. SA)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

2310' FSL 330' FWL Sec. 6-18-30

Sec. 6-18-30

14. PERMIT NO.

15. ELEVATIONS (Show whether DP, RT, GR, etc.)

12. COUNTY OR PARISH
Eddy

13. STATE
New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	


WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Pull tubing and packer
2. Spot sufficient cement across producing interval to tie back to production string casing seat, or set bridge plug near casing seat and cap with 25 sack cement plug.
3. Perforate base of salt @ 1105' and squeeze with 50 sacks cement leaving 100' plug in casing.
4. Perforate top of salt @ 431' and squeeze with 50 sacks cement leaving 100' plug in casing.
5. Set 15 sack cement plug at surface tying surface and production casing together.
6. Erect permanent well marker

- Note: (A.) Your office will be notified 24 hrs. prior to operations.
(B.) All plugs will be verified
(C.) Hole will be loaded between all plugs with 10# mud
(D.) We do not plan to pull any casing.

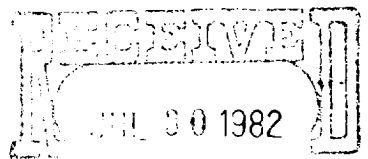

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Area Manager DATE 7/28/82

(This space for Federal or State office use)
APPROVED
(Orig. Sign) L. W. CHESTER
APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:
SEP 1 1982
FOR
JAMES A. GILLHAM
DISTRICT SUPERVISOR

*See Instructions on Reverse Side