

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-06300
1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injector ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Chevron USA Inc		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd, Midland, TX, 79705		7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
4. Well Location Unit Letter <u>K</u> : <u>1980</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>31</u> Township <u>20-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County		8. Well No. 160
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eunice Monument, Grayburg, SA

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI and RU.
2. Set 5 1/2" CIBP at 3575, spot 25sx, plug 3575-3400 (Grayburg - San Andres) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Spot 25sx, plug 2600-2400 (B-Salt, Yates) WOC Tag.
5. Perf 4 holes at 1250, sqz 50sx, plug 1250-1050 (T-Salt, 7 5/8 Shoe) WOC Tag.
6. Perf 4 holes at 200, sqz 50sx, plug 200-100 (10 3/4 Shoe) WOC Tag.
7. 10sx Surf, install dry hole marker.

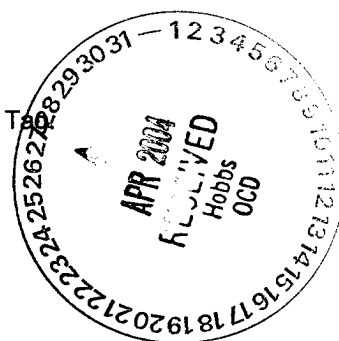

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 4/22/2004

Type or print name G.R. Bledsoe

Telephone No. (432) 687-7153

(This space for State use)

APPROVED BY Gary W. Wink TITLE OCD FIELD REPRESENTATIVE II / STAFF MANAGER DATE APR 27 2004

Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.
LEASE NAME EUNICE MOUNTAIN SOUTH UNIT
WELL # 160 WIC

SECT 31 TWN 20-S RNG 37-E
FROM 1980 NSL 1980 ENL
TD 3840 FORMATION @ TD S. ANDRES
PBDT FORMATION @ PBDT GRAYBURG

10 3/4
@ 140
TOC SURF

75 1/8
@ 1184
TOC SURF

5 1/2
@ 3740
TOC 2476

TD 3840

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	10 3/4	140	SURF	Circ
INTMED 1	75 1/8	1184	SURF	Circ
INTMED 2				
PROD	5 1/2	3740	2476	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	3629 - 3686
INTMED 2	OPENHOLE	3740 - 3840
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIP	25	3575
YATES	2	B-SALT	25	2600
QUEEN	3	75 1/8 SHOE	50	1250
GRAYBURG	4	10 3/4 SHOE	50	200
SAN ANDRES	5	SURF	10	10
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				