

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-06303
1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injector ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Chevron USA Inc		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd, Midland, TX, 79705		7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
4. Well Location Unit Letter <u>C</u> : <u>660</u> feet from the <u>North</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>31</u> Township <u>20-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County		8. Well No. 136
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eunice Monument, Grayburg, SA

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24 hrs prior to MI and RU.
2. Set 5 1/2" CIBP at 3680, spot 25sx, plug 3680-3500 (Grayburg - San Andres) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Perf 4 holes at 2600, sqz 40sx, plug 2600-2400 (B-Salt, Yates) WOC Tag.
5. Perf 4 holes at 1200, sqz 50sx, plug 1200-1000 (7 5/8 Shoe, T-Salt) WOC Tag.
6. Perf 4 holes at 250, sqz 50sx, plug 250-150 (10 3/4 Shoe) WOC Tag.
7. 10sx Surf, install dry hole marker.



I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 4/22/2004

Type or print name G.R. Bledsoe

Telephone No. (432) 687-7153

(This space for State use)

APPROVED BY Gary W. Wink TITLE OCD FIELD REPRESENTATIVE #1/STAFF MANAGER DATE APR 27 2004
Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME EUNICE MOUNTAIN SOUTH UNIT


WELL # 136 WIC

SECT 31 TWN 20-S RNG 37-E

FROM 660 NSL 1980 EML

TD 3932 FORMATION @ TD S. ANDRES

PBTD FORMATION @ PBTD GRAYBURG

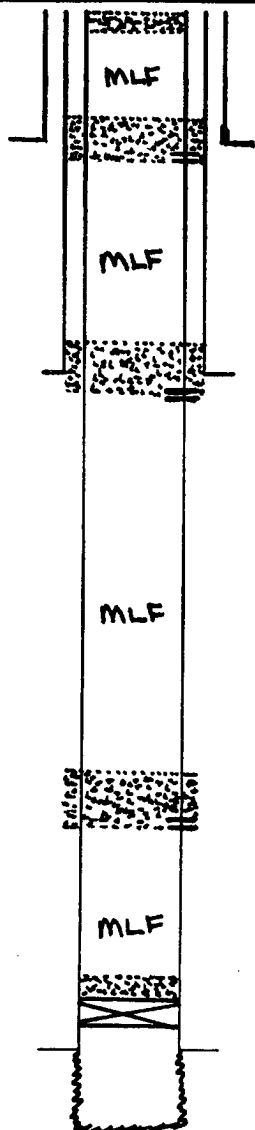

63/4
@ 159
TOC SURF

75/8
@ 1175
TOC SURF

5 1/2
@ 3730
TOC 2623

TD 3932

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	10 3/4	159	SURF	CIRC
INTMED 1	7 5/8	1175	SURF	CIRC
INTMED 2				
PROD	5 1/2	3730	2623	CALC

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	
INTMED 2	OPENHOLE	3730 - 3932
PROD		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP	25	3680
YATES	2	B-SALT	40	2600
QUEEN	3	75/8 SHOE	50	1200
GRAYBURG	4	10 3/4 SHOE	50	250
SAN ANDRES	5	SURF	10	10
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				