

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

| | |
|---|--|
| SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) | |
| 1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/> Injector | 7. Lease Name or Unit Agreement Name: Eunice Monument South Unit |
| 2. Name of Operator Chevron USA Inc | 8. Well No. 160 |
| 3. Address of Operator 15 Smith Rd, Midland, TX, 79705 | 9. Pool name or Wildcat Eumont Monument Grayburg San Andres |
| 4. Well Location Unit Letter <u>K</u> : <u>1980</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>31</u> Township <u>20-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County | |
| 10. Elevation (Show whether DR, RKB, RT, GR, etc.) | |

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒


CASING TEST AND CEMENT JOB ☐

OTHER: ☐ Replug ☐

12. **Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Set 5 1/2" CIBP at 3575, spot 25sx, plug from 3575-3400 (Grayburg - San Andres) Tag at 3335.
2. Displace hole w/MLF 9.5# Brine w/12.5# gel P/BBL.
3. Spot 25sx, plug from 2604-2400 (B-Salt, Yates) Tag at 2384.
4. Perf 4 holes at 1250, sqz 50sx from 1250-1050 (T-Salt, 7 5/8 Shoe) Tag at 976.
5. Perf 4 holes at 200, Circ cmt from 200-Surf 5 1/2 x 7 5/8 csg w/200sx (10 3/4 Shoe) Tag at Surf.
6. Install dry hole marker 5-6-04.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

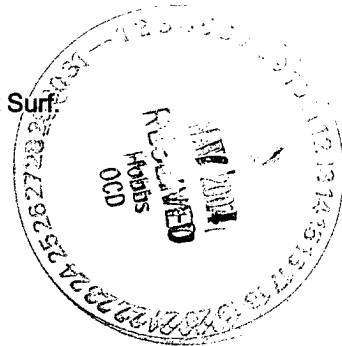

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jimmy Bagley TITLE Field Supervisor/Sunset DATE 5/6/04

Type or print name Jimmy Bagley Telephone No. (432) 561-8600

(This space for State use)

APPROVED BY Guy W. Wink TITLE _____ DATE _____

Conditions of approval, if any:

OC FIELD REPRESENTATIVE II/STAFF MANAGER

MAY 13 2004