

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
March 4, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

| |
|---|
| WELL API NO. 30-025-36234 |
| 5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/> |
| 6. State Oil & Gas Lease No. |
| 7. Lease Name or Unit Agreement Name Blue Baer Dunn 32 |
| 8. Well Number 1 |
| 9. OGRID Number |
| 10. Pool name or Wildcat Eidson, Morrow North Gas |

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other

2. Name of Operator
EOG Resources, Inc


3. Address of Operator
P.O. Box 2267, Midland, TX, 79702

4. Well Location
Unit Letter N : 676 feet from the South line and 1980 feet from the West line
Section 32 Township 15-S Range 35-E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)

Pit Location: UL N Sect 32 Twp 15S Rng 35E Pit type Steel Depth to Groundwater 68 Distance from nearest fresh water well Over 1000
Distance from nearest surface water 676 feet from the South line and 1980 feet from the West line (Steel Tank)

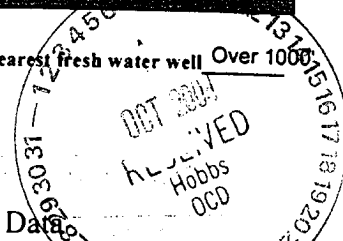

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☒ Approved as to plugging of the Well Bore.
Liability under bond is retained until surface restoration is completed. ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notified OCD 24 hrs prior to MI & RU.
2. NU BOP, pull out of hole with tbg and seal assembly.
3. Set 4 1/2" CIBP at 12340.
4. Displace hole w/MLF, 9.5# Brine w/25# salt gel P/BBL.
5. Spot 50sx, plug from 12340-11900, WOC Tag at 11700 (Morrow, Atoka).
6. Spot 25sx, plug from 11600-11400 (Strawn).
7. Spot 25sx, plug from 10100-9900 (Wolfcamp).

8. Spot 25sx, plug from 7450-7250 (Tubb).
9. Spot 60sx, plug from 4850-4100, WOC Tag at 4050 (S. Andres, Grayburg, 8 5/8 Shoe).
10. Spot 25sx, plug from 3100-2900 (Yates).
11. Cut 4 1/2" csg at 1800, L/D csg, spot 40sx, plug from 1850-1700 (Stub) WOC Tag at 1696.
12. Spot 60sx, plug 525-325 (11 3/4 Shoe) WOC Tag @ 320.
13. Spot 10sx Surf, install dry hole marker, P&A complete 9-29-04.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOC guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE [Signature] TITLE Consultant DATE 9-29-04

Type or print name Jimmy Bagley E-mail address: sunsetwellservice@yahoo.com Telephone No. 432-561-8600

(This space for State use)

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER

Conditions of approval, if any:

DATE OCT 12 2004