

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised May 08, 2003

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-36422
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name B M Marcus
8. Well Number 3
9. OGRID Number 000495
10. Pool name or Wildcat Skaggs Drinkard, (57000) Warren; Tubb (87080) Blinebry Oil & Gas (6660)

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator Amerada Hess Corporation	
3. Address of Operator P.O. Box 840 Seminole, Texas 79360	
4. Well Location Unit Letter <u>B</u> : <u>660</u> feet from the <u>North</u> line and <u>1980</u> feet from the <u>East</u> line Section <u>20</u> Township <u>20S</u> Range <u>38E</u> NMPM County <u>Lea</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3553'	


12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
<b>NOTICE OF INTENTION TO:</b> PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: Add Blinebry Oil & Gas <input checked="" type="checkbox"/>	<b>SUBSEQUENT REPORT OF:</b> REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Plan to MIRU pulling unit. TOH w/prod eqpt. RU Schlumberger. Set CIBP @ 6500'. Test plug to 1000 psi. Perf Blinebry as follows: 5904'-5910.4', 5971'- 5974.8', 5996'-6000.8', 6053'-6055', 6090'-6092'. Acidize perms w/4000 gals 15% HCL w/additives. Frac Blinebry zone w/200,000# 16/30 Ottawa sand in Spectra Star Frac 30# XL Borate Gel. Flow back load. Clean out fill and KO CIBP. Begin producing from all zones.

Please refer to R-11363

HOB-0067

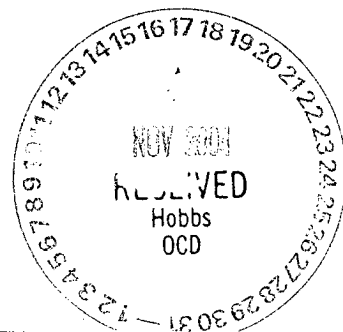

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carol J. Moore TITLE Senior Advisor DATE 11/16/2004

Type or print name Carol J. Moore cmoore@hess.com Telephone No. (432)758-6738

(This space for State use)

APPROVED BY [Signature] TITLE PETROLEUM ENGINEER DATE NOV 23 2004  
Conditions of approval, if any: