New Mexico Oil Conscription Division, District 1

Form 3160-5 (April 2004) UNITED STATES

UNITED STATES

DEPARTMENT OF THE INTERIOR OF STATES, NM 88240

BUREAU OF LAND MANAGEMENT

FORM APPROVED OM B No. 1004-0137 Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

 Lease Serial No. NM-81633

6. If Indian, Allottee or Tribe Name

abandoned well. Use Form 3160	-3 (APD) for such proposals.		
SUBMIT IN TRIPLICATE- Other instructions on reverse side.		7. If Unit or CA/Agreement, Name and/or No. Checker Board "23" Fed	
1. Type of Well Gas Well Other			
2. Name of Operator EOG Resources, Inc		8. Well Name and No.	
3a Address P.O. Box 2267, Midland, TX, 79702	3b. Phone No. (include area code) 432-686-3600	9. API Well No. 30-025-32376	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		10. Field and Pool, or Exploratory Area Red Tank Delaware West	
Unit Letter H, 2310 FNL, 990 FEL Section 23, Township 22-S, Range 32-E		11. County or Parish, State Lea, New Mexico	
12. CHECK APPROPRIATE BOX(FS	TO INDICATE NATURE OF NOTICE	DEBORT OR OTHER DATA	

TIURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Acidize Deenen Production (Start/Resume) Water Shut-Off Notice of Intent Alter Casing Fracture Treat Reclamation Well Integrity Subsequent Report Casing Repair New Construction Recomplete Change Plans Plug and Abandon Temporarily Abandon Final Abandonment Notice Convert to Injection Plug Back Water Disposal

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has

Approved as telephologishigatherita isvest/plagainal inspection.)

Surface regionation is completed.

1. Notified Kathy w/BLM 24 hrs prior to MI and RU.

2. Set 5 1/2" CIBP at 8375, Spot 25sx, Plug from 8375-8122 (B. Spring) WOC Tag @ 8113.

3. Displace hole with MLF.


4. Cut csg at 4673. Press up to 2000 PSI. Spot 60sx, plug from 5113-4513, WOC Tag at 4493.

5. Cut csg at 3000. Press up to 2000 PSI. Spot 25sx, plug from 3068-2815, WOC Tag at 2812.

6. Perf at 1150. Press up to 2000 PSI. Spot 45sx, plug from 1200-800, WOC Tag at 757.

7. Perf at 300, circ 80sx cmt down 5 1/2 csg up through 8 5/8 annulus.

8. Install dry hole marker P&A complete 1-9-05.

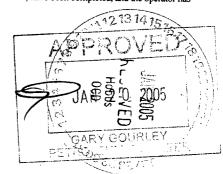

P&A Complete 1-9-05

14. I hereby certify that the foregoing is true and correct					
Name (Printed/Typed)	ı				
Jimmy Bagley	Title	Consultant			
Signature / /	Date	01/09/2005			
HIS SPACE FOR FEDERAL OR STATE OFFICE USE					
Approved by Conditions of approval if any are attached. Account follows.		Title	Date		
which would entitle the applicant to conduct operations thereon.		Office			
Title 18 11 S.C. Santian 1001 and Title 43 11 S.C. S					

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

