

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-07005
5. Indicate Type of Lease	STATE ☒ FEE ☒
6. State Oil / Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.		7. Lease Name or Unit Agreement Name MARK OWEN
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator CHEVRON USA INC	8. Well No. 6
3. Address of Operator 15 SMITH RD, MIDLAND, TX 79705	9. Pool Name or Wildcat PENROSE SKELLY GRAYBURG	
4. Well Location Unit Letter <u>O</u> : <u>554'</u> Feet From The <u>SOUTH</u> Line and <u>2086'</u> Feet From The <u>EAST</u> Line Section <u>34</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY		
10. Elevation (Show whether DF, RKB, RT, GR, etc.)		

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ RECOMPLETE TO GRAYBURG

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1-26-05: MIRU PU.
1-27-05: TIH TO 5145.
1-28-05: TIH W/RBP & PKR. SET RBP @ 5100. PU 15' & SET PKR. SPOT 5 SX OF SAND ON TOP OF CIBP.
1-31-05: TIH W/CPNL LOG & LOG FR 5100 UP TO 2900. RUN CBL & CCL LOG FR 5100-SURF TOP OF CMT @ 50.
2-02-05: PERF 3658-3660, 3670-3676, 3696-3704, 3726-3731, 3753-3760, 3769-3771, 3778-3784, 3790-3793, 3796-3803, 3827-3834, 3836-3842, 3848-3855. PU PKRS & TIH WO 3900. SET PKR @ 3615. REL PKR.
2-03-05: ACIDIZE PERFS 3658-3855' W/2600 GALS 15% NEFE. SPOT ACID TO END OF TBG. SET PKRS. REL PKR. SET PKR @ 3646. SWAB WELL.
2-07-05: REL PKR. TIH W/PKR & SET @ 3593.
2-08-05: FRAC W/67,000 GALS YF130, & SAND.
2-09-05: REL PKR. TIH & TAG SAND @ 4992.
2-10-05: TIH W/PKR & SET @ 3603. SWAB.
2-11-05: FLOW WELL TO TANK.
2-14-05: TIH W/TRACER SURVEY. FLOW.
2-15-05: FLOW WELL TO BATTERY ON 15/64 CHOKE 175 PSI. 9 OIL, 33 WTR, & 14 MCF. TURN WELL OVER TO PRODUCTION TO FLOW.
2-16-05: TIH & SET PLUG IN PROFILE NIPPLE. TEST PLUG & GET OFF PKR. TIH W/112 JTS 2 7/8" TBG & LATCH ONTO PKR. SWAB WELL DN TO 2000'.
2-17-05: TIH & FILL ON TOP OF PLUG. TIH W/BAILER. CLEAN OUT FILL. RETR PRONG FROM PLUG. WELL FLOW TO TANK. RETR PLUG FR PROF NIP. RIG DOWN. TURN WELL OVER TO PRODUCTION. FINAL REPORT
2-24-05: ON 24 HR OPT. FLOWING 81 OIL, 201 GAS, & 262 WATER. GOR-2481

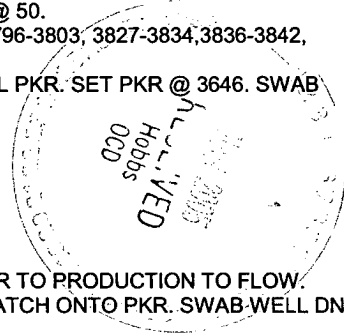

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 3/7/2005
TYPE OR PRINT NAME Denise Pinkerton Telephone No. 432-687-7375

(This space for State Use)

APPROVED [Signature] TITLE PETROLEUM ENGINEER
CONDITIONS OF APPROVAL, IF ANY:

DATE

MAR 10 2005

2A Blinberry OaB