
Submit 1 Copy To Appropriate District	State of New Mexico	Form C-103
Office District I – (575) 393-6161	Energy, Minerals and Natural Resources	October 13, 2009
1625 N French Dr , Hobbs, NM 88240 📔	OBBS OCD	WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-025-27297
District III - (505) 334-6178	T 1 4 2011 220 South St. Francis Dr.	5. Indicate Type of Lease  STATE X FEE
1000 Rio Brazos Rd , Aziec, NW 87410	Santa Fe; NM 87505	6. State Oil & Gas Lease No.
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM		_ /
87505 ;	RECEIVED	B-1565
	ICES AND REPORTS ON WELLS SALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
	CATION FOR PERMIT" (FORM C-101) FOR SUCH	Aztec State
PROPOSALS)		8. Well Number 15
1. Type of Well: Oil Well	Gas Well ☑ Other W(W)	9. OGRID Number
<ol><li>Name of Operator OXY USA Inc.</li></ol>		16696
3. Address of Operator		10. Pool name or Wildcat
P.O. Box 50250 Midland, TX 79	9710	Maljanian GBSH
4. Well Location		1 00.100.000
Unit Letter:	2310 feet from the North line and	2310 feet from the east line
Section 7	Township 175 Range 33E	NMPM County Lea
Section	11. Elevation (Show whether DR, RKB, RT, GR, et	
	1225.8' GR	/
		Production of the second of th
12. Check	Appropriate Box to Indicate Nature of Notice	e, Report or Other Data
NOTICE OF IA	ITENTION TO:	BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	NTENTION TO: SU  PLUG AND ABANDON 🔼 REMEDIAL WO	
TEMPORARILY ABANDON		RILLING OPNS. P AND A
PULL OR ALTER CASING	= 1	
DOWNHOLE COMMINGLE	WIGETH ZE GOWN E	
BOWN 1022 00 11 11 11 12 12 12 12 12 12 12 12 12 12		r
OTHER:	☐ OTHER:	
13. Describe proposed or comp	pleted operations. (Clearly state all pertinent details,	and give pertinent dates, including estimated date
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple C	and give pertinent dates, including estimated date completions: Attach wellbore diagram of
13. Describe proposed or comp	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple C	and give pertinent dates, including estimated date completions: Attach wellbore diagram of
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple C	ompletions: Attach wellbore diagram of
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.	ompletions: Attach wellbore diagram of
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.	ompletions: Attach wellbore diagram of
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a cork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC  5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965'	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a lork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965'  2. M&P 25sx cmt to 2550-2375' WOC-Tag  3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965'  2. M&P 25sx cmt to 2550-2375' WOC-Tag  3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag  4. Perf @ 300', sqz 120sx cmt to surface	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a lork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965'  2. M&P 25sx cmt to 2550-2375' WOC-Tag  3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965'  2. M&P 25sx cmt to 2550-2375' WOC-Tag  3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag  4. Perf @ 300', sqz 120sx cmt to surface	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed was proposed completion or really	pleted operations. (Clearly state all pertinent details, a lork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed with any proposed w	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965'  2. M&P 25sx cmt to 2550-2375' WOC-Tag  3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag  4. Perf @ 300', sqz 120sx cmt to surface	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed was proposed completion or really	pleted operations. (Clearly state all pertinent details, a lork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs	ompletions: Attach wellbore diagram of 450'
13. Describe proposed or composed was proposed completion or red	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:	ompletions: Attach wellbore diagram of 450' -Surf-Circ e, TOC-1585'-TS
13. Describe proposed or composed was proposed completion or red	pleted operations. (Clearly state all pertinent details, a lork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs	ompletions: Attach wellbore diagram of 450' -Surf-Circ e, TOC-1585'-TS
13. Describe proposed or composed was proposed completion or red	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:	dge and belief.
13. Describe proposed or composed was proposed completion or red	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:	dompletions: Attach wellbore diagram of 450' -Surf-Circ e, TOC-1585'-TS
13. Describe proposed or composed was proposed completion or recompletion or recompletion or recompletion or recompletion.  Spud Date:  I hereby certify that the information of the proposed completion or recompletion.	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:  Rig Release Date:  TITLE Regulatory Advisor	dge and belief.  DATE LOCITATION  DATE LOCITATION  DATE
13. Describe proposed or composed was proposed completion or red  Spud Date:  I hereby certify that the information SIGNATURE  Type or print nameDavid Stev	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:  Rig Release Date:  TITLE Regulatory Advisor	dompletions: Attach wellbore diagram of 450' -Surf-Circ e, TOC-1585'-TS
13. Describe proposed or composed was proposed completion or recompletion or recompletion or recompletion or recompletion.  Spud Date:  I hereby certify that the information of the proposed completion or recompletion.	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:  Rig Release Date:  TITLE Regulatory Advisor	dge and belief.  DATE LOCITATION  DATE LOCITATION  DATE
13. Describe proposed or composed was proposed completion or red  Spud Date:  I hereby certify that the information SIGNATURE  Type or print name David Stever For State Use Only	pleted operations. (Clearly state all pertinent details, a lock). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:  TITLE Regulatory Advisor  Wart /E-mail address: david_stewart@	dge and belief.  DATEOxy.com PHONE:432-685-5717
13. Describe proposed or composed was proposed completion or red  Spud Date:  I hereby certify that the information SIGNATURE  Type or print nameDavid Stev	pleted operations. (Clearly state all pertinent details, a ork). SEE RULE 19.15.7.14 NMAC. For Multiple Completion.  TD-4518' PBTD-4435' Perfs-4190-4349' CIBP-4  8-5/8" 24# csg @ 977' w/ 500sx, 12-1/4" hole, TOC 5-1/2" 14-15.5# csg @ 4518' w/ 1400sx, 7-7/8" ho  1. RIH & set CIBP @ 4140' M&P 25sx cmt to 3965' 2. M&P 25sx cmt to 2550-2375' WOC-Tag 3. Perf @ 1027', sqz 40sx cmt to 927' WOC-Tag 4. Perf @ 300', sqz 120sx cmt to surface 10# MLF between plugs  Rig Release Date:  Rig Release Date:  TITLE Regulatory Advisor	dge and belief.  DATE LOCITATION  DATE LOCITATION  DATE

OXY USA Inc. - Current Aztec State #15 API No. 30-025-27297

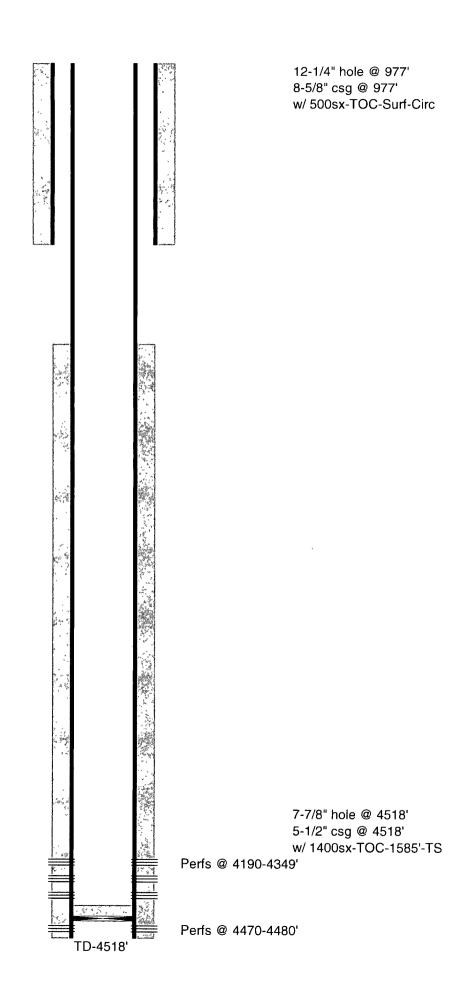

CIBP @ 4450' w/ 15' cmt

OXY USA Inc. - Proposed Aztec State #15 API No. 30-025-27297

120sx @ 300'-Surface 12-1/4" hole @ 977' 8-5/8" csg @ 977' w/ 500sx-TOC-Surf-Circ Perf @ 300' 40sx @ 1027-927' WOC-Tag Perf @ 1027' 25sx @ 2550-2375' 7-7/8" hole @ 4518' CIBP @ 4140' w/ 25sx to 3965' 5-1/2" csg @ 4518' w/ 1400sx-TOC-1585'-TS Perfs @ 4190-4349' CIBP @ 4450' w/ 15' cmt Perfs @ 4470-4480'

TD-4518'