

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

DISTRICT I
1625 N French Dr, Hobbs, NM 88240

HOBBS OCD

1220 South St. Francis Dr.
Santa Fe, NM 87505

DISTRICT II
1301 W Grand Ave, Artesia, NM 88210

JAN 17 2012

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

WELL API NO 30-025-07361
5 Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No
7 Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 19
8 Well No 131
9 OGRID No 157984
10 Pool name or Wildcat Hobbs (G/SA)

11 Elevation (Show whether DF, RKB, RT GR, etc)
3667' DF

Pit or Below-grade Tank Application ☐ or Closure ☐
Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____
Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals)

1 Type of Well
Oil Well ☐ Gas Well ☐ Other Injector ☒

2 Name of Operator
Occidental Permian Ltd.

3 Address of Operator
HCR 1 Box 90 Denver City, TX 79323

4 Well Location
Unit Letter L 2310 Feet From The South 330 Feet From The West Line
Section 19 Township 18-S Range 38-E NMPM Lea County

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS ☐
OTHER: ☐	CASING TEST AND CEMENT JOB ☐
	OTHER: Clean out/plug back/squeeze ☒

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU & RU.
2. RU wireline & set blanking plug in packer @4078'. RD wireline
3. NU BOP/ND wellhead.
4. POOH w/tubing
5. RU wireline & fished blanking plug. RD wireline.
6. POOH w/packer.
7. RIH w/bit. Tag @4308' POOH w/bit.
8. Dump bail 36 buckets of pea gravel. Tag @4175'. RU wireline & RIH w/bailer & 2 sacks cement. Dumped 10' of cement on top of pea gravel. Tagged TOC @4165'. RD wireline.
9. RIH w/packer set @3978'. Got injection rate. POOH w/packer.
10. RIH w/CICR set @3984.

see attached sheet for additional data

PMX-234

I hereby certify that the information above is true and complete to the best of my knowledge and belief I further certify that any pit or below-grade tank has been/will be constructed or

closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A Johnson TITLE Administrative Associate DATE 01/13/2012
TYPE OR PRINT NAME Mendy A Johnson E-mail address: mendy_johnson@oxy.com TELEPHONE NO 806-592-6280

For State Use Only
APPROVED BY Mary Brown TITLE Compliance Officer DATE 1/17/2012
CONDITIONS OF APPROVAL IF ANY

JAN 23 2012


NHU 19-131


11. RU HES & squeezed perms in casing w/28 bbl of cement. Reversed out 20 bbl. RD HES.
12. RIH w/bit & drill collars. RU power swivel & stripperhead. Broke circulation & drilled on CICR @3984'. Drilled squeeze from 3986-4158'. Circulate clean. Test squeeze. Lost 10 PSI in 20 min. Continue to drill on cement from 4159-4175'. Fell thru and cleaned out pea gravel to 4310' PBTD. RD power swivel & stripperhead. POOH w/bit & drill collars.
13. RIH w/Arrowset 1-X Dbl Grip packer set on 124 jts of 2-7/8" Duoline 20 tubing. Packer set @4063'.
14. ND BOP/NU wellhead.
15. Test casing to 600 PSI for 30 minutes and chart for the NMOCD.
16. RDPU & RU. Clean location and return well to injection.

RUPU 10/05/2011

RDPU 10/19/2011

Wellbore Diagram : NNSAU 131-19

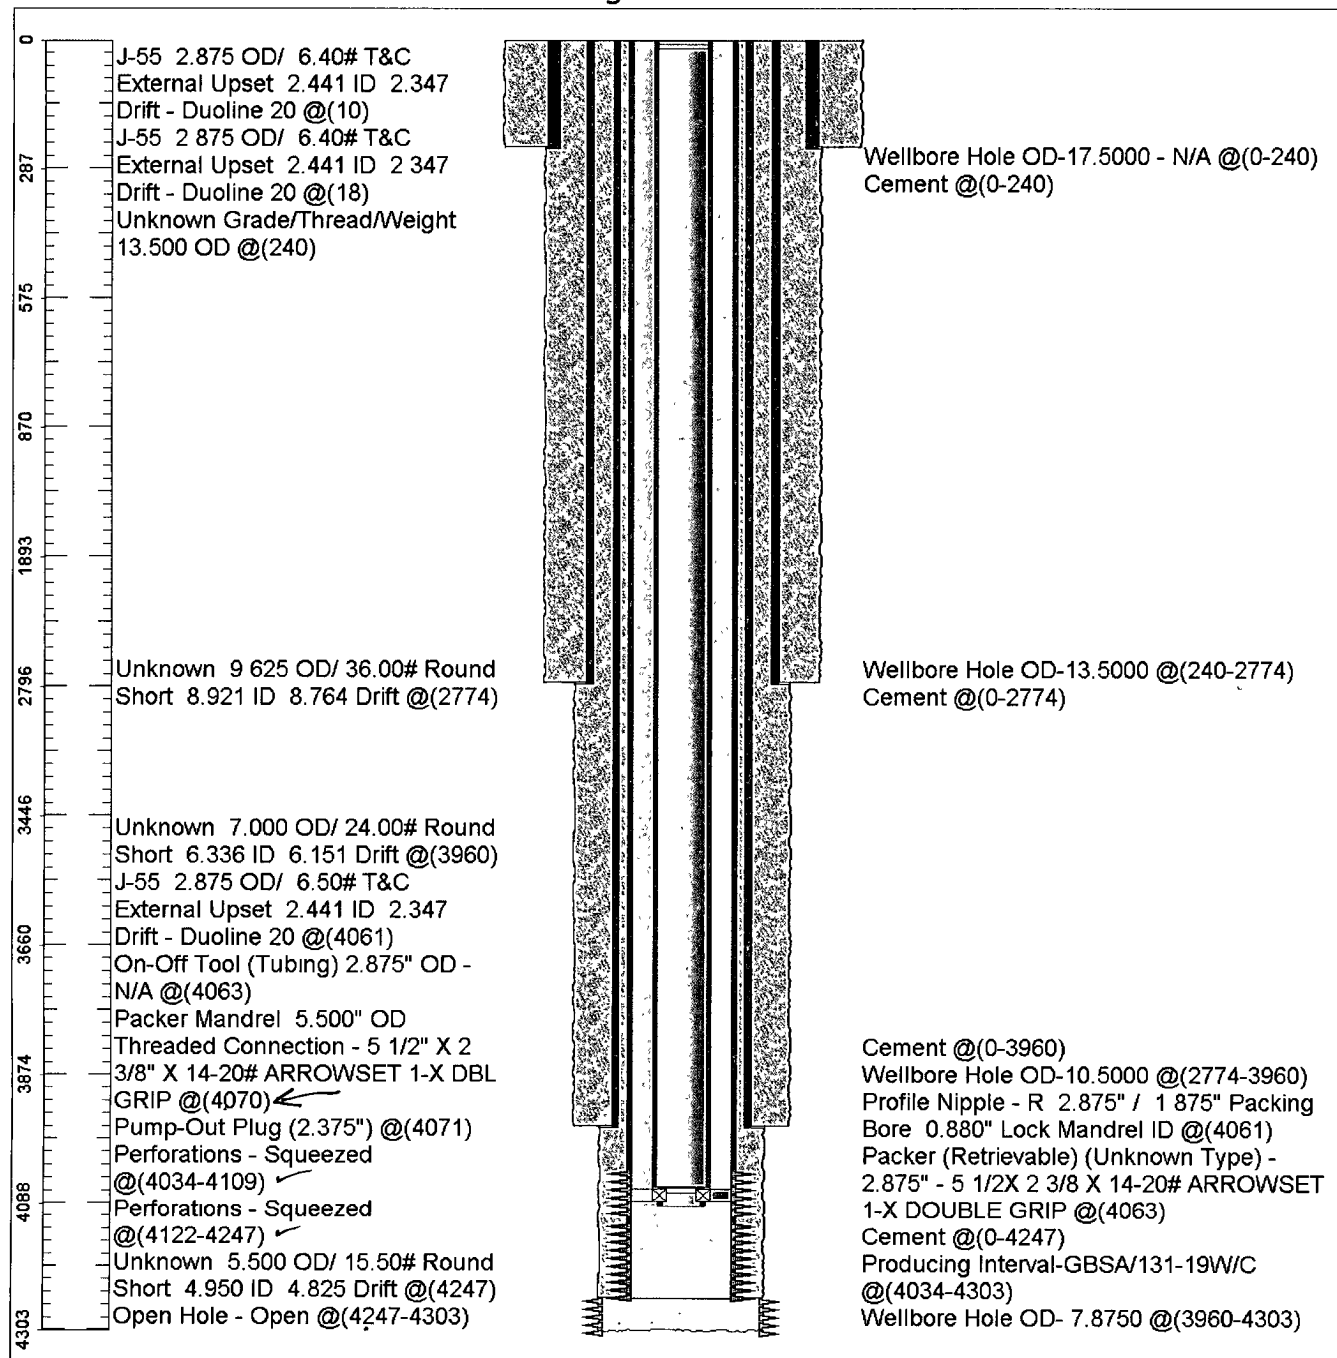

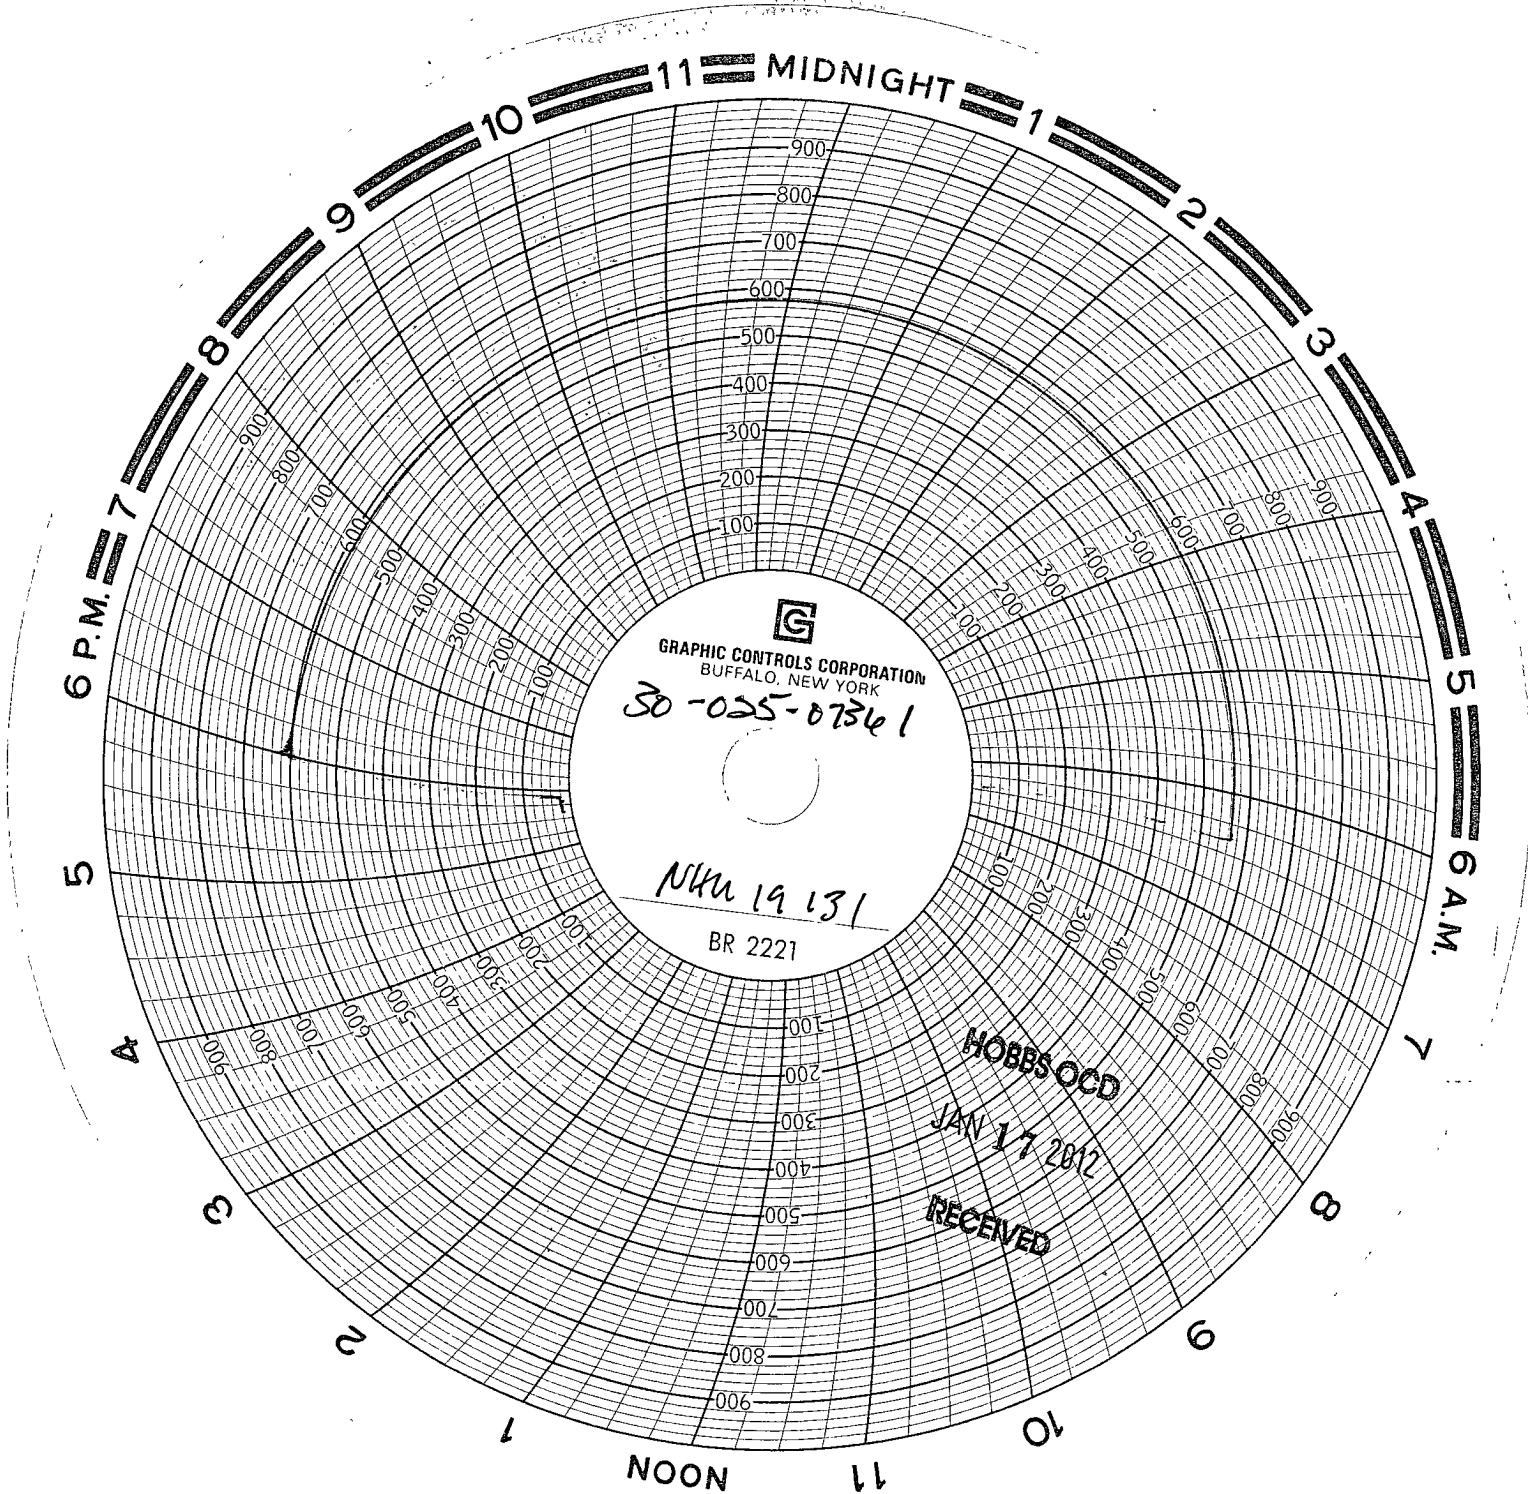

HOBBS OCD
JAN 17 2012
RECEIVED

NHSAU 19-131
PMC Equipment Com
Calibrated 6-7-11
Serial Number 12517
API # 30-025-07361