

Submit 3 Copies To Appropriate District
Office
District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
JAN 12 2012 1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
June 19, 2008

RECEIVED		WELL API NO. 30-025-28133
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)		5. Indicate Type of Lease STATE ☒ FEE ☐
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		6. State Oil & Gas Lease No. V-412
2. Name of Operator Mack Energy Corporation		7. Lease Name or Unit Agreement Name State GS 16
3. Address of Operator P.O. Box 960 Artesia, NM 88210		8. Well Number 1
4. Well Location Unit Letter P 660 feet from the South line and 660 feet from the East line Section 16 Township 17S Range 34E NMPM County Lea		9. OGRID Number 013837
11. Elevation (Show whether DR, RKB, RT, GR etc) 4087' GR		10. Pool Name or Wildcat Vacuum Abo, North

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS ☐ P AND A ☐
CASING/CEMENT JOB ☐

13. Describe proposed or completed operations. (Clearly state all pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions, include a diagram of proposed completion.

Notify OCD 24 hours prior to starting plugging operations.

1. Set CIBP @ 4600' w35' cement cap. (Perfs 4640-4751').
2. Perf @ 3300' squeeze 35sx 50' above and below top of cement @ 3310'.
3. Set 25sx plug from 2815-2915'. (cover BOS @ 2865'). WOC and tag.
3. Set 25sx plug from 1650-1750'. (cover csg shoe and TOS @ 1700'). WOC and tag.
4. Circulate cement from 60' to surface.
5. Install Dry Hole Marker.

Note: Circ. Well with salt gel mud consisting of at least 9.5# Brine with 25 pounds of gel per barrel after the bottom plug is set.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Jerry W. Sherrell

TITLE Production Clerk

DATE 1/10/12

Type or print name Jerry W. Sherrell

E-mail address: jerrys@mec.com

PHONE: (575)748-1288

For State Use Only

APPROVED BY:

Mary G. Brown

TITLE Compliance Officer


DATE 1/18/2012

Conditions of Approval (if any)

JAN 23 2012

Mack Energy Corporation
State GS 16 #1 30-025-28133

Before

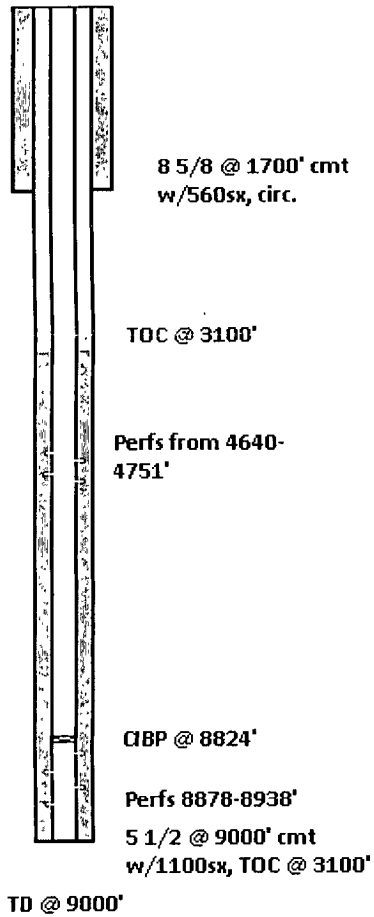

After

