

District I - (575) 393-6161

**HOBBS OGD**

Energy, Minerals and Natural Resources

Revised August 1, 2011

1625 N. French Dr., Hobbs, NM 88240

District II - (575) 748-1283

811 S. First St., Artesia, NM 88210

District III - (505) 334-6178

1000 Rio Brazos Rd., Aztec, NM 87410

District IV - (505) 476-3460

1220 S. St. Francis Dr., Santa Fe, NM 87505

**RECEIVED**

APR 11 2012

CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO. 300-025-40178
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Collins Heirs
8. Well Number #1
9. OGRID Number 018100
10. Pool name or Wildcat: Nadine West

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Primero Operating Inc.

3. Address of Operator

PO Box 1433, Roswell, NM 88202-1433

4. Well Location

Unit Letter K : 1650 feet from the S line and 1700 feet from the W line  
Section 4 Township 20S Range 38E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
4258 GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: ☐


OTHER: Completion ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

12/14/2011 MIRUPU. Perf Abo 7422-28, 7468-72, 7492-7500, 7526-34, 7570-72, & 7584-86. Acidize with 5000 gal 15% NEFE AIR 2 BPM @ 1600 psi. ISIP 6700 15 min 6084. Swab dry with show of oil. Fluid entry TSTM. Set RBP @ 7380. Perf Abo 7288-90, 96-7300, 7312-18, 24-26, 38-42, 7238-40, 43-44, 57-64, & 72-82 w/ 2 spf. Acidize with 5000 gal 15% NEFE AIR 3 BPM @ 6550 psi. ISIP 6620, 15 min 6127. Swab dry with show of oil, no fluid entry. Rls pkr and retrieve RBP, POH and LD tools. RDMOPU.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

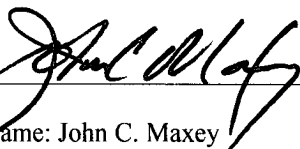

TITLE: Consulting Petroleum Engineer

DATE: 1/26/2012

Type or print name: John C. Maxey

E-mail address: jcm@maxeyengineering.com PHONE: 575-623-0438

**For State Use Only**

APPROVED BY:



TITLE

**PETROLEUM ENGINEER**

DATE

APR 23 2012

Conditions of Approval (if any):

APR 23 2012