
State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 5-27-2004

FILE IN TRIPLICATE	OIL CONSERV	ATION DIVISION	R01130d 3 21 2001
DISTRICT I 1625 N French Dr , Hobbs, NM 88240	HOBBS OCA 1220 South Santa Fe.	St. Francis Dr. NM 87505	WELL API NO. 30-025-37350
DISTRICT II 1301 W Grand Ave, Artesia, NM 88210 DISTRICT III	1/V =		5 Indicate Type of Lease
1301 W Grand Ave, Artesia, NM 88210	AI $I_{1,2012}$		STATE FEE X
DISTRICT III	•		6 State Oil & Gas Lease No
1000 Rio Brazos Rd, Aztec, NM 87410	5CF/450	I.I.O.	7 Lana Nama or Heat Agreement Name
	NO FIGES AND REPORTS ON WE		7 Lease Name or Unit Agreement Name
	PROPOSALS TO DRILL OR TO DEEPEN "APPLICATION FOR PERMIT" (Form C-		B. Hardin
1 Type of Well	ATTECATION FOR TERMIT (TOTAL C	/ Proposais /	8 Well No 2
Oil Well X	Gas Well Other		2
2 Name of Operator		/	9 OGRID No. 192463
Oxy USA WTP Limited Partnership		<u> </u>	
3 Address of Operator	(E) V (E) 2.22		10 Pool name or Wildcat
HCR 1 Box 90 Denver City, 4 Well Location	1X 79323		Hobbs Abo Wildcat
Unit Letter E 2015 Feet From The North 385 Feet From The West Line			
Section 19	Township 18-S	Range 38-	E NMPM Lea County
	11 Elevation (Show whether DF, R. 3657' GL	KB, RT GR, etc)	
Pit or Below-grade Tank Application or Closure			
Pit Type Depth of Ground Water Distance from nearest fresh water well Distance from nearest surface water			
Pit Liner Thickness mil Below-Grade Tank: Volume bbls; Construction Material			
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:			
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OF	PNS PLUG & ABANDONMENT
PULL OR ALTER CASING	Multiple Completion	CASING TEST AND CEME	NT JOB
] Manaple completion		
OTHER:			y Abandon well/TA status request X
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. RUPU & RU. 2. POOH and lay down rods and pump 3. NU BOP/ND wellhead. 4. RIH w/bit Found hole in joint 155 from surface. POOH w/bit. 5. RIH w/CIBP set @6603'. RU wireline and dump 35' of cement on top of CIBP. 6. RIH w/CIBP set @3999'. Dump 35' of cement on top of CIBP. 7. RIH w/CIBP set @3398'. Dump 35' of cement on top of CIBP. RD wireline. 8. ND BOP/NU TA wellhead. 9. Test casing to 550 PSI for 30 minutes and chart for the NMOCD. 10. RDPU & RU. Clean location. Well is TA'd This Approval of Temporary 5-2017. Abandonment Expires			
			RDPU 03/07/2012
I hereby certify that the information above constructed or	is true and complete to the best of my know	ledge and belief I further certify	y that any pit or below-grade tank has been/will be
closed according to NMOCD guidelin	nes , a general permit	or an (attached) alternative plan	ve OCD-approved
SIGNATURE TITLE Administrative Associate DATE 05/10/2012			
TYPE OR PRINT NAME Mendy A. Johnson E-mail address; mendy johnson@oxy.com TELEPHONE NO 806-592-6280			
For State Use Only			
APPROVED BY COMPANY DATES 14 7016			
CONDITIONS OF APPROVAL IF ANY			
	′ /		

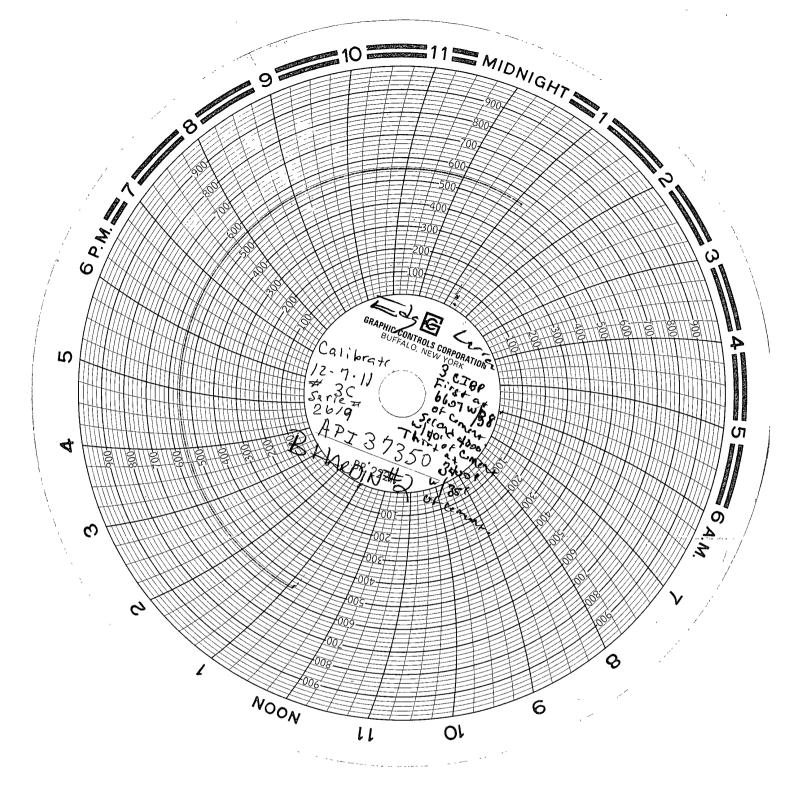


B. Hardin Lease Will # 2 Marain

APT # 30-025-3738
3738-0

April 12, 2012

Work Plan Report for Well: HARDINB-002A

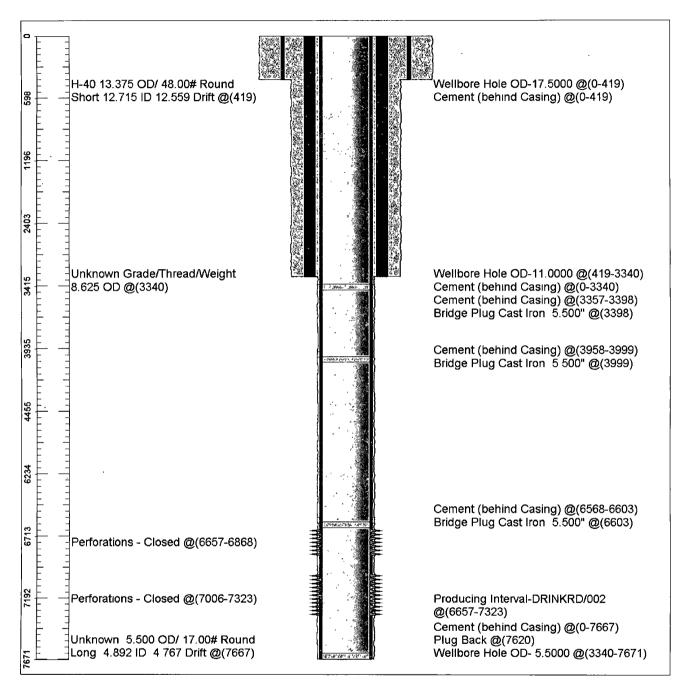

Survey Viewer