

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N French Dr, Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
HOBBS OCD
20 South St. Francis Dr.
Santa Fe, NM 87505

JUL 02 2012

WELL API NO. 30-025-05843
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No 81667
7. Lease Name or Unit Agreement Name East Eumout Unit
8. Well Number 103
9. OGRID Number 192463
10. Pool name or Wildcat Eumout Yates TR ON

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <u>Injection</u>	
2. Name of Operator OXY USA WTP Limited Partnership	
3. Address of Operator P.O. Box 50250 Midland, TX 79710	
4. Well Location Unit Letter <u>M</u> : <u>660</u> feet from the <u>South</u> line and <u>660</u> feet from the <u>West</u> line Section <u>36</u> Township <u>19S</u> Range <u>37E</u> NMPM County <u>Lea</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) <u>3595'</u>	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: CIBP-MIT-TA Status ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

6/25/12 Bled well off. NDWH, NU BOP, Rel pkr. POOH w/tbg & LD tbg. RIH w/ 4-3/4" bit, 4-3/4" string mill and 120 jts tbg to 3780'.
6/26/12 Bled well off. POOH w/tbg & LD bit and mill. RIH w/ 5-1/2" CIBP & set @ 3774'. Loaded and tested CIBP to 500 psi. Held. POOH w/ tbg & setting tool. RIH w/10 jts tbg. ND BOP. NUWH.
6/27/12 Recorded 500 psi chart for OCD. Well held good. RDPU.

This Approval of Temporary
Abandonment Expires 6/27/2013

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David Stewart TITLE Regulatory Advisor DATE 6/26/12


Type or print name _____ E-mail address: david.stewart@oxy.com PHONE: 432-685-5717

For State Use Only

APPROVED BY: Mark Brown TITLE Compliance Officer DATE 7/3/2012


Conditions of Approval (if any)

JUL 03 2012

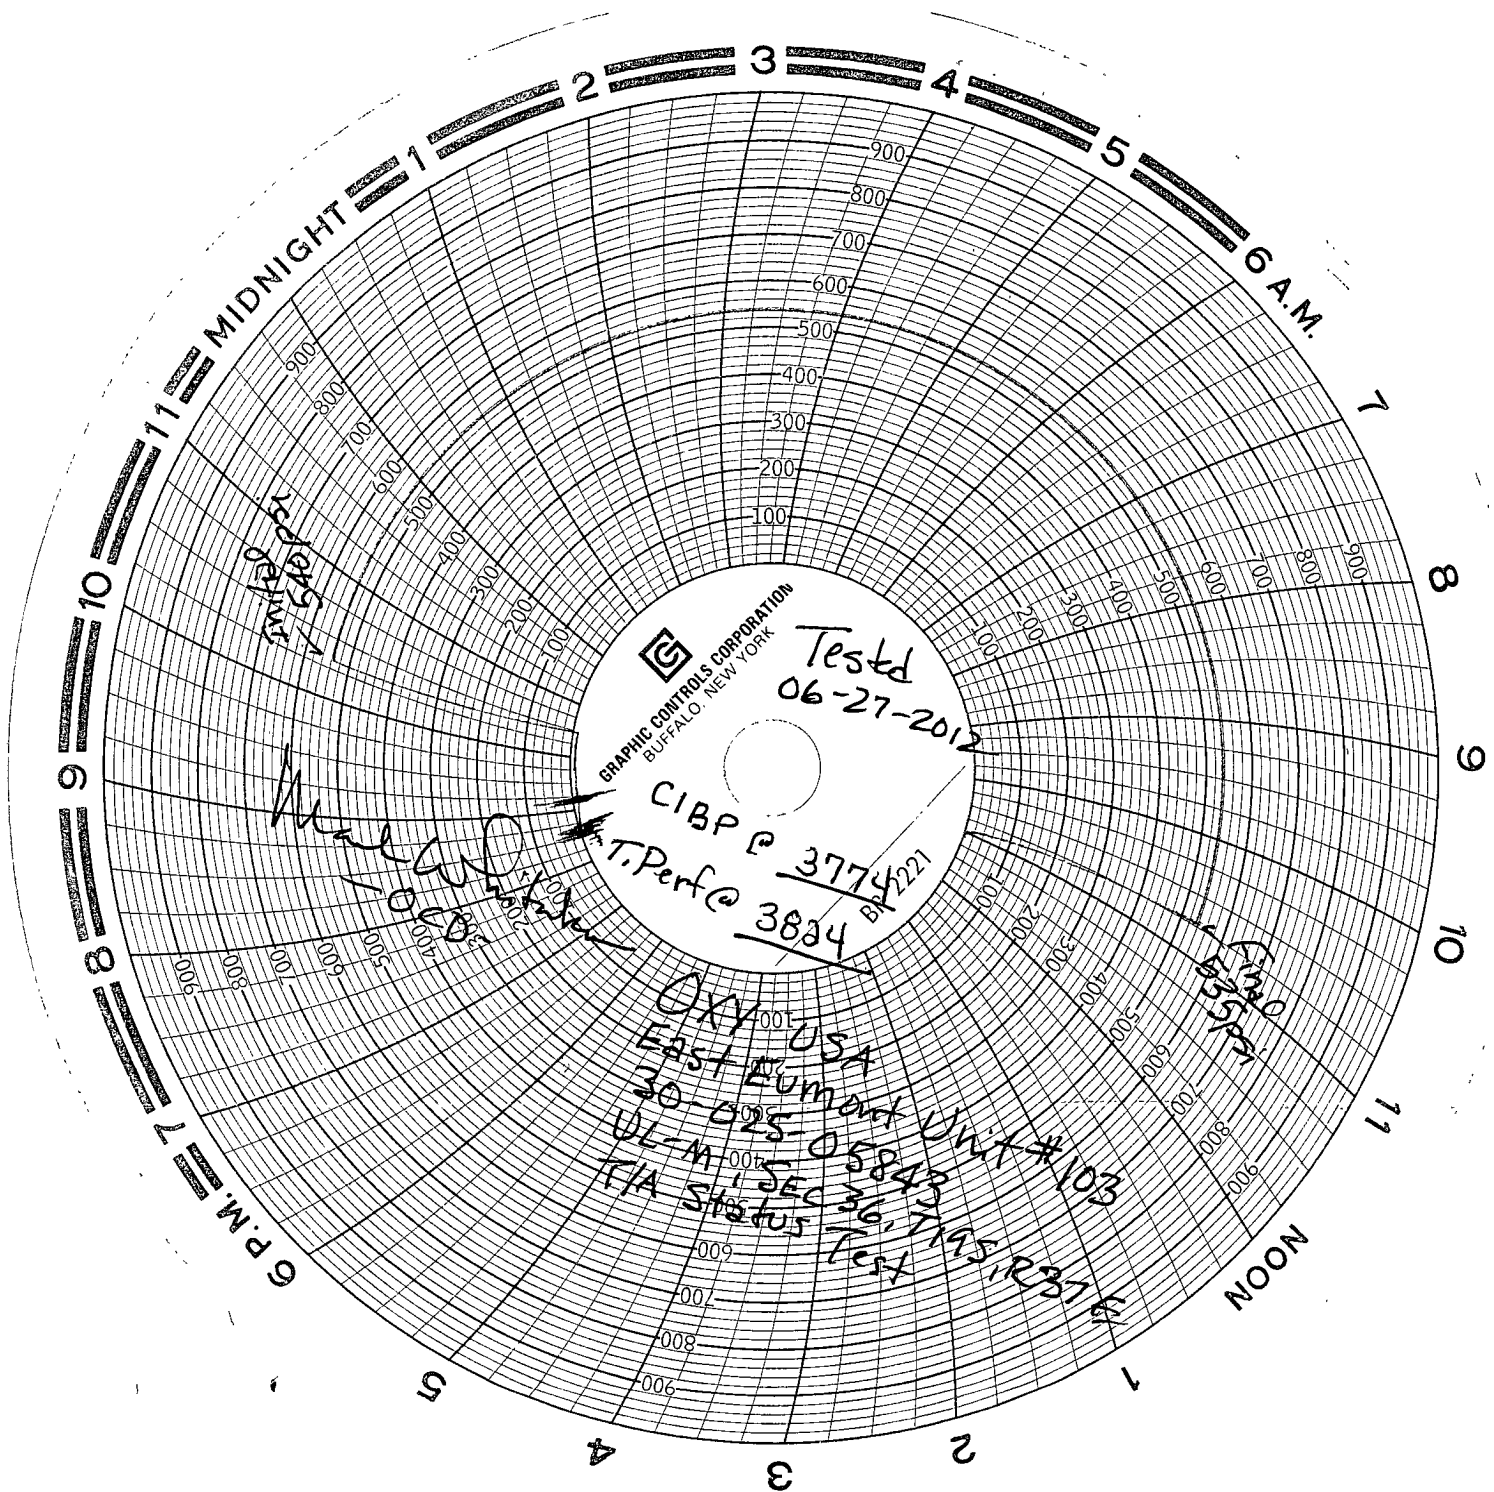

OXY USA WTP LP
East Eumont Unit #103
API No. 30-025-05843

12-1/4" hole @ 308'
8-5/8" csg @ 308'
w/ 350sx-TOC-Surf-Circ

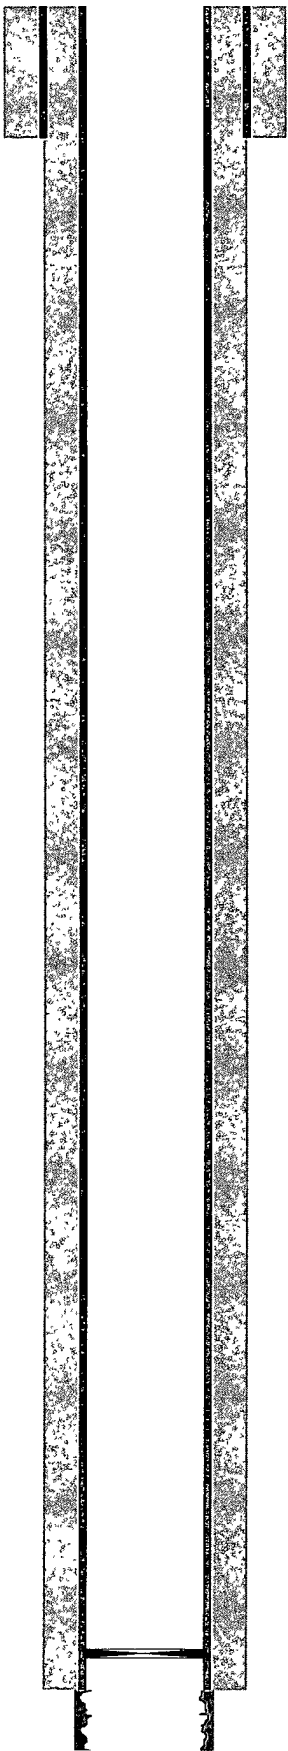

7-7/8" hole @ 3824'
5-1/2" csg @ 3824'
w/ 800sx-TOC-Surf-Calc

CIBP @ 3774'

OH @ 3824-3945'

TD-3945'