

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

HOBBS OIL CONSERVATION DIVISION

DISTRICT I
1625 N French Dr , Hobbs, NM 88240

1220 South St. Francis Dr.
Santa Fe, NM 87505

DISTRICT II
1301 W Grand Ave, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

OCT 09 2012

RECEIVED

WELL API NO 30-025-29730
5 Indicate Type of Lease STATE ☒ FEE ☐
6 State Oil & Gas Lease No
7 Lease Name or Unit Agreement Name South Hobbs (G/SA) Unit
8 Well No 214
9 OGRID No 157984
10 Pool name or Wildcat Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals)	
1 Type of Well Oil Well ☒ Gas Well ☐ Other ☐	
2 Name of Operator Occidental Permian Ltd.	
3 Address of Operator HCR 1 Box 90 Denver City, TX 79323	
4 Well Location Unit Letter <u>E</u> <u>1720</u> Feet From The <u>North</u> Line and <u>549</u> Feet From The <u>West</u> Line Section <u>4</u> Township <u>19-S</u> Range <u>38-E</u> NMPM <u>Lea</u> County <u></u>	
11 Elevation (Show whether DF, RKB, RTGR, etc) 3623' KB	
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐	REMEDIAL WORK ☒ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐	COMMENCE DRILLING OPNS ☐ PLUG & ABANDONMENT ☐
PULL OR ALTER CASING ☐ Multiple Completion ☐	CASING TEST AND CEMENT JOB ☐
OTHER: _____	OTHER: _____

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU & RU.
2. RU wireline & perforate tubing @3793'. RD wireline.
3. NU BOP/ND wellhead.
4. POOH w/ESP equipment.
5. RIH w/bit. Tag @4281'. POOH w/bit.
6. Dump 45 gal of pea gravel down well. Tag @4241'. RU wireline & dump bail 4 sacks of cement on pea gravel. Tag @4240'. Dump bail 2 more sacks of cement. Tag @4240'. Dump 20 more gal of pea gravel. Tag @4232'. Dump bail 15' of pea gravel. Tag @4218'. Dump bail 1 sack of cement. Tag @4208'. RD wireline.
7. RIH w/ESP equipment on 125 jts of 2-3/8" tubing. Top of motor @3969'
8. ND BOP/NU wellhead.
9. RDPU & RU. Clean location and return well to production

RU 06/14/2012

RD 06/20/2012

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 10/05/2012
TYPE OR PRINT NAME Mendy A. Johnson E-mail address mendy_johnson@oxy.com TELEPHONE NO 806-592-6280


For State Use Only

APPROVED BY [Signature] TITLE Dist. Mgr DATE 10-10-2012
CONDITIONS OF APPROVAL IF ANY

OCT 10 2012

October 4, 2012

Work Plan Report for Well:SHOU-214E04

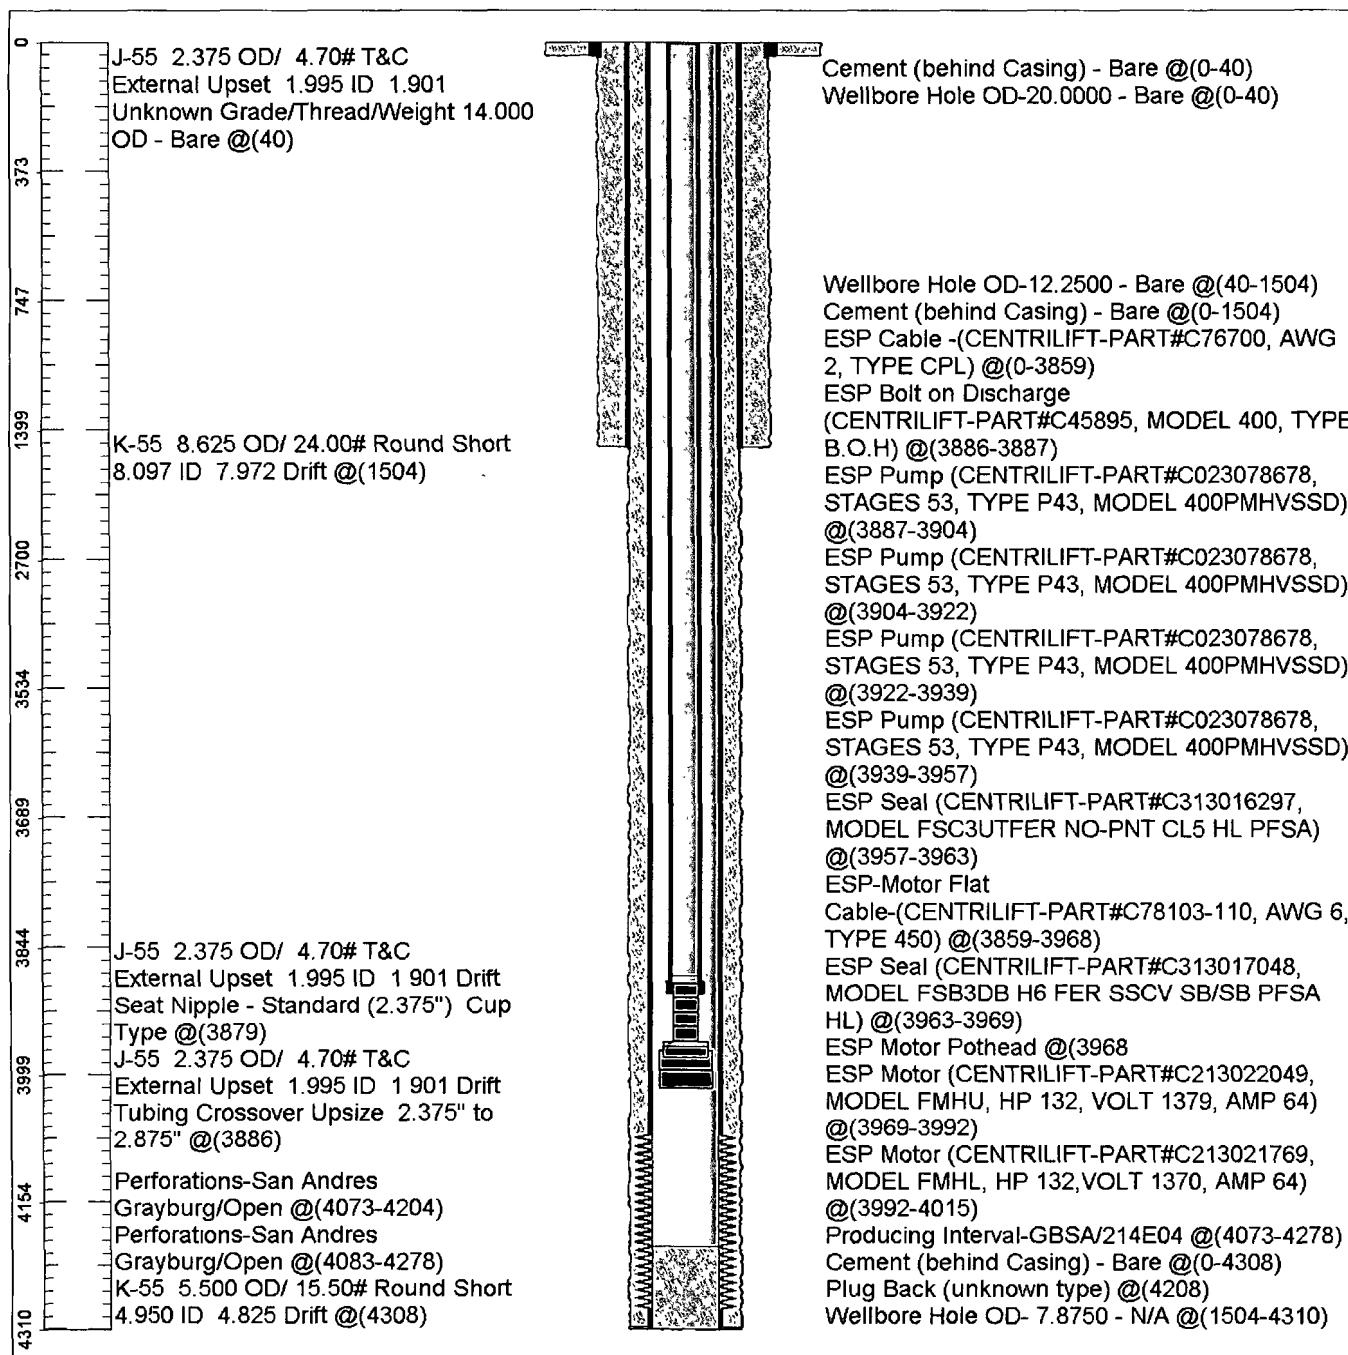

Survey Viewer