

New Mexico Oil Conservation Division, District I

1625 N. French Drive

Hobbs, NM 88240

Form 3160-5
(June 1990)UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NMLC-059001

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Pearsall A #3

9. API Well No.

30-025-36546

10. Field and Pool, or Exploratory Area

Maljamar Graburg-San Andres

11. County or Parish, State

Lea, NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1 Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Mack Energy Corporation

3. Address and Telephone No.

P.O. Box 960, Artesia, NM 88211-0960

(505)748-1288

4. Location of Well (Footage, Sec., T. R., M. or Survey Description)

2310 FSL & 380 FEL, Sec. 33-T17S-R32E, ~~E~~

12 CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒
- Notice of Intent
-
- ☐
- Subsequent Report
-
- ☐
- Final Abandonment Notice


TYPE OF ACTION

- ☒
- Abandonment
-
- ☐
- Recompletion
-
- ☐
- Plugging Back
-
- ☐
- Casing Repair
-
- ☐
- Altering Casing
-
- ☐
- Other
-
- ☐
- Change of Plans
-
- ☐
- New Construction
-
- ☐
- Non-Routine Fracturing
-
- ☐
- Water Shut-Off
-
- ☐
- Conversion to Injection
-
- ☐
- Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work)**

1. Notify BLM 24 hours prior to starting plugging operations.
2. Set CIBP @ 3428' above perfs @ 3528' w/35' cement cap. *Set at 3475'*
3. Circ hole with mud get.
4. Set 100' cement plug 2546' - 2446' 50' above and below 8 5/8" shoe. *TAG*
5. Set 100' cement plug 363' - 263' 50' above and below 13 3/8" shoe. *TAG*
6. 60' circ cement to surface.
7. Install dry hole marker.

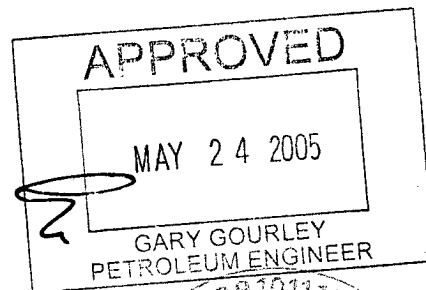

14. I hereby certify that the foregoing is true and correct

Signed *George W. Sherrill*

Title Production Clerk

Date 05/16/2005

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

GWW


•See Instruction on Reverse Side

MACK ENERGY CORPORATION
Pearsall A #3
Sec 33 T17S R32E 2310FSL 380FEL

FEDERAL

1. Notify BLM 24 hrs. prior to any work done.
2. Set CIBP @ 3428' above perms @ 3528' w/35'cmt cap.
3. Circ hole with mud gel.
4. Set 100' cmt plug 2546'-2446' 50' above & below 8 5/8" shoe
5. Set 100' cmt plug 363'-263' 50' above & below 13 3/8" shoe
5. 60' circ cmt to surface
6. Install Dry Hole Marker

BEFORE

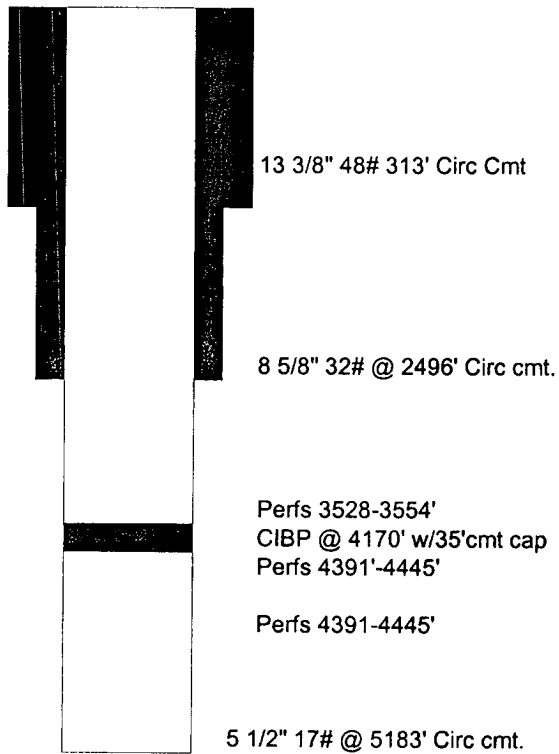

AFTER

