

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06901
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	H.T. MATTERN 'B'
8. Well No.	4
9. Pool Name or Wildcat	PENROSE SKELLY GRAYBURG

<p align="center">SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.</p>	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>P</u> : <u>330'</u> Feet From The <u>SOUTH</u> Line and <u>330'</u> Feet From The <u>EAST</u> Line Section <u>30</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT,GR, etc.)	3468' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐
 OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
 CASING TEST AND CEMENT JOB ☐
 OTHER: ☒ CLEAN OUT & ACIDIZE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-03-05: MIRU. UNSET TAC. TIH W/CROSS OVER, 3531', 114 JTS.
 8-04-05: TIH W/BIT & TAG @ 3897.
 8-05-05: HU BLOWDOWN TANK. DRILL 3897-3920'.
 8-08-05: TAG @ 3915. WASH W/SONIC HAMMER TO 3920. WASH UP TO SHOE @ 3635.
 8-09-05: TIH W/SONIC HAMMER. TAG @ 3638, 3665, 3705, HARD @ 3760. TIH TO 3760. WASH 3760 TO 3920.
 8-10-05: TIH TO 3912. TIH W/SONIC HAMMER & 2 3/8" TBG TO 3912. ACIDIZE OPEN HOLE 3920-3635 W/SONIC HAMMER, 3000 GALS 15% HCL. TIH W/BIT & 114 JTS TO 3536.
 8-11-05: TIH W/BIT TO TAG @ 3710. WASH OUT BRIDGES 3734, 3792, 3815, 3835, 3860, 3910, TO 3920. SPOT CHEMICAL, SCALE INHIB MIXED W/50 BBLs OF 2% KCL.
 8-12-05: RU SWAB.
 8-15-05: SWABBING. TIH & TAG @ 3900. TIH W/PROD TBG TO 3805.
 8-16-05: TIH W/PMP & RODS. RIG DOWN. FINAL REPORT

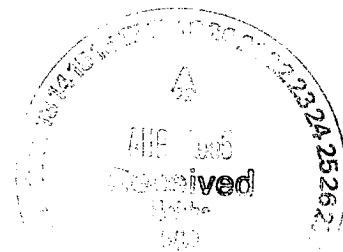

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 8/18/2005

TYPE OR PRINT NAME Denise Pinkerton Telephone No. 432-687-7375

(This space for State Use)
 APPROVED Gary W. Wink
 CONDITIONS OF APPROVAL, IF ANY: TITLE

ORIGINAL SIGNED BY
 GARY W. WINK
 OG FIELD REPRESENTATIVE II/STAFF MANAGER

DATE AUG 25 2005
 DeSoto/Nichols 12-95