

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.

30-025-24786

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

L.W. White

7. Well No.

2

8. Pool name or Wildcat

Eumont Yates 7RQ

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☐ Other ☒ TA'd

2. Name of Operator

Amerada Hess Corporation

3. Address of Operator

P. O. Box 840, Seminole, Texas 79360

4. Well Location

Unit Letter C : 660 feet from the North line and 1980 feet from the West line

Section 2 Township 21S Range 35E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

3569.2' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐


OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Notify NMOCD 24 hours before rig-up.

Plan to MIRU plugging unit, remove wellhead & install BOP. Spot 35' min. cement plug on top of plug at 3862'. Spot plug mud to 1800'. Perforate 5-1/2" csg. at 1800' & attempt to circ. If able to circ., pump 20 sks. cement down csg. w/wiper plug. Tag TOC. Circ. plug mud. Spot 25 sks. cement fr. 386' - 183'. Tag TOC. Spot 10 sks. cement fr. 80' to surface. Install hole marker & clean location.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

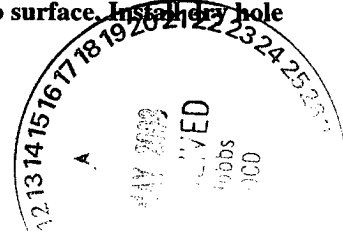

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Chad McGehee TITLE Sr. Petroleum Engineer DATE May 9, 2003

Type or print name Chad McGehee Telephone No. 915 758-6707

(This space for State use)

APPROVED BY Harry W. Wink TITLE OC FIELD REPRESENTATIVE II / STAFF MANAGER DATE MAY 15 2003

Conditions of approval, if any