

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 87210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-24630
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No. N/A
7. Lease Name or Unit Agreement Name: STEELER
8. Well No. 2
9. Pool name or Wildcat LANGLIE MATTIX

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other	
2. Name of Operator JOHN H. HENDRIX	
3. Address of Operator 403 WALL TOWERS WEST, MIDLAND, TEXAS 79701	
4. Well Location Unit Letter <u>I</u> : <u>2310</u> feet from the <u>SOUTH</u> line and <u>990</u> feet from the <u>EAST</u> line Section <u>19</u> Township <u>23S</u> Range <u>37-E</u> NMPM <u>LEA</u> County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3317' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

WELL BORE - 8 5/8" CASING 376' - 11" HOLE 275 SX. - 5 1/2" CASING - 3672'.

- 1.) SET CIBP AT 3274'; CAP WITH 25 SACKS OF CEMENT.
- 2.) CIRCULATE HOLE WITH 9.5# MUD.
- 3.) SPOT 25 SX. OF CEMENT AT 2830'.
- 4.) WOC; TAG TOP OF CEMENT AT 2730'.
- 5.) PERFORATE CASING AT 1330'.
- 6.) SQUEEZE PERFORATIONS WITH 55 SX. OF CEMENT; WOC; TAG TOP OF CEMENT AT 1230'.
- 7.) PERFORATE CASING AT 426'.
- 8.) SQUEEZE PERFORATIONS WITH 100 SX. OF CEMENT; WOC; TAG TOP OF CEMENT AT 326'.
- 9.) CUT OFF WELLHEAD; SPOT A 10 SX. SURFACE PLUG; INSTALL DRY HOLE MARKER.



I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Howard Boatright TITLE AGENT DATE 06/05/2003

Type or print name HOWARD BOATRIGHT

(This space for State use)

Telephone No. (432)570-5382

APPROVED BY PETROLEUM ENGINEER TITLE


Conditions of approval, if any:

DATE JUN 12 2003

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

John H. Hendrix Corporation
STEELER #2
Lea County, New Mexico

BEFORE PLUGGING

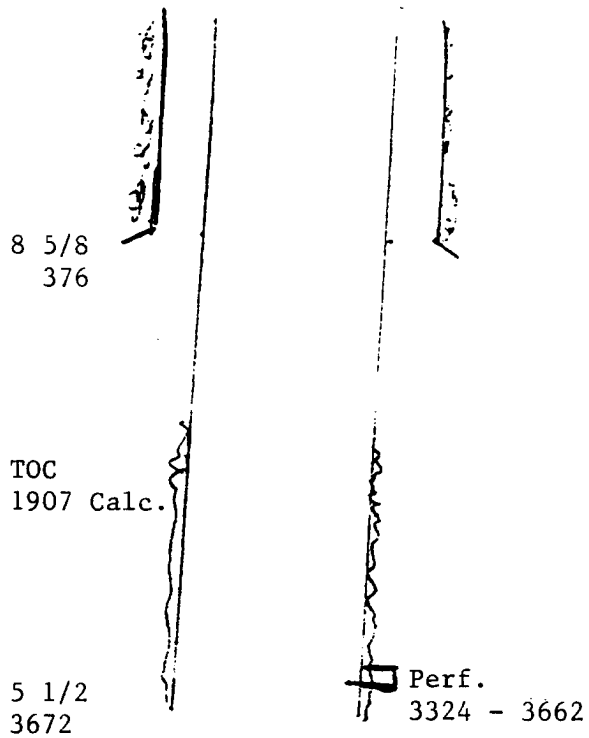

AFTER PLUGGING

