

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO.
30-025-35104

5. Indicate Type of Lease
STATE XX FEE

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
TMBR "10" STATE

1. Type of Well:
Oil XX GAS
WELL XX WELL OTHER

2. Name of Operator
TMBR/SHARP DRILLING, INC.

8. Well No. 1

3. Address of Operator
P.O. DRAWER 10970, MIDLAND, TEXAS 79702

9. Pool name or Wildcat
WILDCAT

4. Well Location
Unit Letter L : 2630 Feet From The SOUTH Line and 713 Feet From The WEST Line

Section 10 Township 14S Range 34E NMPM: LEA County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4123' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT XX
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1.) 02/26/2003 - NOTIFIED OCD BILLY P.
- 2.) 02/28/2003 - SET CIBP ON TUBING AT 9950'.
- 3.) CIRCULATED HOLE WITH 10# MUD LADEN FLUID.
- 4.) SPOTTED 25 SACKS OF CEMENT AT 9950' TO 9698'.
- 5.) 03/04/2003 - CUT 5 1/2" CASING AT 5500'.
- 6.) 03/06/2003 - SPOTTED 50 SACKS OF CEMENT AT 5550'.
- 7.) 03/07/2003 - TAGGED TOC AT 5365'.
- 8.) SPOTTED 50 SACKS OF CEMENT AT 4500'; WOC; TAGGED TOC AT 4386'.
- 9.) SPOTTED 50 SACKS OF CEMENT AT 2970' TO 2778'.
- 10.) SPOTTED 50 SACKS OF CEMENT AT 535'.
- 11.) 03/10/2003 - TAGGED TOC AT 345'; CIRCULATED 15 SACKS OF CEMENT FROM 60' TO SURFACE.
- 12.) CUT OFF WELLHEAD AND DEADMAN.
- 13.) INSTALLED DRY HOLE MARKER.
- 14.) BACKFILLED PIT AND CELLAR.

Approved as to plugging of the Well Bore
Liability under bond is retained until
surface restoration is completed.

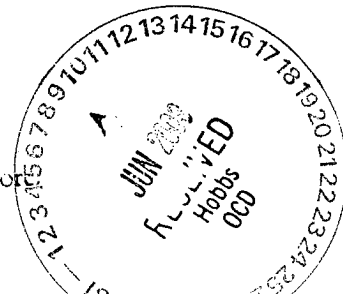

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Lonnie Arnold TITLE Production Manager DATE 6/5/03

TYPE OR PRINT NAME Lonnie Arnold TELEPHONE NO. (432) 699-5050

(This space for State Use)

APPROVED BY Gary W. Wink

OC FIELD REPRESENTATIVE II/STAFF MANAGER
TITLE DATE

JUN 17 2003

CONDITIONS OF APPROVAL, IF ANY: