

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87400
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
June 19, 2008

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-20283
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: NEW MEXICO S STATE
8. Well Number 25
9. OGRID Number 005380
10. Pool name or Wildcat BLINEBRY
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	2. Name of Operator XTO Energy, Inc.
3. Address of Operator 200 N. Loraine, Ste. 800 Midland, TX 79701	4. Well Location Unit Letter N : 810 feet from the SOUTH line and 2130 feet from the WEST line Section 2 Township 22S Range 37E NMPM County LEA
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

FILL STRING #1 TO SURFACE. STRING #2 PERF & SQZ @ 1500' 360' 60'.
1. MIRU WSU, NU BOP on string #1. RIH w/1.9" tbg. Tag TOC. 2. Pump 50sx cmt fr 5590'-3560'. 3. Pump 50sx cmt fr 3560'-1500'. 4. Spot plug @ 1500'. WOC & Tag. 5. Spot plug @ 1250'. WOC & tag. 6. Spot plug fr 360'-200'. WOC & Tag. 7. Spot plug fr 60' to surf. 8. ND BOP, NU BOP on string 2. Set 2 7/8" CIBP @ 5590'. 9. Pump 50sx fr 5590'-3560'. 10. Pump 50sx cmt fr 3560'-1500'. 11. Spot plug @ 1500'. WOC & Tag. 12. PERF @ 1500'. Spot plug @ 1250'. WOC & Tag. 13. Spot plug fr 360'-200'. WOC & Tag. 14. Spot plug fr 60'-Surf. 15. Cut 1500' off WH & anchors, weld on dry hole marker. **PERF & SQZ @ 360'** **PERF & SQZ @ 60' (SQZ 50sx)**

Spud Date:


Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Stephanie Rabadue TITLE Regulatory Analyst DATE 12/14/2012
Type or print name Stephanie Rabadue E-mail address: stephanie.rabadue@xtoenergy.com PHONE 432-620-6714

For State Use Only
APPROVED BY Mark Brown TITLE Compliance Officer DATE 1/4/2013
Conditions of Approval (if any): 7.m. Chm.

JAN 08 2013

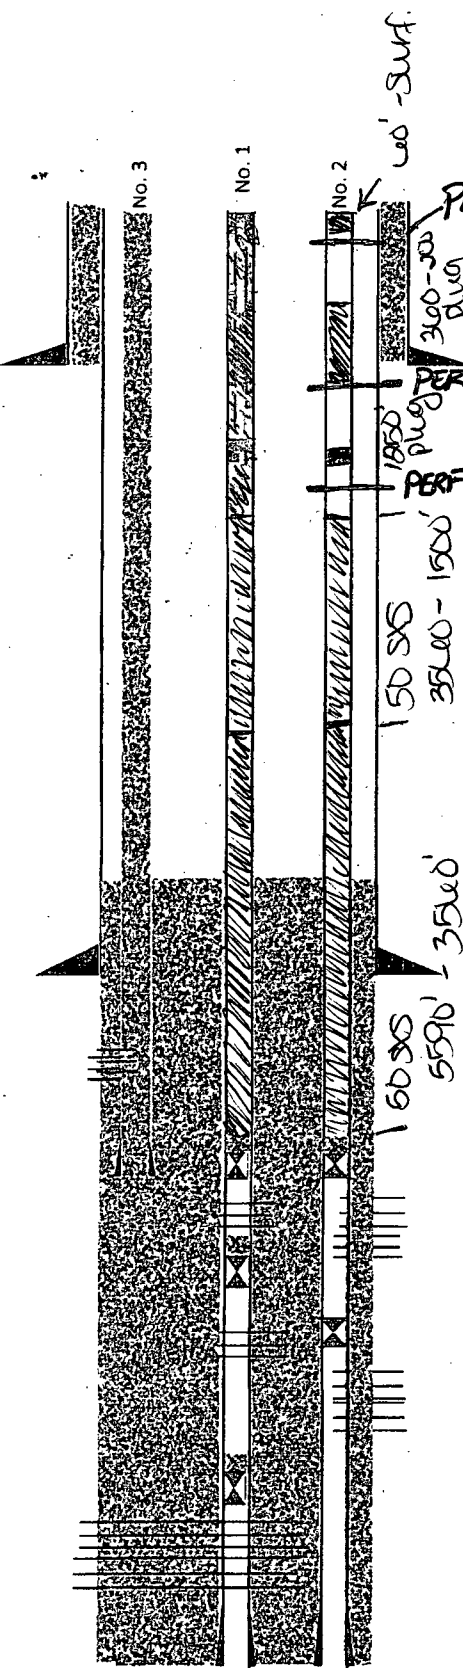

**NM S STATE 25
LEA COUNTY, NM.**

Proposed

	Size	Wt.	Grde	Thrd	Depth	(E)TOC	Sks/Cmt
SURFACE	13-3/8"	48	H-40	ST&C	305	Surface	235
INTERMEDIATE	9-5/8"	32.3	H-40	ST&C	2660	1275 000	600
PRODUCTION 1	2-7/8"	6.4	J-55	NON-EUE	7,393	1500 000	1475
PRODUCTION 2	2-7/8"	6.4	J-55	NON-EUE	7,393	1500 000	
PRODUCTION 3	2-7/8"	6.4	J-55	NON-EUE	5,456	1500 000	
TUBING	1 900"				980		

Description	OD	ID	Depth
STRING #1 NORTH			
30 JOINTS 1.9" TUBING			980'
CIBP W/20' CEMENT STRING 1			5590
BLINEBRY PERFS	5672-5740, 5778-5814		
CIBP W/20' CEMENT STRING 1			6200
DRINKARD PERFS	6255-6486		
CIBP W/35' CEMENT STRING 1			7250
GRANITE WASH PERFS	7300-7318, 7342-7359		
STRING #2 EAST			
CIBP W/20' CEMENT STRING 2			5590
OTIS MODEL DD RETRIEVABLE TUBING STOP w/PLUG			6000
WANTZ ABO PERFS	6520-7155		
STRING #3 WEST			
STRING #3 PLUGGED. CEMENTED GRAYBURG PERFS & TUBING STRING TO SURFACE 12-05-91 WITH 110 SX CEMENT.			
GRAYBURG PERFS	3678-3746		

PBTD MD	7361
TVD	
T DPTH MD	7395
TVD	
FLUID LIH	
DATE LIH	
PREPARED BY:	ABE HARDER
DATE:	9/1/2011