

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-02795
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 004782
7. Lease Name or Unit Agreement Name LOWE STATE COM
8. Well Number 1
9. OGRID Number 009338
10. Pool name or Wildcat TOWNSEND MORROW GAS

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "NOTIFICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator
GREAT WESTERN DRILLING COMPANY

3. Address of Operator
P.O. BOX 1659 MIDLAND, TEXAS 79702

4. Well Location
Unit Letter A : 330 feet from the NORTH line and 330 feet from the EAST line
Section 17 Township 16S Range 35E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4,040' KB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Proposed start date: November 1, 2012.

1. Release the packer, circulate the well full of mud and pull out of the hole with the tubing and packer.
2. Set a cast iron bridge plug with wire line at 12,400' and cap with 3 sacks of cement. **25SKCMT+**
3. Use wireline to cut the **4 1/2"** casing at $\pm 10,400'$. Pull and lay out the casing. **SPOT A STOP PLUG 10450' - TAG**
4. Run in the hole with the tubing and spot 40 sacks of class C cement from 8,650' back to 8,550'. Spot 40 sacks of class C cement from 6,200' back to 6,100'. Spot 40 sacks of class C cement from 4,699' back to 4,599'. Wait on cement and tag. **SPOT 25SKS+**
5. Spot 40 sacks of class C cement from 1,888' back to 1,788'. Spot 40 sacks of class cement from 417' back to 317'. Wait on cement and tag. **@ 3050'**
5. Pull up and spot 20 sacks of class C cement from 50' back to the bottom of the cellar.
6. Cut off the casing, install a dry hole marker, fill the cellar and clean the location.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Sam Roberts TITLE Area Engineer DATE 9/6/12
Type or print name Sam Roberts E-mail address: sroberts@gwdr.com PHONE: 432-682-5241
For State Use Only
APPROVED BY: Maley Brown TITLE Compliance Officer DATE 1/24/2013
Conditions of Approval (if any)

Oil Conservation Division - Hobbs office. Must be Notified 24 hours prior to the beginning of Plugging Operations begin.

Low State Com #1 8-28-12

Well: Lowe State Com #1
 Location: surface 330' FNL & 330' FEL
 bottom 1,978' FNL & 898' FEL (1,695' S19°W)
 Sec 17 T16S R35E
 Lea County, New Mexico
 API# 30-025-027950

Operator: GWDC
 Spud date: 5/7/55 P&A 10/20/70
 re-entry side track 1/26/72
 Elevations: KB 4,040'
 GL-KB 18'
 GL 4,022'

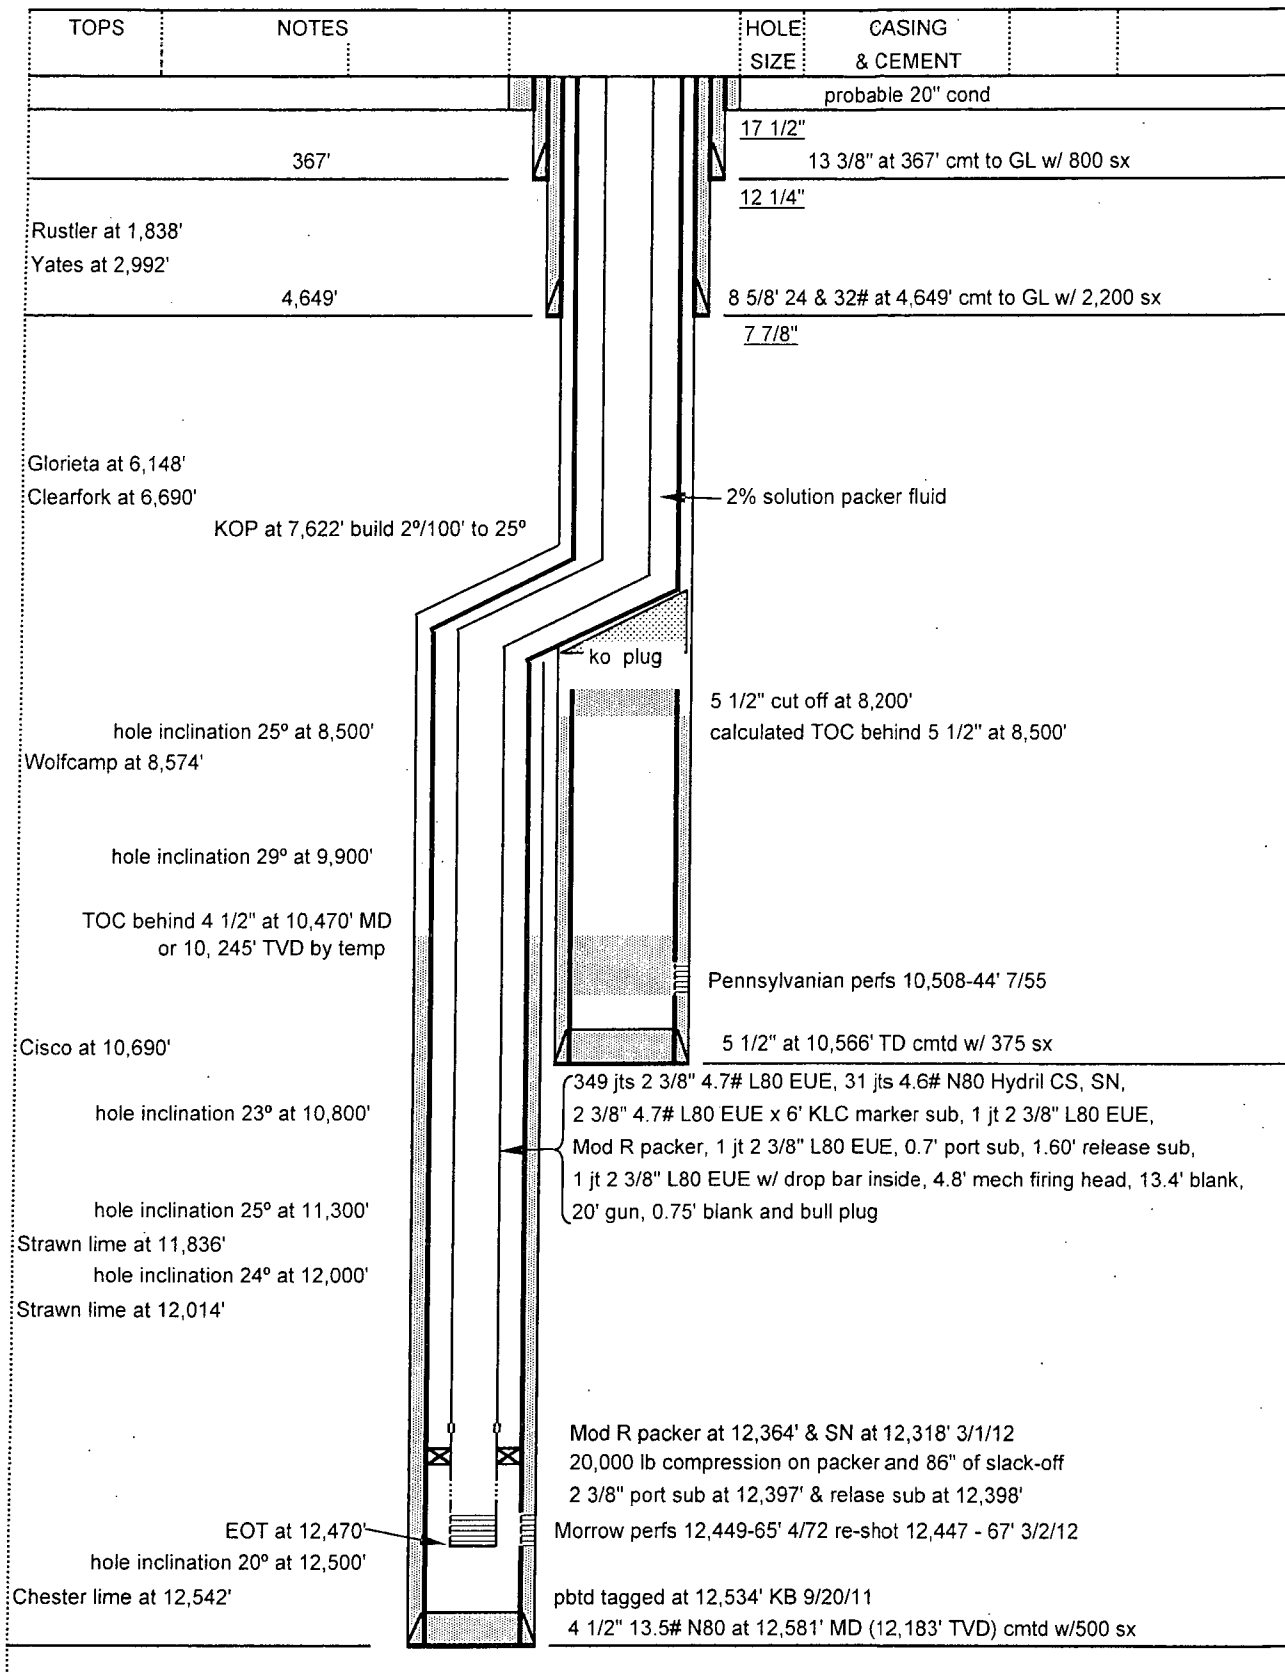

Lowe State Com #1 P&A plan

Well: Lowe State Com #1
 Location: surface 330' FNL & 330' FEL
 bottom 1,978' FNL & 898' FEL (1,695' S19°W)
 Sec 17 T16S R35E
 Lea County, New Mexico
 API# 30-025-027950

Operator: GWDC
 Spud date: 5/7/55 P&A 10/20/70
 re-entry side track 1/26/72
 Elevations: KB 4,040'
 GL-KB 18'
 GL 4,022'

