

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

HOBBS OGD 1000 N. Church Drive Hobbs, NM 88240

FORM APPROVED OMB No. 1004-0137 Expires: October 31, 2014

JUL 25 2013

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No. NM-02419
6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well [X] Oil Well [ ] Gas Well [ ] Other
2. Name of Operator Celero Energy II, LP
3a. Address 400 W. Illinois, Ste. 1601 Midland TX 79701
3b. Phone No. (432)686-1883
4. Location of Well (A) Sec 33, T13S, R31E 990' FNL & 330' FEL
7. If Unit of CA/Agreement, Name and/or No. NM-10935X
8. Well Name and No. Drickey Queen Sand Unit #10
9. API Well No. 30-005-21115
10. Field and Pool or Exploratory Area Caprock; Queen
11. County or Parish, State Chaves NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

Table with columns TYPE OF SUBMISSION and TYPE OF ACTION. Includes checkboxes for Notice of Intent, Subsequent Report, Final Abandonment Notice, Acidize, Alter Casing, Casing Repair, Change Plans, Convert to Injection, Deepen, Fracture Treat, New Construction, Plug and Abandon, Plug Back, Production (Start/Resume), Reclamation, Recomplete, Temporarily Abandon, Water Disposal, Water Shut-Off, Well Integrity, Other.

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)
1. Tag at 2505' and circulate salt mud to 1170'.
2. Pull tubing to 2078' and spot 25 sx Class C. POOH w/tubing.
3. RU wireline and perforate(4) at 1170' and (4) at 358'. RD wireline.
4. RIH w/tubing and tag plug at/above 1070'. POOH w/tubing.
5. RIH w/packer and squeeze 40 sx into perfs at 1170'. POOH w/packer. RBIH w/BP & PS and tag TOC at/above 1070'. Circulate salt mud to 358'. POOH.
6. Set packer at 30 and establish circulation to 5-1/2"-by-8-5/8" annulus. Circulate cement to surface on 5-1/2"-by-8-5/8" annulus by pumping a minimum 80 sx Class C.
7. POOH w/packer. WOC a minimum 4 hours, tag and top off 5-1/2" casing.
8. RD, remove wellheads, set P&A marker, clean and reclaim location.

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) Lisa Hunt Title Regulatory Analyst
Signature Lisa Hunt Date 06/20/2013

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by ISI DAVID R. GLASS Title PETROLEUM ENGINEER Date JUL 09 2013
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. EG 7-30-2013 Office Roswell Field Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.
APPROVED FOR 3 MONTH PERIOD ENDING OCT 09 2013 SEE ATTACHED FOR CONDITIONS OF APPROVAL JUL 30 2013

# CELERO ENERGY

**FIELD:** Caprock  
**LEASE/UNIT:** Drickey Queen Sand Unit  
**COUNTY:** Chaves

**DATE:** 20-Jun-13  
**BY:** MWM  
**WELL:** 10  
**STATE:** New Mexico

Location: 990' FNL & 330' FEL, Sec 33A, T13S, R31E

SPUD: 5/93 COMP: 5/93


CURRENT STATUS: SI Producer

Original Well Name: Circle Ridge Production Drickey Queen Sand Tract 12 #2

KB =

GL = 4200'

API = 30-005-21115

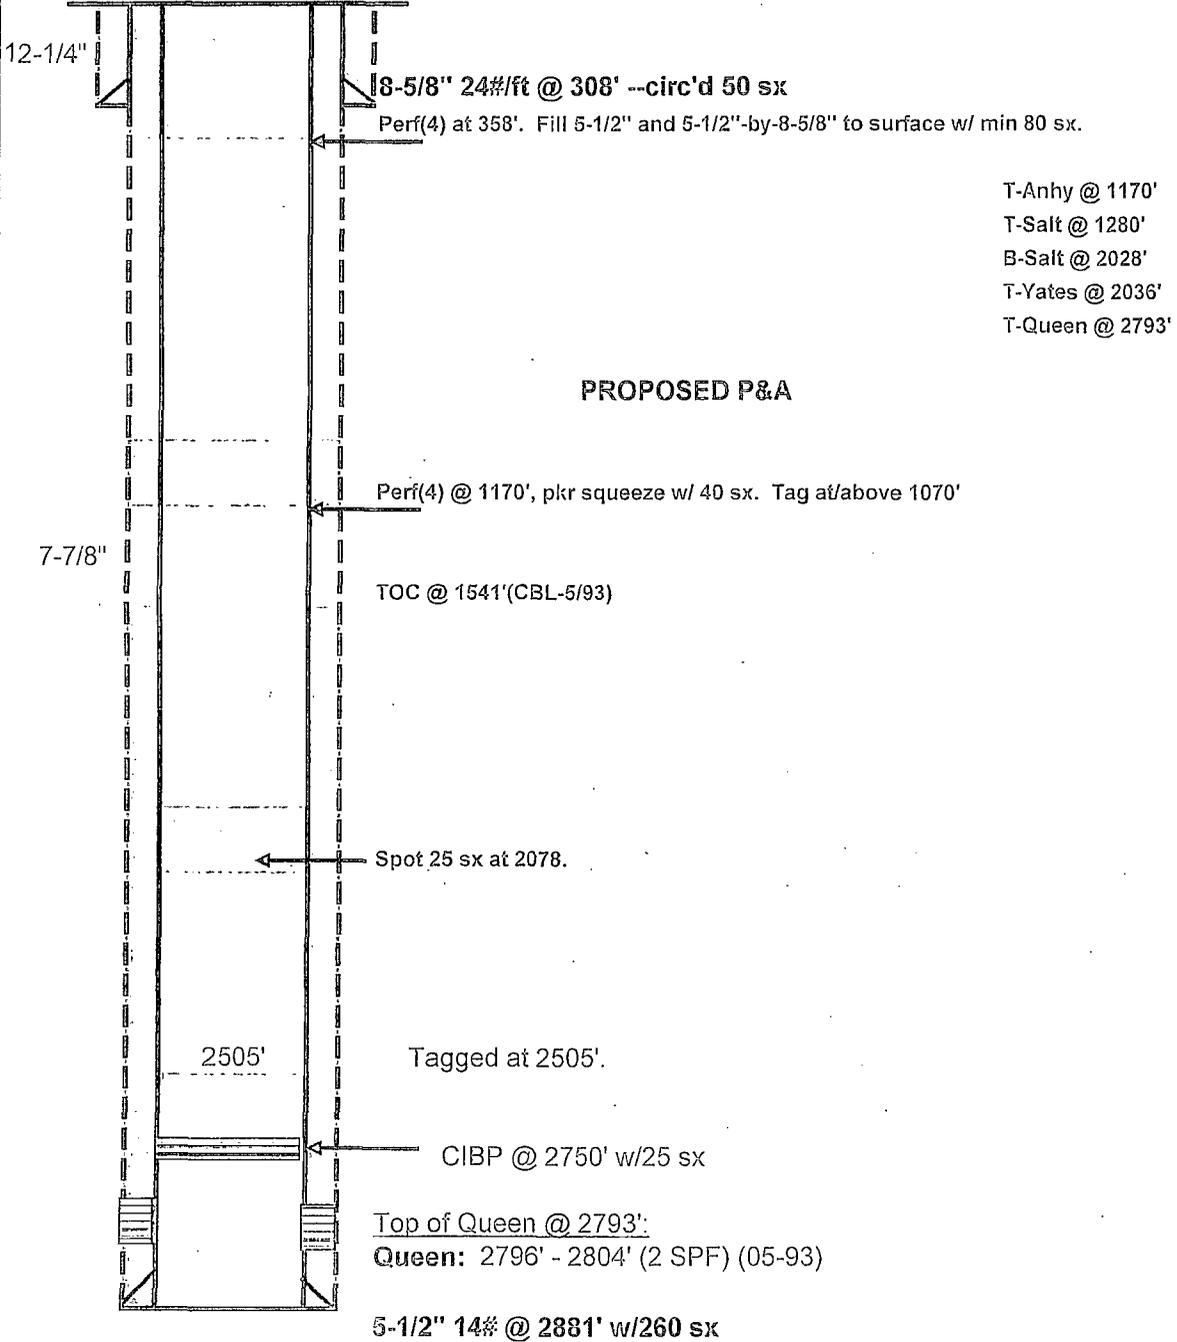

PBTD -  
TD - 2881'

# CELERO ENERGY

FIELD: Caprock  
LEASE/UNIT: Drickey Queen Sand Unit  
COUNTY: Chaves

DATE: 20-Jun-13  
BY: MWM  
WELL: 10  
STATE: New Mexico

Location: 990' FNL & 330' FEL, Sec 33A, T13S, R31E

SPUD: 5/93 COMP: 5/93


CURRENT STATUS: SI Producer

Original Well Name: Circle Ridge Production Drickey Queen Sand Tract 12 #2

KB =

GL = 4200'

API = 30-005-21115

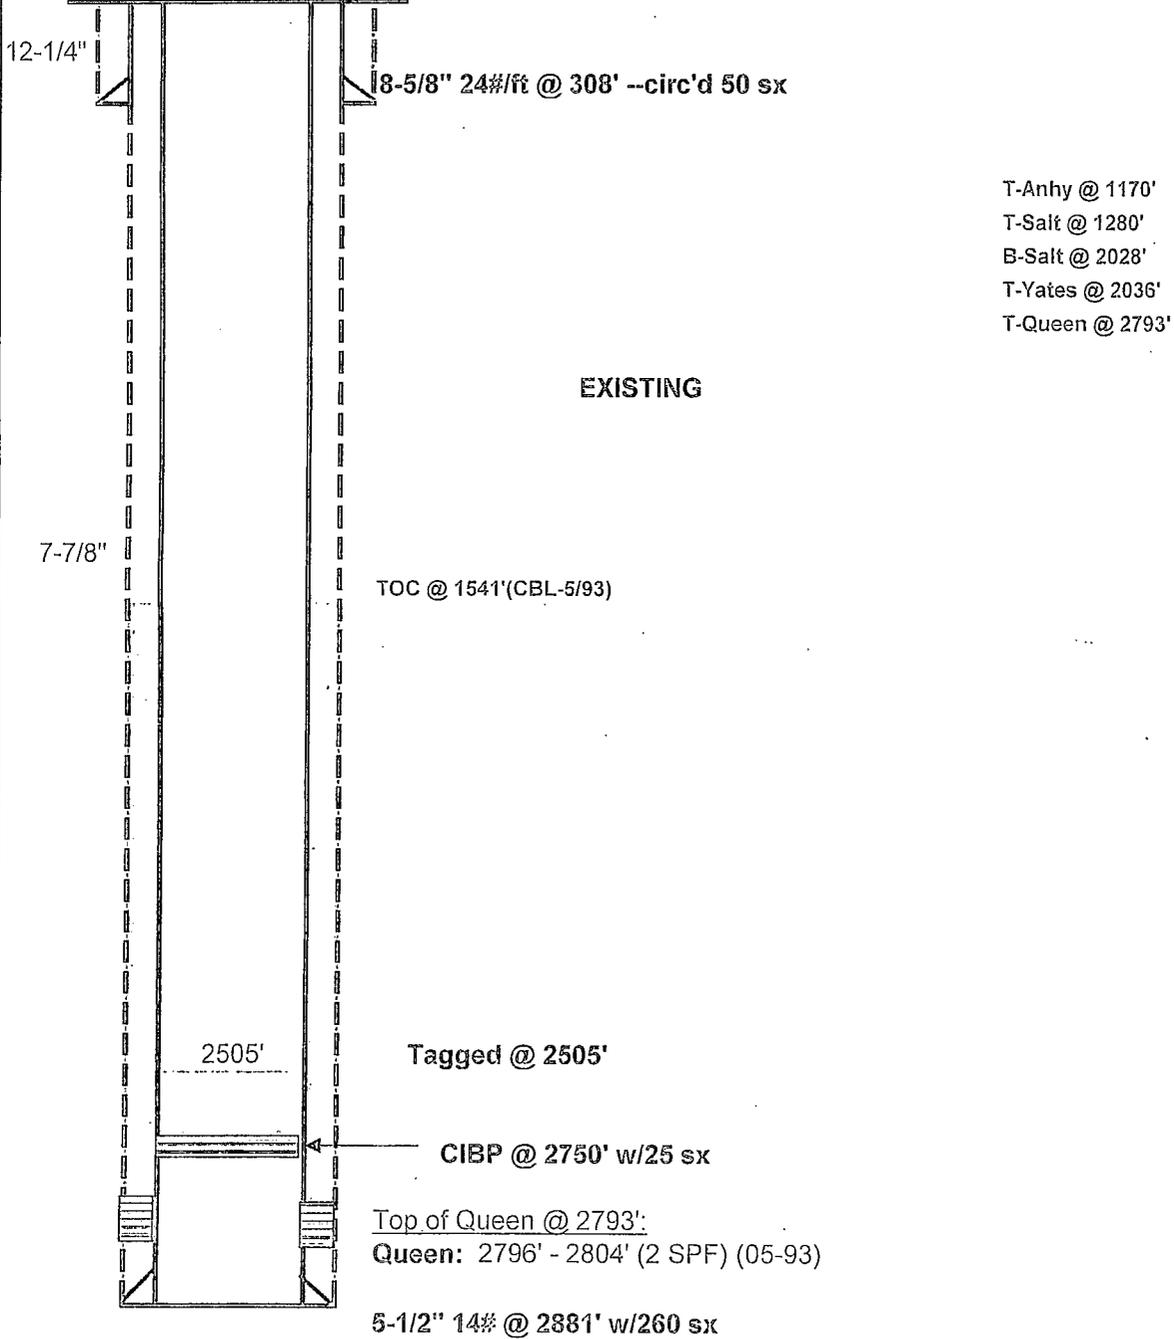

BUREAU OF LAND MANAGEMENT  
Roswell Field Office  
2909 West Second Street  
Roswell, New Mexico 88201  
(575) 627-0272

**Permanent Abandonment of Federal Wells  
Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90) days** from the approval date of this Notice of Intent to Abandon. **If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office (RFO), prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.**

2. Notification: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.