| State of New Mexico Office | , |
|---|---|
| District I – (575) 393-6161 Energy, Minerals and Natural R | Revised August 1, 2011 |
| 1625 N. French Dr., Hobbs, NM 88240 10835 OCD District II – (575) 748-1283 | WELL API NO. |
| OH CONSERVATION ON | /ISION 30-025-0560 5. Indicate Type of Lease |
| District III – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 UG 01 2013 1220 South St. Francis I | Dr. STATE FEE |
| District IV – (505) 476-3460 Santa Fe, NM 87505 | 6. State Oil & Gas Lease No. |
| 1220 S. St. Francis Dr., Santa Fe, NM | 8-2330 |
| SUNDRY NOTICES AND REPORTS ON WELLS | 7. Lease Name or Unit Agreement Name |
| (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BA | CV TO A |
| DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUPPROPOSALS.) | |
| 1. Type of Well: Oil Well Gas Well Other | 8. Well Number 42 |
| 2. Name of Operator | 9. OGRID Number 192463 |
| OXY USA WTP Limited Partnership | |
| 3. Address of Operator P.O. Box 50250 Midland, TX 79710 | 10. Pool name or Wildcat |
| | Eumont Tates TRan |
| 4. Well Location | line and 1980 feet from the west line |
| · | |
| Section 15 Township 195 Range 37E NMPM County Lea 11. Elevation (Show whether DR, RKB, RT, GR, etc.) | |
| 3659 | , 11, 51, 515.) |
| | ~, |
| 12. Check Appropriate Box to Indicate Nature | e of Notice, Report or Other Data |
| NOTICE OF INTENTION TO: | SUBSEQUENT DEDODT OF: |
| | SUBSEQUENT REPORT OF: MEDIAL WORK |
| TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A | |
| PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT JOB | |
| DOWNHOLE COMMINGLE | |
| ~ C A () () ~ | |
| OTHER: Pert Add' Tuterum 4 Test D OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date | |
| of starting any proposed work). SEE RULE 19.15.7.14 NMAC. Fo | |
| proposed completion or recompletion. | . Multiple Completions. Attach wendore diagram of |
| Prof | |
| · | • |
| | |
| | |
| See Attached | |
| JEE MACKEE | |
| | |
| | |
| | |
| | |
| | |
| Spud Date: Rig Release Date: | |
| | |
| | |
| I hereby certify that the information above is true and complete to the best of | my knowledge and belief. |
| 111 | |
| SIGNATURE / G. Regula | tory Advisor DATE 7/29/13 |
| | DITTE HOLLS |
| | id_stewart@oxy.com PHONE: 432-685-5717 |
| For State Use Only | |
| APPROVED BY TITLE ST. | MG= DATE Q-7-7012 |
| Conditions of Approval of any): | DATE |
| | AUG 07 2013 √ |
| | AUG UI 2013 V |

EEU-042


OXY USA WTP LIMITED PARTNERSHIP respectfully request permission to recomplete the above mentioned well in the Lower Seven Rivers. This recompletion will be a test to evaluate the potential of the inactive portion of the field. The detail procedure is attached along with the current and proposed wellbore diagrams for review.

Program

Seven Rivers Recompletion

- 1. MIRU PU. ND X-Mas Tree. NU BOP.
- 2. POH polished rods & tubing.
- 3. Set CIBP at +/- 3794'.
- 4. Pressure test casing.
- 5. Perforate Seven Rivers in the approximate interval 3488-3508' & 3445-3465'.
- 6. RIH with packer on workstring, and frac Lower Seven Rivers perforations.
- 7. Open the well and let flow until recover frac fluid load.
- 8. Unset packer. POH.
- 9. RIH production string with seating nipple and tubing anchor.
- 10. Set tubing hanger. ND BOP. NU Rod BOP and well head.
- 11. RIH rod pump. Space out. Install polished rod. Test pump function.
- 12. RD Well Service Rig.
- 13. Put the well on production.

OXY USA WTP LP - Proposed East Eumont Unit #42 API No. 30-025-05601

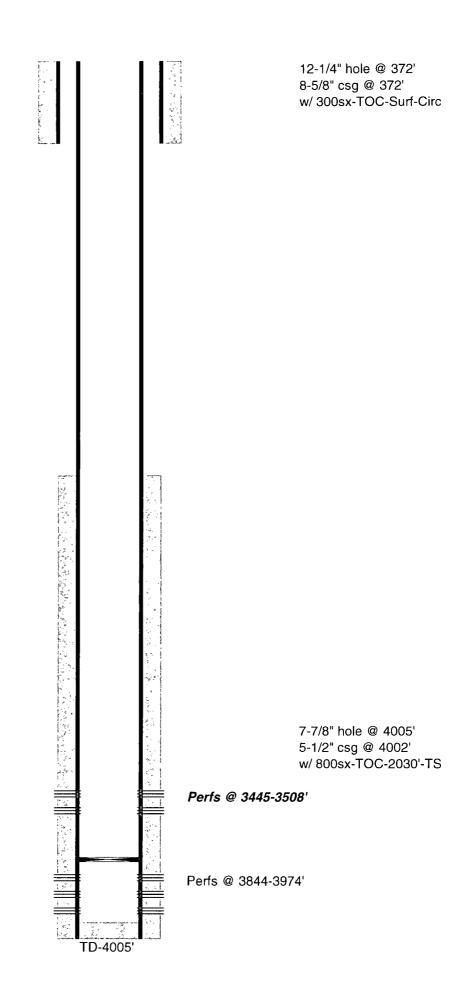

CIBP @ 3794'

PB-3984'

OXY USA WTP LP - Current East Eumont Unit #42 API No. 30-025-05601

PB-3984'

