

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

HOBBS OGD

SEP 20 2013

RECEIVED

WELL API NO. 30-025-05479
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 24
8. Well No. 412
9. OGRID No. 157984
10. Pool name or Wildcat Hobbs (G/SA)

SUNDRIY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator Occidental Permian Ltd.	
3. Address of Operator HCR 1 Box 90 Denver City, TX 79323	
4. Well Location Unit Letter <u>A</u> : <u>330</u> Feet From The <u>North</u> Line and <u>330</u> Feet From The <u>East</u> Line Section <u>24</u> Township <u>18-S</u> Range <u>37-E</u> NMPM Lea County	
11. Elevation (Show whether DF, RKB, RTGR, etc.) 3670' GL	
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ Multiple Completion ☐ OTHER: _____ ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER: <u>OAP/AT</u> ☒

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU & RU.
2. RU wire line and shoot drain holes in tubing @3790'. RD wire line.
3. ND BOP/NU wellhead.
4. POOH and lay down ESP equipment.
5. RIH w/bit. Tag TD @4307'. POOH w/bit.
6. RU wire line and perforate casing at 4076-94', 4099-4104', 4108-18', at 4 JSPF. RD wire line.
7. RIH w/PPI packer set @3976'. RU Rising Star and pump 3300 gal of 15% PAD acid in 3 settings. Flush w/30 bbl 10# brine. RD Rising Star. RU pump truck and pump scale squeeze w/200 bbl flush. RD pump truck. POOH w/PPI packer.
8. RIH w/ESP equipment set on 119 jts of 2-7/8" tubing. Intake set @3975'.
9. ND BOP/NU wellhead.
10. RDPU & RU. Clean location and return well to production.

RUPU 08/22/2013 RDPU 08/28/2013

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 09/18/2013

TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy_johnson@oxv.com TELEPHONE NO. 806-592-6280

For State Use Only


APPROVED BY [Signature] TITLE Dist. Mgr DATE 9-23-20

CONDITIONS OF APPROVAL IF ANY:

SEP 23 2013

September 17, 2013

Work Plan Report for Well:NHSAU 412-24

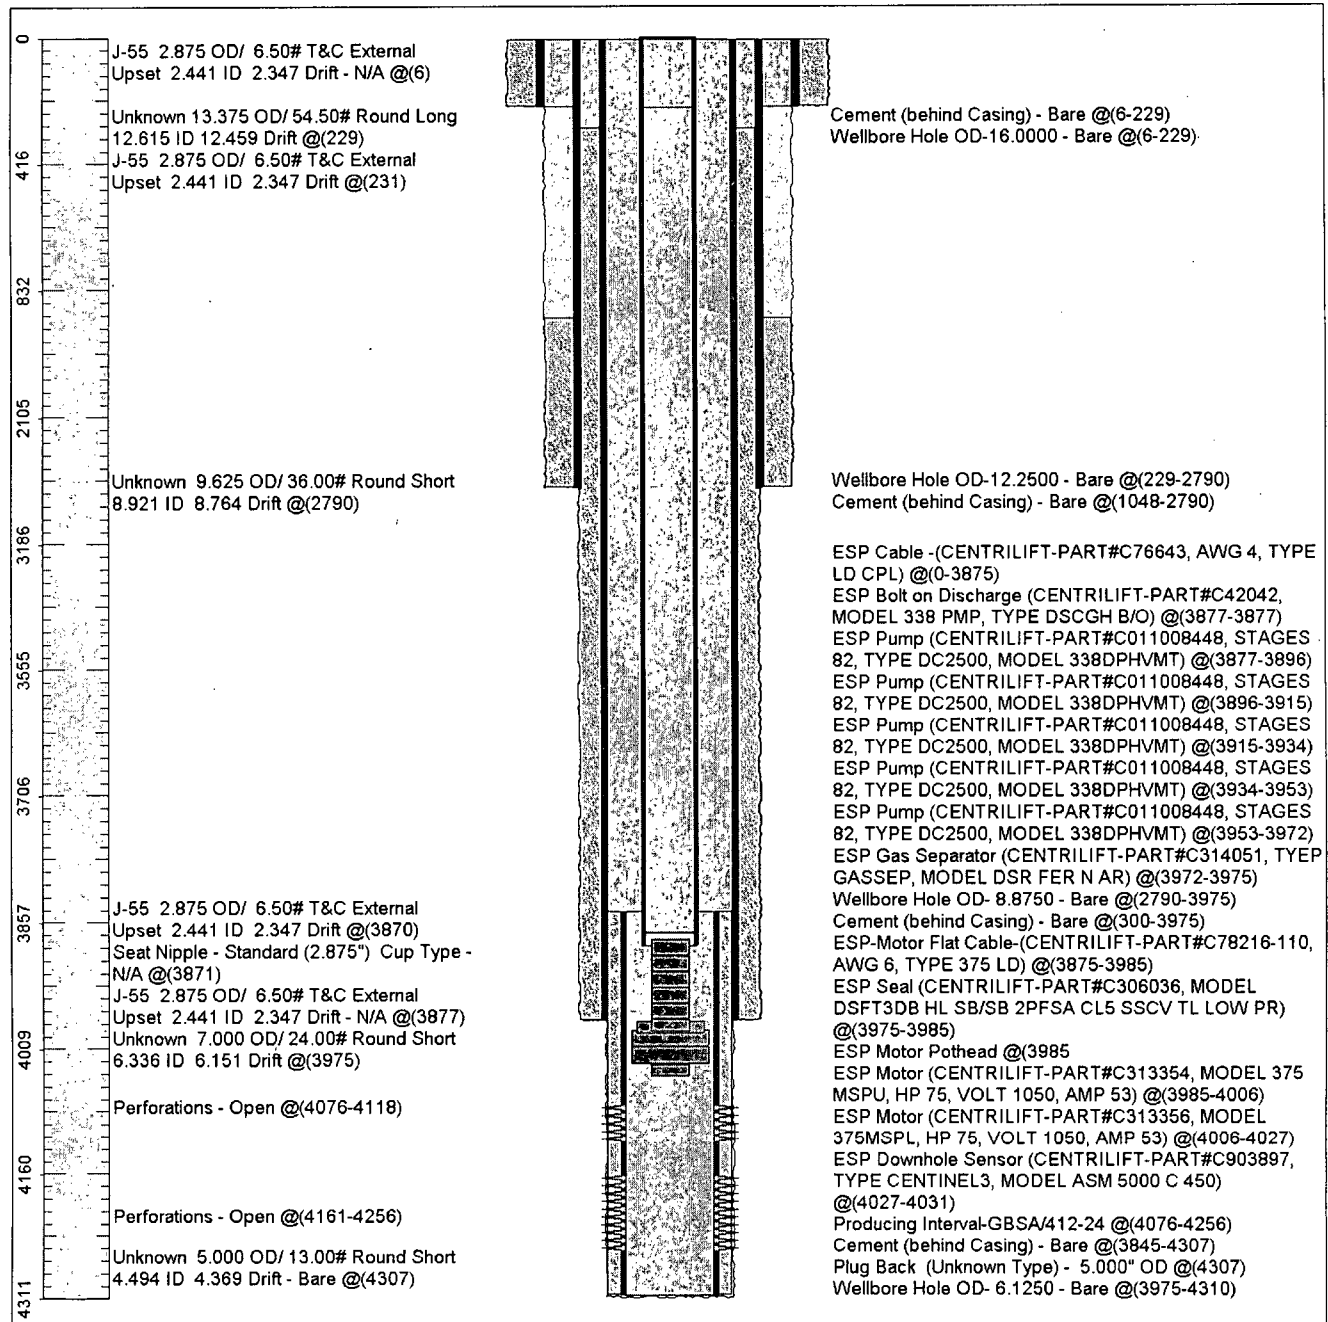

Survey Viewer