

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

HOBBS OCD **OIL CONSERVATION DIVISION**

1220 South St. Francis Dr.
Santa Fe, NM 87505

FEB 28 2014

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)		WELL API NO. 30-025-07360
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Occidental Permian Ltd.		6. State Oil & Gas Lease No.
3. Address of Operator HCR 1 Box 90 Denver City, TX 79323		7. Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 19
4. Well Location Unit Letter <u>G</u> : <u>2310</u> Feet From The <u>North</u> Line and <u>2310</u> Feet From The <u>East</u> Line Section <u>19</u> Township <u>18-S</u> Range <u>38-E</u> NMPM <u>Lea</u> County		8. Well No. <u>321</u>
11. Elevation (Show whether DF, RKB, RTGR, etc.) 3662' GL		9. OGRID No. <u>157984</u>
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____		10. Pool name or Wildcat <u>Hobbs (G/SA)</u>

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☒
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: _____	PLUG & ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: _____

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
1. RUPU & RU.
 2. RU wire line & shoot drain holes @4055'. RD wire line.
 3. ND wellhead/NU BOP.
 4. POOH and lay down ESP equipment.
 5. RIH w/bit & drill collars. Tag @4300'. NU stripper head & power swivel. Clean out frac sand from 4300-4315'. Drill on new formation from 4315-4340'. RD power swivel & stripper head. POOH w/bit & drill collars.
 6. RIH w/treating packer. Set @4122'. RU acid trucks and pump 6000 gal of 15% PAD acid w/2000# rock salt block. RD acid trucks. RU pump truck and pump 100 bbl scale squeeze. Flush w/200 bbl 10# brine. RD pump truck.
 7. Had to rig down pulling unit and change out rig due to issues with rig.
 8. RU PU & RU.
 9. POOH w/treating packer.

see attached sheet for additional data

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or

closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 02/27/2014
TYPE O-R PRINT NAME Mendy A. Johnson E-mail address: mendy_johnson@oxv.com TELEPHONE NO. 806-592-6280

For State Use Only
APPROVED BY Mark White TITLE Compliance Officer DATE 03/07/2014
CONDITIONS OF APPROVAL IF ANY:

MAR 10 2014

NHU 19-321 API #30-025-07360


10. RIH w/ESP equipment set on 128 jts of 2-7/8" tubing. Intake set @4127'.
11. ND BOP/NU wellhead.
12. RDPU & RU. Clean location and return well to production.

RUPU 01/16/2014

RDPU 01/25/2014

February 26, 2014

Work Plan Report for Well:NHSAU 321-19

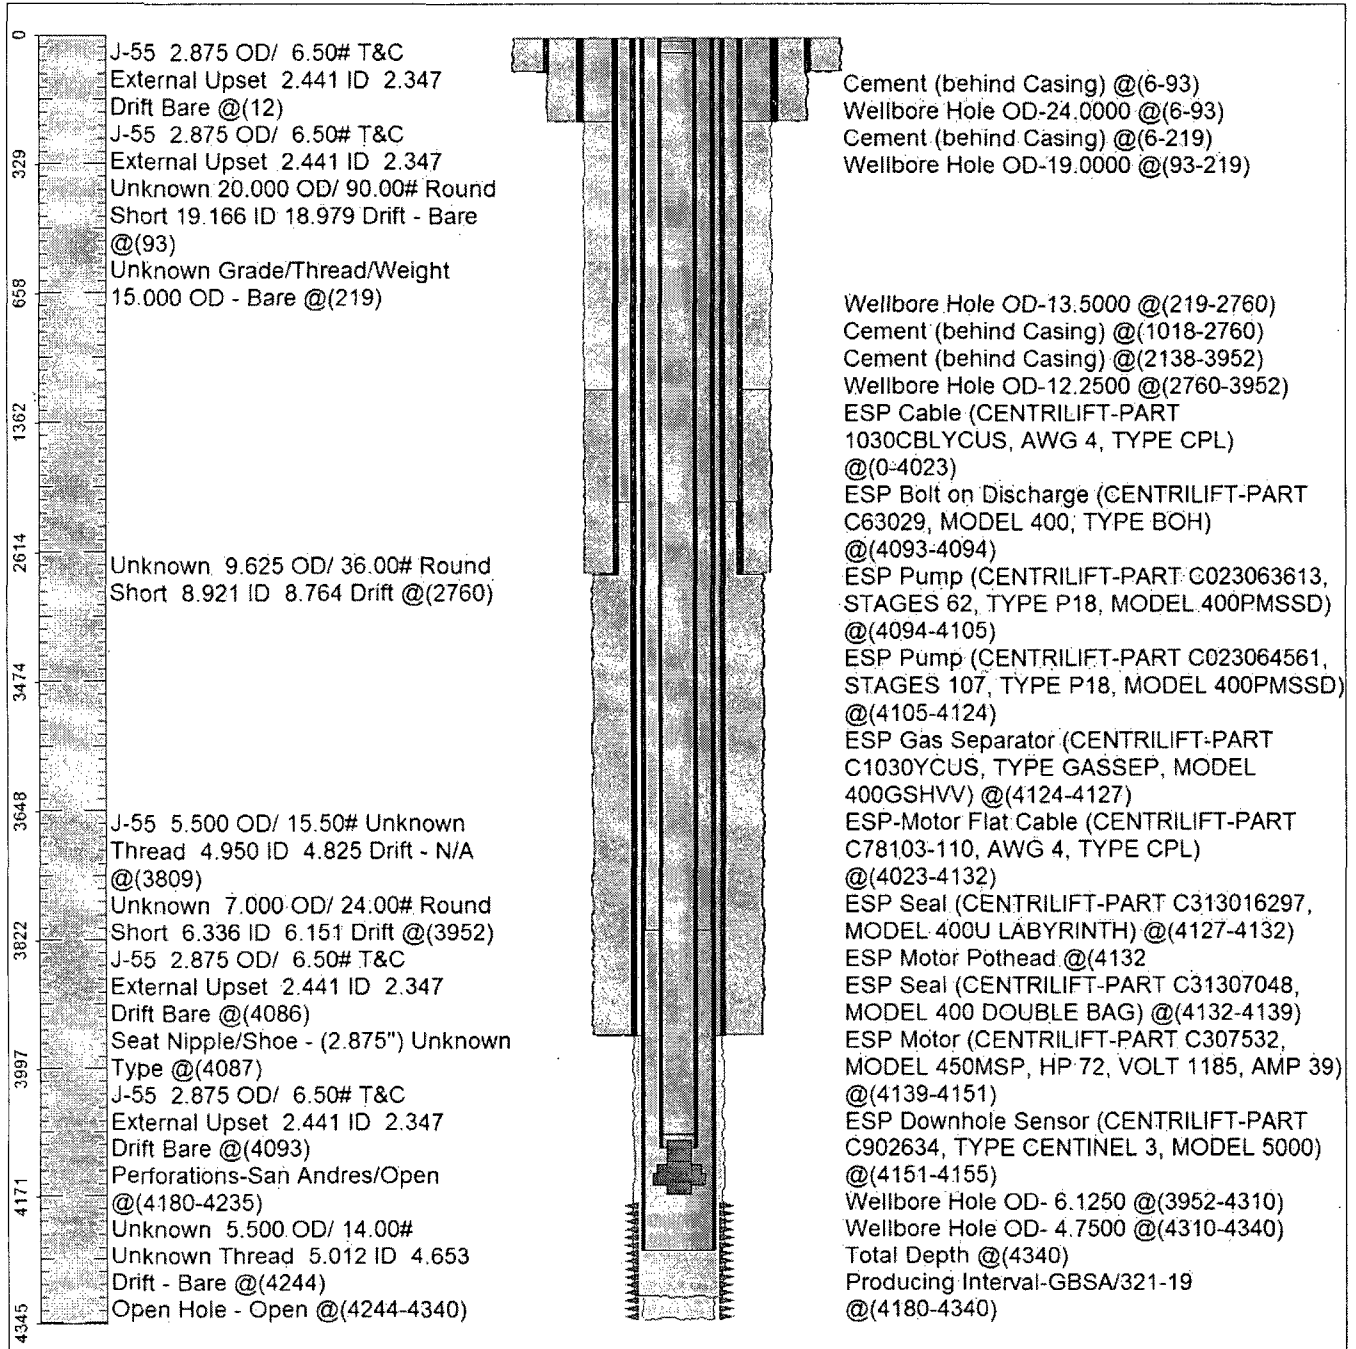

Survey Viewer