

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico

Energy, Minerals and Natural Resources

Form C-103

June 19, 2008

HOBBS OCD

APR 02 2014

RECEIVED

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO.

30-025-39986

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

West Blinbry Drinkard Unit (WBUD)

8. Well Number 121

9. OGR/D Number

873

10. Pool name or Wildcat

Eunice; Bli-Tu-Dr, North (22900)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: ☒ Oil Well ☐ Gas Well ☐ Other:

2. Name of Operator

Apache Corporation

3. Address of Operator

303 Veterans Airpark Lane, Suite 3000 Midland, TX 79705

4. Well Location

Unit Letter P : 330 feet from the South line and 1310 feet from the East line

Section 17 Township 21S Range 37E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

3476' GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

DOWNHOLE COMMINGLE ☐

OTHER: COMPLETE & FRAC BLINBRY

☒

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ P AND A ☐

CASING/CEMENT JOB ☐

OTHER:

☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Apache intends to complete and fracture stimulate the Blinbry, per the attached procedure.

Spud Date: 01/01/2011

Rig Release Date: 01/10/2011

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Reesa Fisher

TITLE Sr Staff Reg Analyst

DATE 03/28/2014

Type or print name Reesa Fisher

E-mail address: Reesa.Fisher@apachecorp.com

PHONE: 432/818-1062

For State Use Only

APPROVED BY:

Mary Brown

TITLE

Compliance Officer

DATE

4/3/2014

Conditions of Approval (if any):

APR 03 2014

WBDU 121 (API: 30-025-39986) Proposed Procedure: Complete and Fracture Stimulate the Blinebry**March 28, 2014****Day 1:** MIRU. POOH w/ rods and pump. Install BOP. POOH w/ 2-7/8" tubing**Day 2:** MIRU WL. RIH & correlate depths to openhole logs

Set CBP @ +/-5905'. PUH & perforate the Blinebry as per the attached sheet w/3-1/8" slick guns loaded w/ Owen TAG-3375-311L charges @ 1 SPF, 180 deg phasing (total 30 ft, 30 shots). POOH & RD WL

PU & RIH w/ treating packer on 2-7/8" tubing to +/-5500'


Day 3: MIRU pump trucks. Set packer @ +/-5500' and P/T casing to 4,200 psi

Acidize the Blinebry with 3,000 gals 15% HCl and ball sealers @ +/-10 BPM. Release packer and run through perms to knock off balls. POOH w/ tubing

Day 4: RU frac equipment. Frac the Blinebry w/200,000 lbs 20/40 proppant down 5-1/2" casing @ +/- 50 BPM (pressure permitting, max pressure is 4,200 psi) in 25# XL gel as per frac recommendation. RD frac equipment**Day 5:** PU & RIH w/ 4-3/4" bit on 2-7/8" tubing. Clean well out to CBP. Drill out CBP. Continue to clean well out and circulate clean**Day 6:** RIH w/SN and 2-7/8" production tubing. RIH w/ 1-1/2" pump and rods. Return well to production. Place well in test

WBDU 121 Blinebry Perforations						
Guns: 3-1/8" slick guns w/ Owen TAG-3375-311L Charges						
Stage	Zone	Top	Bottom	Feet	SPF	Shots
1	Blinebry	5547	5548	2	1	2
1	Blinebry	5563	5564	2	1	2
1	Blinebry	5579	5580	2	1	2
1	Blinebry	5594	5595	2	1	2
1	Blinebry	5605	5606	2	1	2
1	Blinebry	5636	5637	2	1	2
1	Blinebry	5641	5642	2	1	2
1	Blinebry	5651	5652	2	1	2
1	Blinebry	5656	5657	2	1	2
1	Blinebry	5707	5708	2	1	2
1	Blinebry	5724	5725	2	1	2
1	Blinebry	5788	5789	2	1	2
1	Blinebry	5820	5821	2	1	2
1	Blinebry	5829	5830	2	1	2
1	Blinebry	5845	5846	2	1	2
1	Blinebry	5855	5856	2	1	2
1	Blinebry	5871	5872	2	1	2

WBDU 121: Current Wellbore Diagram

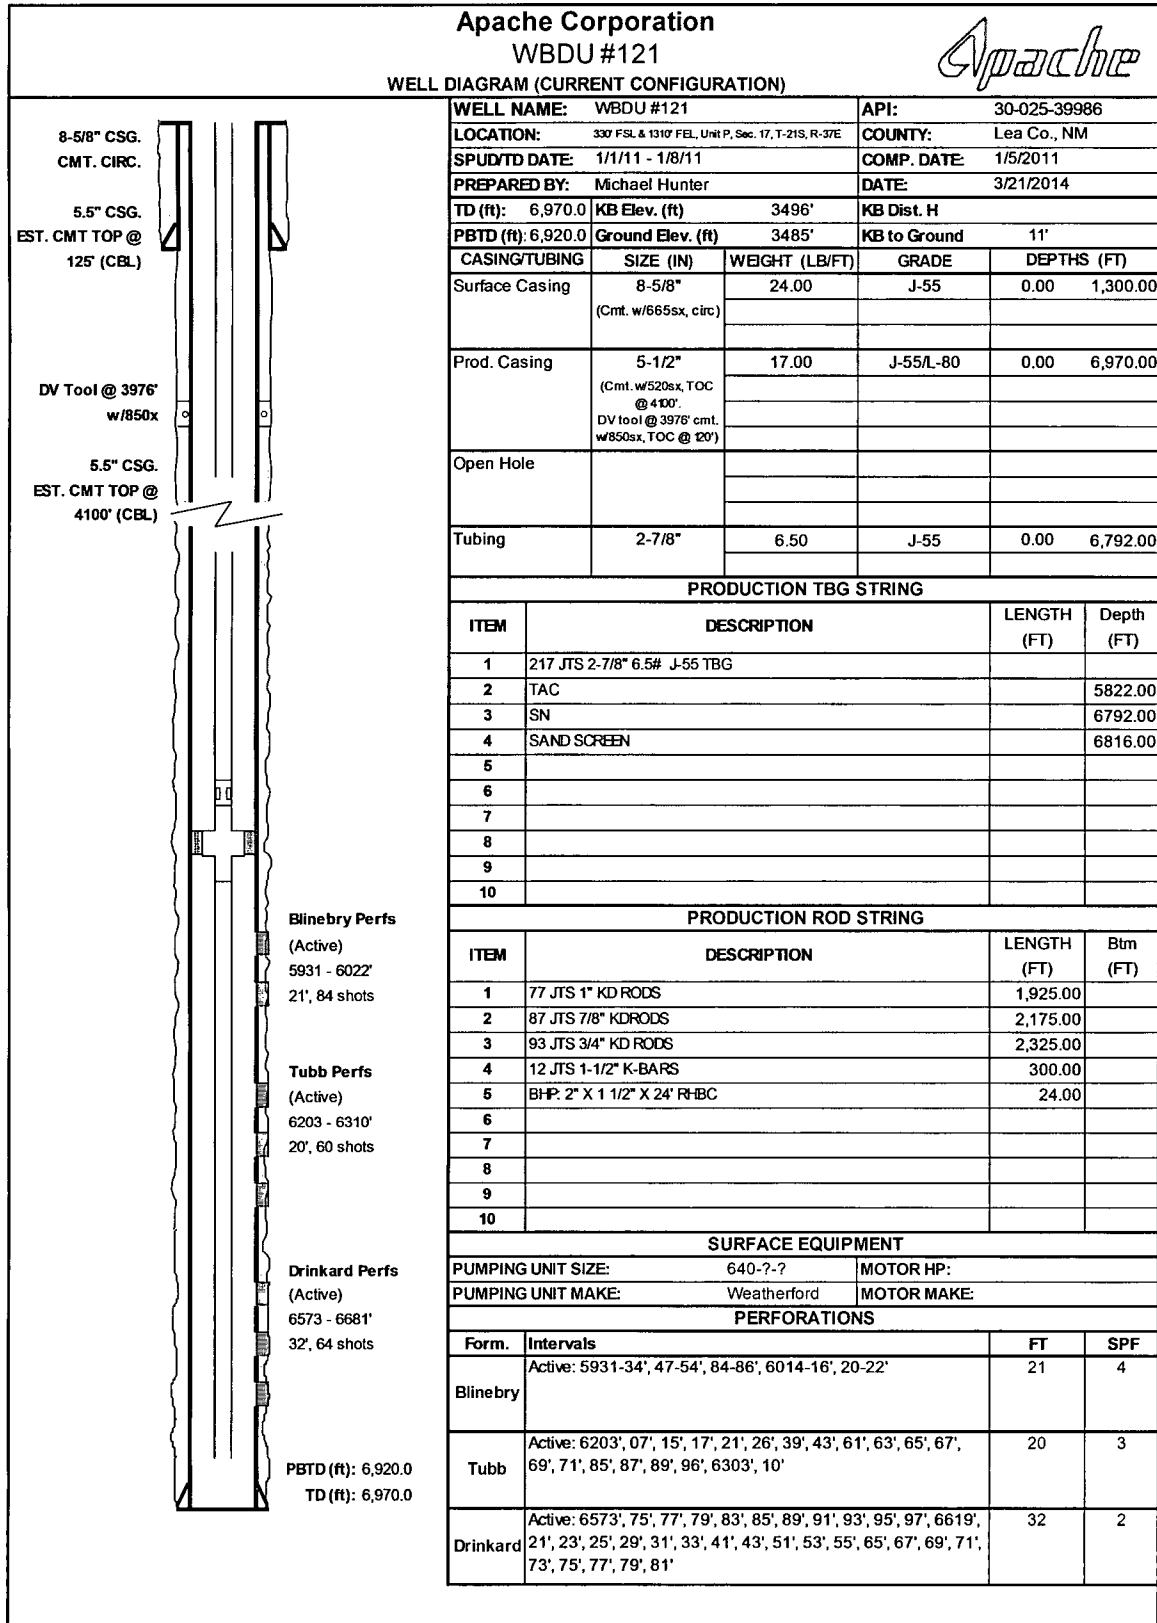

WBDU 121: Proposed Wellbore Diagram

