

FILE IN TRIPLICATE

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240

DISTRICT II
1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

RECEIVED

WELL API NO. 30-025-41550	
5. Indicate Type of Lease STATE ☒ FEE ☐	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 18	
8. Well No.	946
9. OGRID No.	157984
10. Pool name or Wildcat	Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator Occidental Permian Ltd.	
3. Address of Operator HCR 1 Box 90 Denver City, TX 79323	
4. Well Location Unit Letter <u>O</u> : <u>1104</u> Feet From The <u>South</u> Line and <u>1670</u> Feet From The <u>East</u> Line Section <u>18</u> Township <u>18-S</u> Range <u>38-E</u> NMPM Lea County	
11. Elevation (Show whether DF, RKB, RT GR, etc.) 3678' KB	
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ Multiple Completion ☐ OTHER: _____ ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER: <u>Initial completion</u> ☒

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
1. RUPU & RU.
 2. ND wellhead/NU BOP.
 3. RIH w/bit. Tag @3620'. RU power swivel & drill cement from 3620-3666'. Drill out DV tool @3666'. Circulate clean. RD power swivel. Continue in hole w/bit. Tag @4503'. POOH w/bit.
 4. RU wire line and perforate hole @4221-27', 4232-40', 4272-93', 4302-18', 4324-42', 4350-57'. RD wire line.
 5. RIH w/SPA packer set @4173'. RU Rising Star and pump 3700 gal of 15% PAD acid in 4 settings. RD Rising Star. RU pump truck and pump scale squeeze with 100 bbl fresh water and 100 gal of 6490 chemical. Flush w/200 bbl fresh water. RD pump truck. POOH w/packer.
 6. RIH w/ESP equipment set on 125 jts of 2-7/8" tubing. Intake set @4139'
 7. ND BOP/NU wellhead.
 8. RDPU & RU. Clean location and turn well over to production.

RUPU 02/24/2014 RDPU 03/01/2014

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 04/07/2014
 TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy.johnson@oxy.com TELEPHONE NO. 806-592-6280


For State Use Only

APPROVED BY [Signature] TITLE Petroleum Engineer DATE APR 14 2014
 CONDITIONS OF APPROVAL IF ANY:

APR 14 2014

April 4, 2014

Work Plan Report for Well:NHSAU 946-18

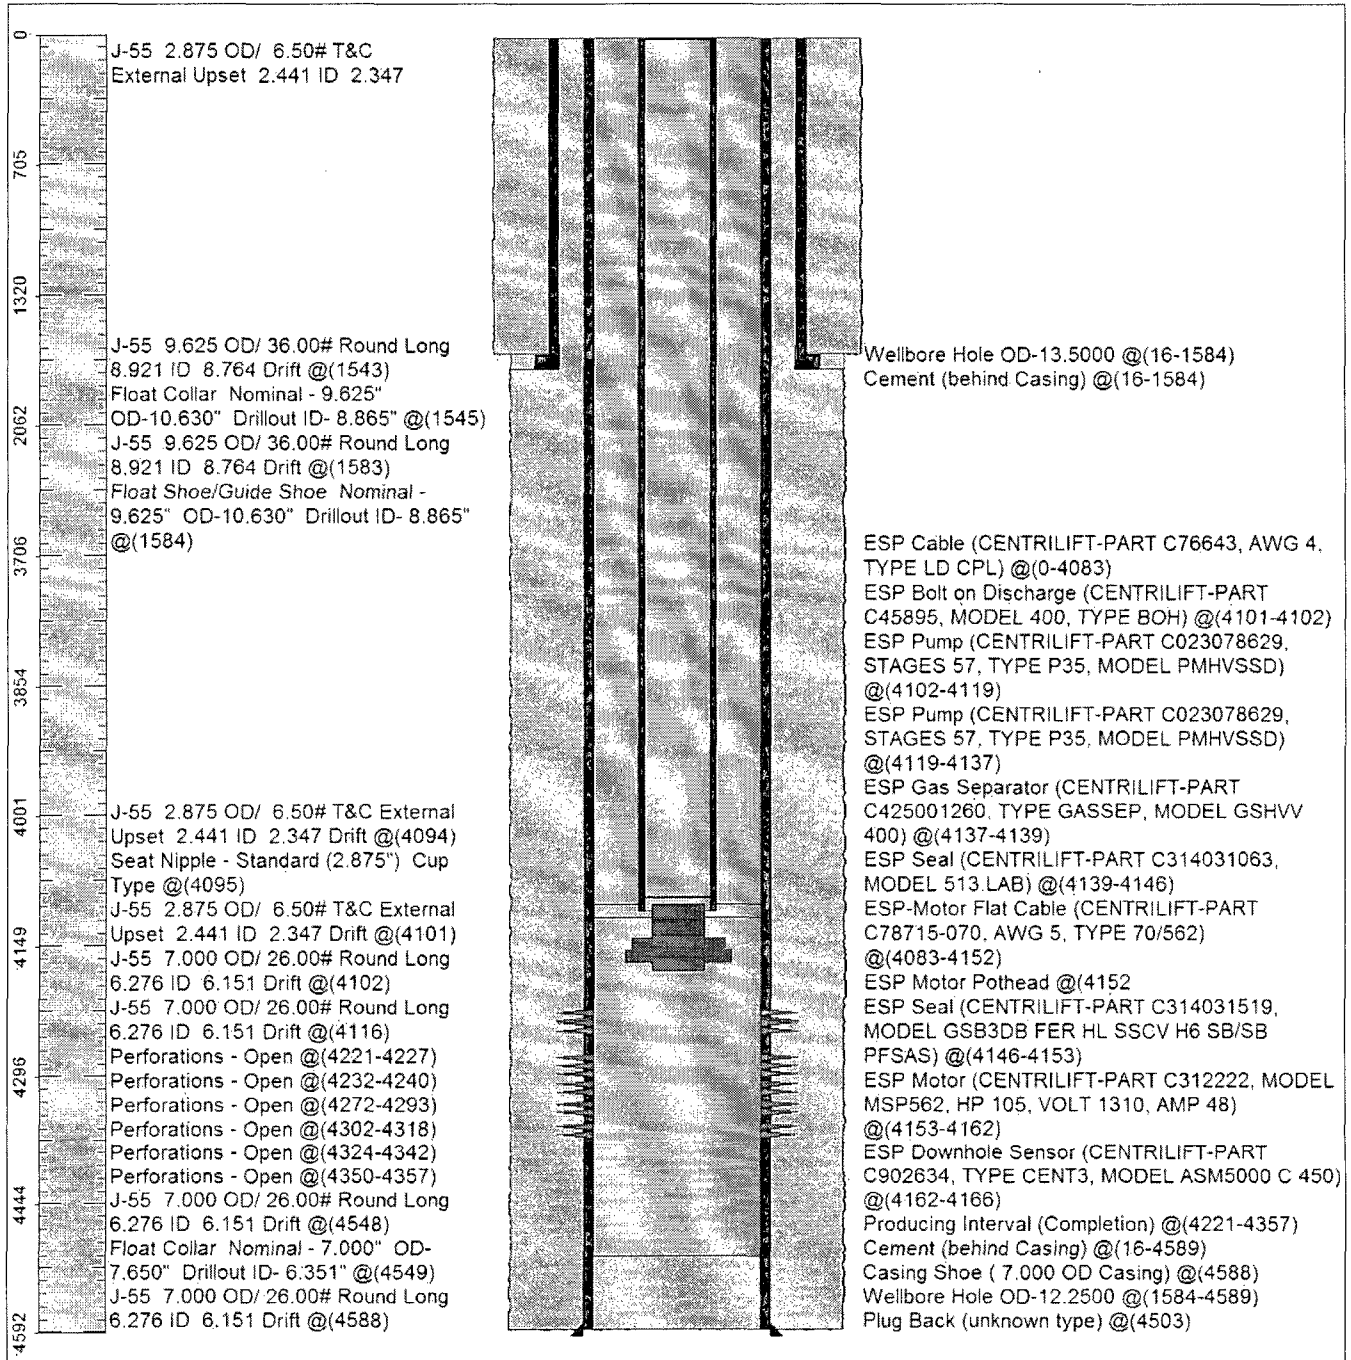

Survey Viewer