

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED
OMB No. 1004-0135
Expires July 31, 1996

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or reenter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

APR 11 2014

2. Name of Operator

DC ENERGY, LLC.

3a. Address c/o Mike Pippin LLC

3104 N. Sullivan, Farmington, NM 87401

3b. Phone No. (include area code)

505-327-4573

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

785' FNL & 1980' FWL Unit C
Sec. 33, T25S, R37E

5. Lease Serial No.

LC-054667

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

CROSBY DEEP #4

3

30-025-25985

10. Field and Pool, or Exploratory Area

Upper Fusselman Pool (75520)

AND

Lea County, New Mexico

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize <input type="checkbox"/> Deepen <input type="checkbox"/> Production (Start/Resume) <input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing <input type="checkbox"/> Fracture Treat <input type="checkbox"/> Reclamation <input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair <input type="checkbox"/> New Construction <input type="checkbox"/> Recomplete <input checked="" type="checkbox"/> Other P&A
	<input type="checkbox"/> Change Plans <input checked="" type="checkbox"/> Plug and Abandon <input type="checkbox"/> Temporarily Abandon
	<input type="checkbox"/> Convert to Injection <input type="checkbox"/> Plug Back <input type="checkbox"/> Water Disposal

13. Describe Proposed or Completed Operations (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomple horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once Testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

DC ENERGY would like to P&A this Upper Fusselman oil well as follows: **MIRUSU. Plug #1, 8562'-7850', Upper Fusselman perfs 8612'-96', top of Fusselman @ 8580, & top of Devonian @ 7900'.** Set 5-1/2" CIBP @ 8562' & top w/110 sx (972') cmt. TOH. WOC. Tag cmt. W/tbg @ TOC, circ hole w/P&A mud (25 sx gel/100 bbls water). **Plug #2, 5465'-5005', Top of Glorieta @ 5055' & DV Tool @ ???.** Pump 25 sx cmt (221') @ 5105'. TOH. WOC. Tag cmt. **Plug #3, 3677'-3777', 8-5/8" csg shoe @ 3727'.** Pump 25 sx cmt (221') @ 3777'. TOH. WOC. Tag cmt. **Plug #4, Top of cmt in 5-1/2"x8-5/8" annulus is 2012' by TS.** Perf 3 sq holes @ 1950' & est rate w/water out 5-1/2"x8-5/8" annulus. W/5-1/2" pkr @ 1800', SQ 5-1/2" csg annulus as required to circ cmt to surface (~300 sx). **Plug #5, 1150'-1050', Top of salt @ 1100'.** Pump 25 sx cmt (221') @ 1150'. TOH. WOC. Tag cmt. **Plug #6, 927'-827', 13-3/8" csg shoe @ 877'.** Pump 25 sx cmt (221') @ 927'. TOH. WOC. Tag cmt. **Plug #7, Top of cmt in 8-5/8"x13-3/8" annulus @ 800' by TS.** Perf 3 SQ holes @ 750' through both 5-1/2" & 8-5/8" csgs. Establish rate w/water out bradenhead. W/5-1/2" pkr @ 550', pump cmt to circ out bradenhead (~270 sx). **Plug #8 (60'-Surface).** W/tbg @ 60', circ cmt to surface in 5-1/2" csg (~7 sx). Cut off csg below surface csg flange. Top off csgs w/cmt. Install P&A marker with cmt to comply with government specs. RD move off location, cut off anchors & restore location.

RECLAMATION PROCEDURE
ATTACHED

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

Mike Pippin mike@pippinllc.com

Title

Petroleum Engineer (Agent)

Signature

Mike Pippin

Date

February 6, 2014

THIS SPACE FOR FEDERAL OR STATE USE

Approved by

James R. Camp

Title

SEPS

Date

4-2-14

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

CAD

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

MAB/OCD 4/16/2014

APR 16 2014

CROSBY DEEP #4

Current - 2/6/14

Fusselman

(C), Section 33, T-25-S, R-37-E, Lea County, NM

Spud: 8/3/78 - M. Pippin
Comp: 10/1/78
Elevation: 3007' GL

17-1/2" Hole

Rustler @ 906'
Salt @ 1100' - Est.

Yates @ 2458'

Queen @ 3100' - Est.

San Andres @ 3600' - Est.

11" Hole to 3800'

Glorieta @ 5055'

Woodford @ 7618'

Devonian @ 7900'

Fusselman @ 8580'

7-7/8" Hole to TD

PBTD = 8894'

TD > 8894'

13-3/8" 72# H-40 @ 877'
700 sx cmt
(Circ. 100 sx cmt to Surf.)

TOC 8-5/8" @ 800' - TS

TOC 5-1/2" @ 2012' - TS

8-5/8" 32# @ 3727'
1050 sx cmt
TOC @ 800' - TS

DV Tool @ ???
2nd Stg - 525 sx cmt
TOC @ 2012' - TS

TOC 5-1/2" @ 5645' calc 75% eff.


Set RBP @ 8712'. Perfed Upper
Fusselman: 8612'-96' in 12/92.

Perfed 8798'-8815' & 8719'-52'.
Sq w/75 sx cmt on 4/14/80.
Drilled out to 8775'. Perfed 8744'-64'

Cmt Ret @ 8837'

Perfed 8863'-85'. Sq w/10 sx cmt.
PB to 8837' 9/22/78

5-1/2" 17&15.5# @ >8894' - 9/4/78
1st Stg - 625 sx cmt

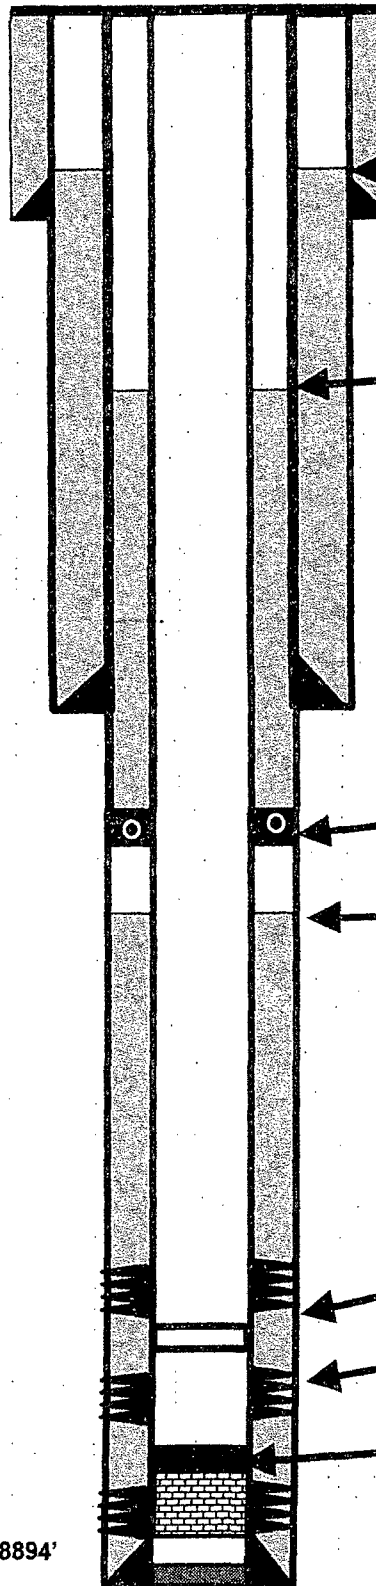

CROSBY DEEP #4

Proposed P&A – 2/6/14

Fusselman

(C), Section 33, T-25-S, R-37-E, Lea County, NM

Spud: 8/3/78 – M. Pippin
Comp: 10/1/78
Elevation: 3007' GL

17-1/2" Hole

Rustler @ 906'

Salt @ 1100' – Est.

Yates @ 2458'

Queen @ 3100' – Est.

San Andres @ 3600' – Est.

11" Hole to 3800'

Glorieta @ 5055'

Woodford @ 7618'

Devonian @ 7900'

Fusselman @ 8580'

7-7/8" Hole to TD

PBTD = 8894'

TD > 8894'

13-3/8" 72# H-40 @ 877'
700 sx cmt. Circ 100 sx.

PLUG #8: 60'-Surface. Circ cmt from 60'.

PLUG #7. TOC outside 8-5/8 @ 800'.
Perf 3 SQ holes @ 750' & SQ cmt to surface.

TOC 8-5/8" @ 800' - TS

PLUG #6. 927'-827', 13-3/8" csq shoe @ 877'. Pump 25 sx cmt @ 927'.

PLUG #5. TOP Salt @ 1100'. Pump 25 sx cmt @ 1150'.

PLUG #4. TOC outside 5-1/2" @ 2112'.
Perf 3 SQ holes @ 1950' & SQ cmt to surface.

TOC 5-1/2" @ 2012' - TS

PLUG #3. 3677'-3777'. Pump 25 sx cmt @ 3777'.

8-5/8" 32# @ 3727'
1050 sx cmt
TOC @ 800' - TS

DV Tool @ ???
2nd Stg - 525 sx cmt
TOC @ 2012' - TS

PLUG #2. 5105'-5005'. Pump 25 sx cmt @ 5101'.

TOC 5-1/2" @ 5645' calc 75% eff.

PLUG #1. 8562'-7850'. Set 5-1/2" CIBP @ 8562' & top w/110 sx cmt.


Set RBP @ 8712'. Perfed Upper Fusselman: 8612'-96' in 12/92.

Perfed 8798'-8815' & 8719'-52'.
Sq w/75 sx cmt on 4/14/80.
Drilled out to 8775'. Perfed 8744'-64'

Cmt Ret @ 8837'

Perfed 8863'-85'. Sq w/10 sx cmt.
PB to 8837' 9/22/78

5-1/2" 17&15.5# @ >8894' – 9/4/78
1st Stg – 625 sx cmt

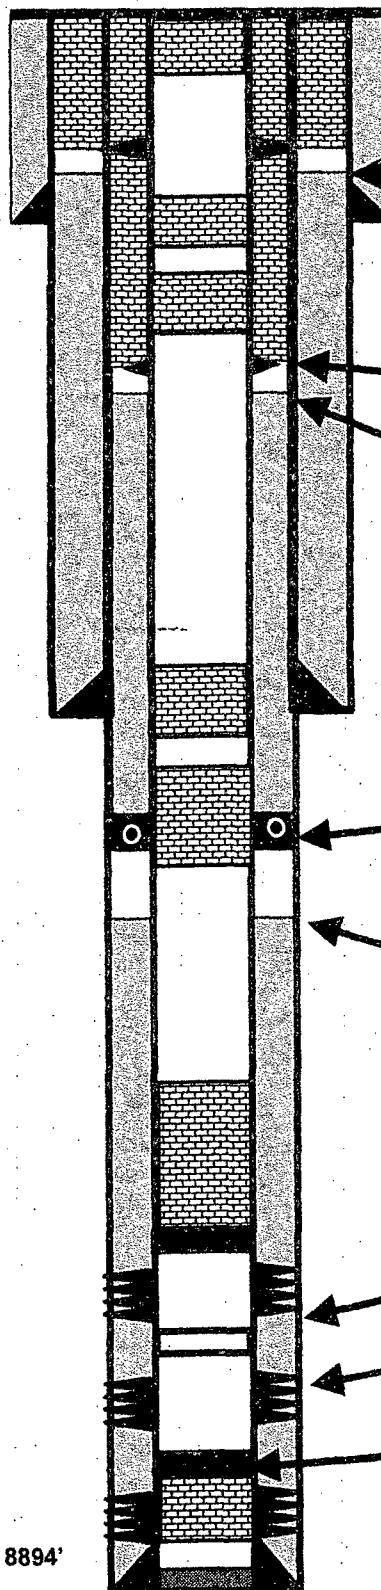

DC Energy, LLC
C/O Mike Pippin LLC
3104 N. Sullivan
Farmington, NM 87401

RE: NMLC054667; Crosby Deep No. 4
785' FNL & 1980' FWL, Sec. 33. T25S-R37E
Lea County, New Mexico

Notice of Intent (NOI) to Plug and Abandon, Changes to NOI:

Plug No. 1, No change

Plug No. 2, 150' plug, Perforate @ 5105', squeeze cement to 4955 (covers top of Glorieta). WOC tag.

Plug No. 3, 227' plug, Spot plug from 3777'-3550' (covers shoe and top of San Andres). WOC tag.

Plug No. 4, 178' plug, Perforate @ 2290', squeeze cement to 2112' (covers base of salt). WOC tag.

Plug No. 5, 230' plug, Perforate @ 1050', squeeze cement to 820' (covers shoe and top of salt). WOC tag.

Plug No. 6, Omit

Plug No. 7, No change

Plug No. 8, No change

If any questions, contact Jim Amos @ 575-234-5909



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office

620 E. Greene St.

Carlsbad, New Mexico 88220-6292

www.blm.gov/nm



In Reply Refer To: 1310

Interim Reclamation Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses.

Interim reclamation consists of minimizing the footprint of disturbance by reclaiming all portions of the well site not needed for production operations. The portions of the cleared well site not needed for operational and safety purposes are recontoured to a final or intermediate contour that blends with the surrounding topography as much as possible. Sufficient level area remains for setup of a workover rig and to park equipment. Topsoil is respread over areas not needed for all-weather operations. Production facilities should be clustered to maximize the opportunity for interim reclamation. In order to inspect and operate the well or complete workover operations, it may be necessary to drive, park, and operate on restored, interim vegetation within the previously disturbed area. This is generally acceptable provided damage is repaired and reclaimed following use.

To reduce final reclamation costs; maintain healthy, biologically active topsoil; and to minimize habitat, visual, and forage loss during the life of the well, all salvaged topsoil should be spread over the area of interim reclamation, rather than stockpiled.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). Interim reclamation is to be completed within 6 months of well completion.
3. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with interim reclamation as per approved APD or Sundry Notice. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
4. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
5. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Environmental Protection Specialist
575-234-5909 (Office), 575-361-2648 (Cell)

Linda Denniston
Environmental Protection Specialist
575-234-5974

Jennifer Van Curen
Environmental Protection Specialist
575-234-5905

Mike Burton
Environmental Protection Specialist
575-234-2226

Jeffery Robertson
Natural Resource Specialist

Solomon Hughes
Natural Resource Specialist
575-234-5951

Douglas Hoag
Civil Engineering Technician
575-234-5979

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

Permanent Abandonment of Federal Wells
Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. **Dry Hole Marker:** All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. **Subsequent Plugging Reporting:** Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. **Trash:** All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.