

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

HOBBS OCD

APR 11 2014

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

WELL API NO. 30-025-41551
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 19
8. Well No. 947
9. OGRID No. 157984
10. Pool name or Wildcat Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator Occidental Permian Ltd.	
3. Address of Operator HCR 1 Box 90 Denver City, TX 79323	
4. Well Location Unit Letter A : 278 Feet From The North Line and 1123 Feet From The East Line Section 19 Township 18-S Range 38-E NMPM Lea County	
11. Elevation (Show whether DF, RKB, RT GR, etc.) 3678' KB	
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG & ABANDONMENT ☐
PULL OR ALTER CASING ☐	Multiple Completion ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: _____		OTHER: Initial completion ☒	

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU & RU.
2. ND wellhead/NU BOP.
3. RIH w/bit. Tag cement @3575'. RU power swivel & stripper head. Drill 39' of cement and drilled out DV tool @3614'. Clean out to 4626'. Circulate well clean. RD power swivel & stripper head. POOH w/bit.
4. RU wire line & perforate casing at 4403-47', 4487-4530', 4544-72'. (472 holes). RD wire line.
5. RIH w/PPI packer set @4304'. RU Warrior and perform PPI acid job with 5000 gal of 15% NEFE acid in 3 stages. RD Warrior. RU pump truck & pump 100 bbl fresh water w/60 gal of 6490 chemical. Flush w/200 bbl 10# brine. POOH w/PPI packer.
6. RIH w/ESP equipment set on 131 jts of 2-7/8" tubing. Intake set @4336'.
7. ND BOP/NU well head.
8. RDPU & RU. Clean location and turn well over to production.

RUPU 03/10/2014 RDPU 03/14/2014

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 04/10/2014

TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy_johnson@oxy.com TELEPHONE NO. 806-592-6280

For State Use Only


APPROVED BY [Signature] TITLE Petroleum Engineer DATE 05/20/14

CONDITIONS OF APPROVAL IF ANY:

MAY 20 2014

April 9, 2014

Work Plan Report for Well:NHSAU 947-19

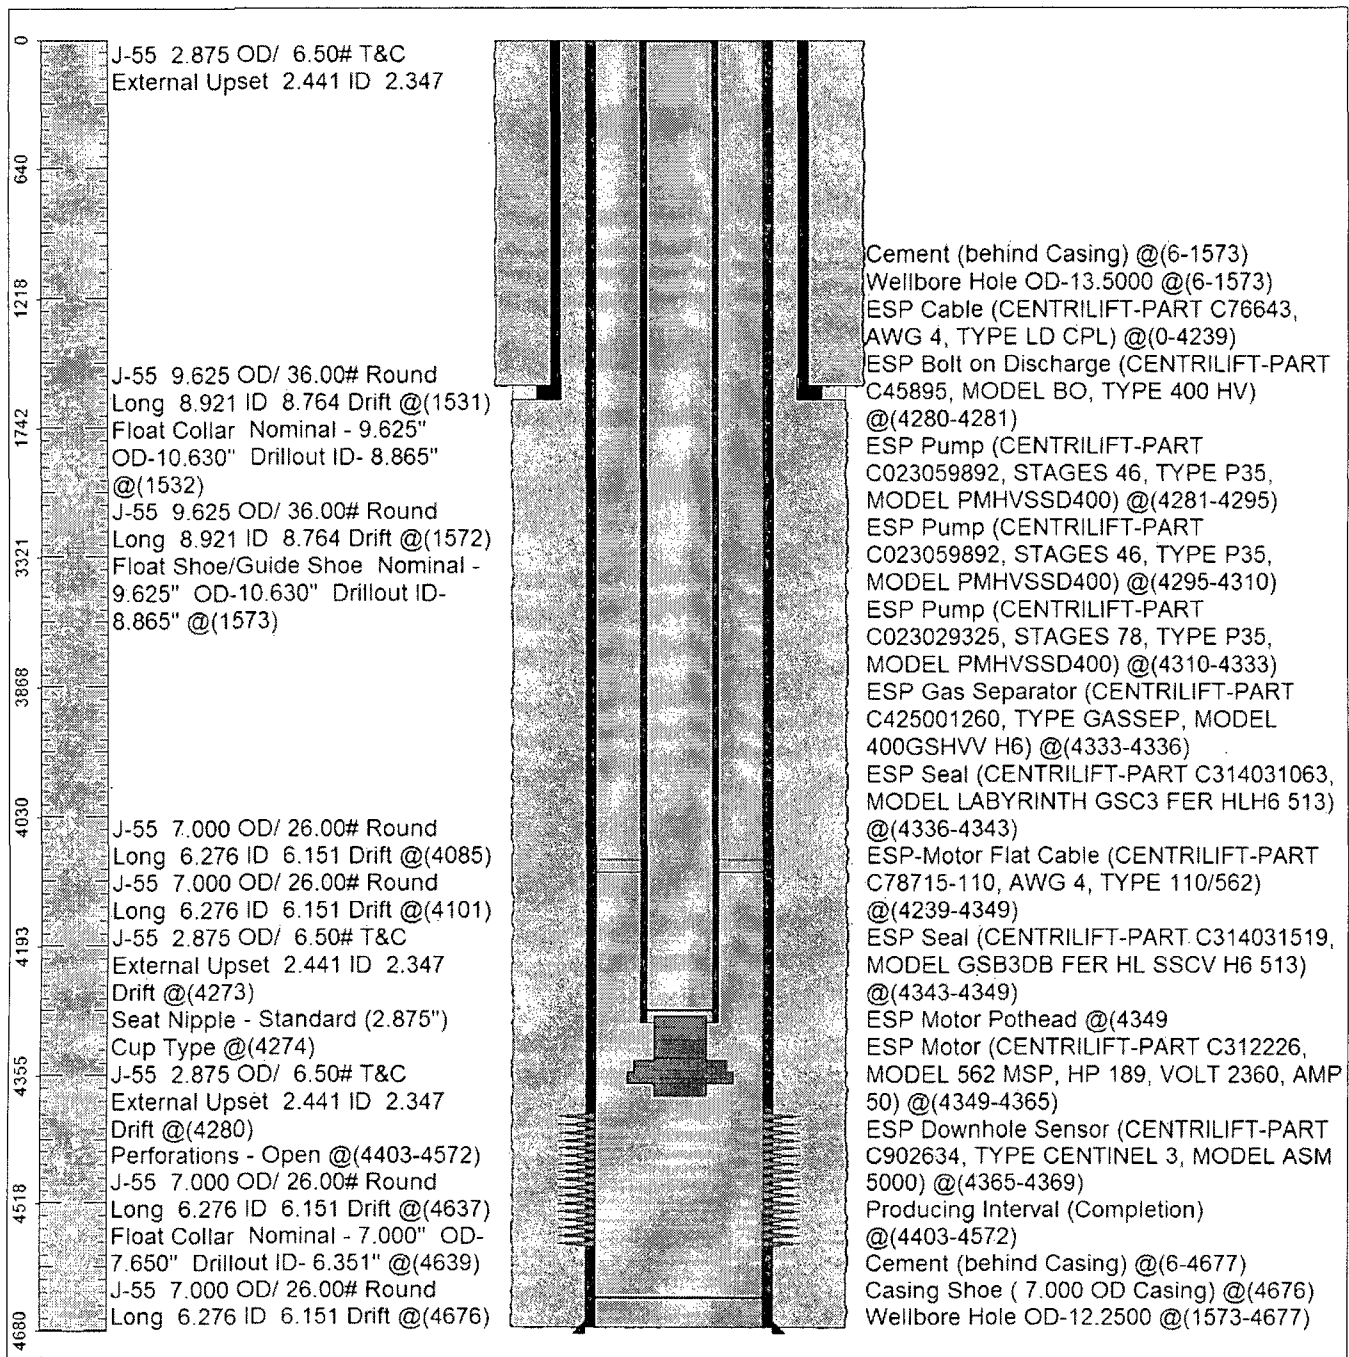

Survey Viewer