

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-005-01103
5. Indicate Type of Lease STATE [ ] FEE [x]
6. State Oil & Gas Lease No. 303737
7. Lease Name or Unit Agreement Name WEST CAP QUEEN SAND UNIT
8. Well Number 13
9. OGRID Number 240974
10. Pool name or Wildcat CAPROCK QUEEN

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)
1. Type of Well: Oil Well [x] Gas Well [ ] Other [ ]
2. Name of Operator LEGACY RESERVES OPERATING LP
3. Address of Operator PO BOX 10848, MIDLAND, TX 79702
4. Well Location Unit Letter A : 660 feet from the NORTH line and 660 feet from the EAST line
Section 20 Township 14S Range 31E NMPM County CHAVES
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK [ ] PLUG AND ABANDON [x]
TEMPORARILY ABANDON [ ] CHANGE PLANS [ ]
PULL OR ALTER CASING [ ] MULTIPLE COMPL [ ]
DOWNHOLE COMMINGLE [ ]
CLOSED-LOOP SYSTEM [x]
OTHER: [ ]
SUBSEQUENT REPORT OF:
REMEDIAL WORK [ ] ALTERING CASING [ ]
COMMENCE DRILLING OPNS. [ ] P AND A [ ]
CASING/CEMENT JOB [ ]
OTHER: [ ]

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

P&A Procedure:

- 1. RIH and spot 25 sx at 2800'. Wait 4 hours and tag at/above 2700'. Circulate mud to 1910'.
2. RIH w/packer and set. Perforate (4) through tubing at 1910'. Squeeze 40 sx into perforations, WOC and tag at/above 1810'.
3. Circulate hole full of mud and POOH w/packer.
4. Perforate (4) at 1165' and 210'. RIH w/packer and squeeze 40 sx into perforations at 1165', WOC and tag at/above 1065'.
5. POOH w/packer, RIH w/O-E tubing to 260' and circulate 4-1/2" and 4-1/2"-by-8-5/8" full w/minimum 60 sx. POOH w/tubing.
6. Top off casing, RD, clean location. Remove wellheads and set P&A marker.
All plugs Class C w/2% CaCl2. Minimum 9.5 ppg salt mud between all plugs.

Spud Date: [ ]

Rig Release Date: [ ]

I hereby certify that the information above is true and complete to the best of my knowledge and belief:

SIGNATURE Laura Pina TITLE REGULATORY TECH DATE 07/09/2014

Type or print name LAURA PINA E-mail address: lpina@legacylp.com PHONE: 432-689-5200

For State Use Only

APPROVED BY: [Signature] TITLE Dist. Supervisor DATE 7/15/2014

Conditions of Approval (if any)

JUL 16 2014


# LEGACY RESERVES LP

**FIELD:** Caprock  
**LEASE/UNIT:** West Cap Queen Sand Unit  
**COUNTY:** Chaves

**DATE:** 30-Jun-14  
**BY:** MWM  
**WELL:** 13  
**STATE:** New Mexico

Location: 660' FNL & 660' FEL, Sec 20A, T14S, R31E  
 SPUD: 3/56 COMP: 3/56  
 CURRENT STATUS: Producer  
 Original Well Name: Stella Zimmerman (NCT-B) #4

**KB = 4149'**  
**GL =**  
**API = 30-005-01103**

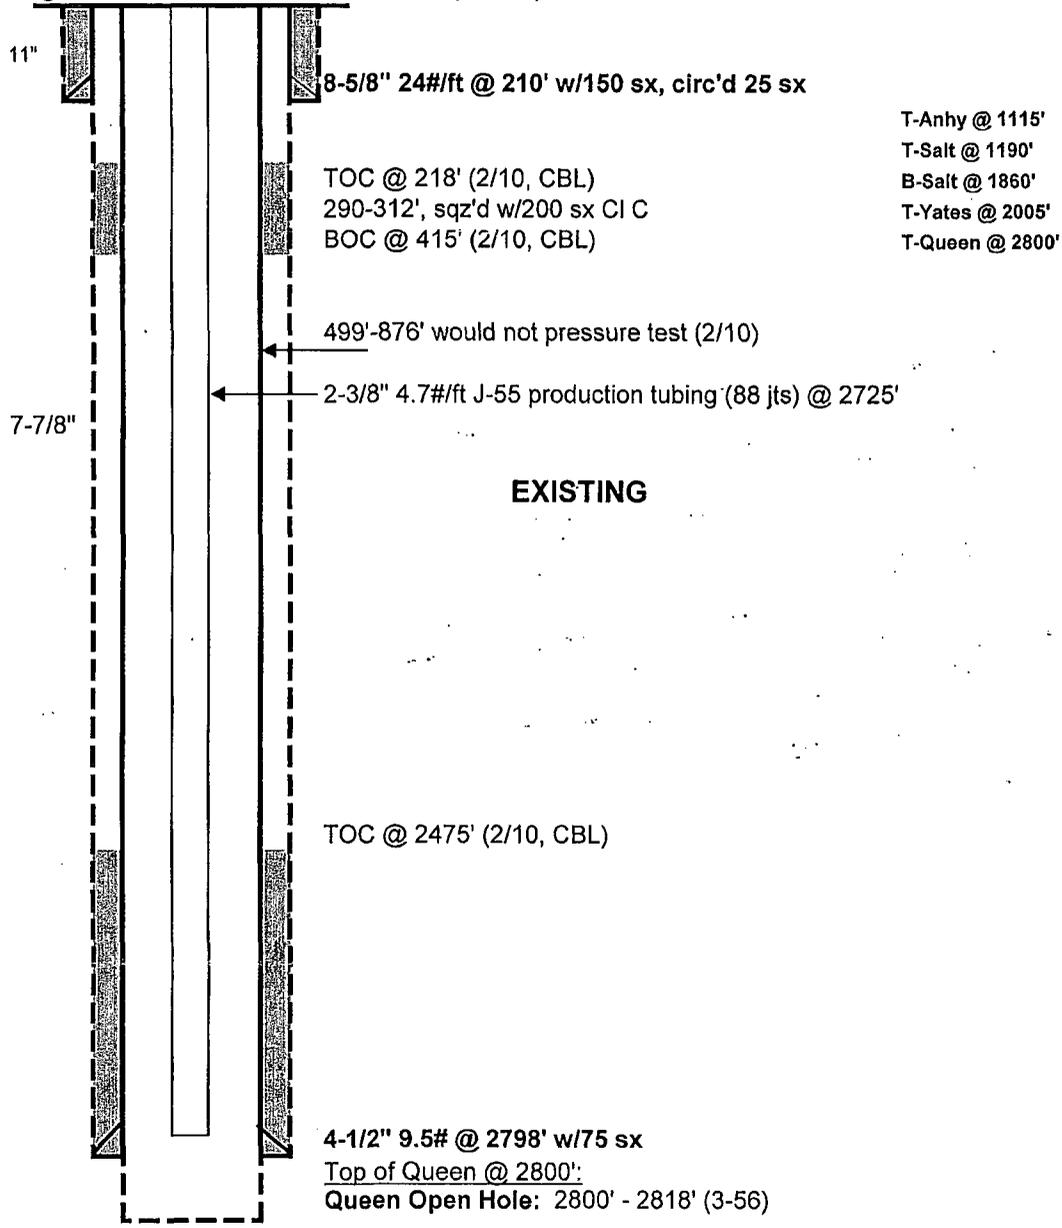

**PBTD - 2818'**  
**TD - 2818'**


# LEGACY RESERVES LP

**FIELD:** Caprock  
**LEASE/UNIT:** West Cap Queen Sand Unit  
**COUNTY:** Chaves

**DATE:** 30-Jun-14  
**BY:** MWM  
**WELL:** 13  
**STATE:** New Mexico

Location: 660' FNL & 660' FEL, Sec 20A, T14S, R31E  
 SPUD: 3/56 COMP: 3/56  
 CURRENT STATUS: Producer  
 Original Well Name: Stella Zimmerman (NCT-B) #4

**KB =** 4149'  
**GL =**  
**API =** 30-005-01103

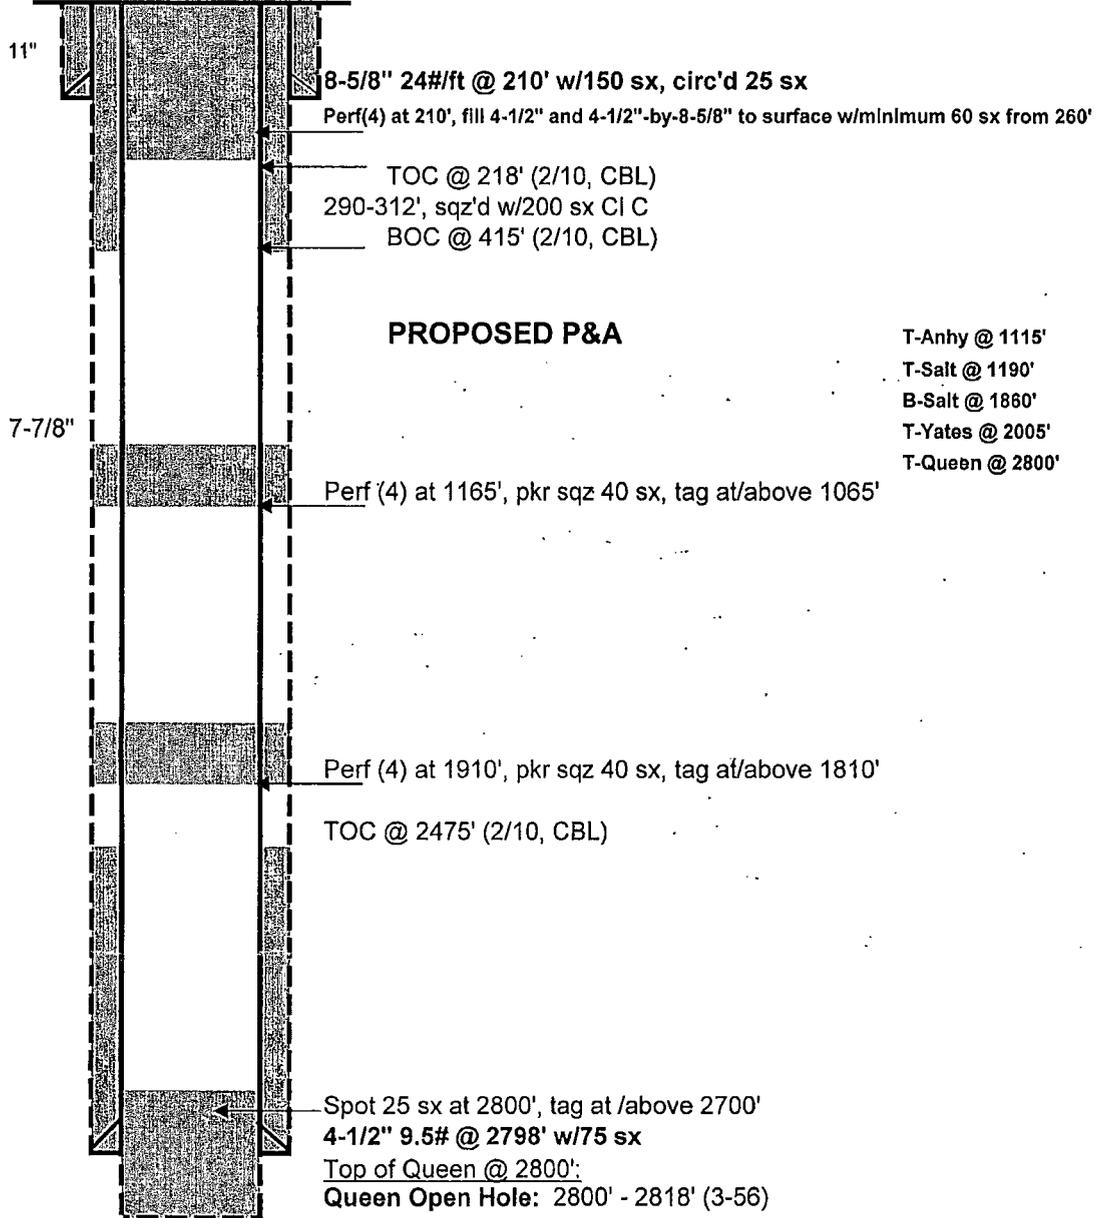

T-Anhy @ 1115'  
 T-Salt @ 1190'  
 B-Salt @ 1860'  
 T-Yates @ 2005'  
 T-Queen @ 2800'

PBTD - 2818'  
 TD - 2818'