

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240

1220 South St. Francis Dr.
Santa Fe, NM 87505

DISTRICT II
1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

WELL API NO. 30-025-30263
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 32
8. Well No. 313
9. OGRID No. 157984
10. Pool name or Wildcat Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-103) for such proposals.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	2. Name of Operator Occidental Permian Ltd.
3. Address of Operator HCR 1 Box 90 Denver City, TX 79323	4. Well Location Unit Letter <u>B</u> : <u>500</u> Feet From The <u>North</u> Line and <u>2370</u> Feet From The <u>East</u> Line Section <u>32</u> Township <u>18-S</u> Range <u>38-E</u> NMPM Lea County
11. Elevation (Show whether DF, RKB, RT GR, etc.) 3639.3' KB	
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐	REMEDIAL WORK ☒ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐
PULL OR ALTER CASING ☐ Multiple Completion ☐	CASING TEST AND CEMENT JOB ☐
OTHER: _____	OTHER: _____

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
1. RUPU & RU.
 2. ND wellhead/NU BOP.
 3. POOH and lay down ESP equipment. Found cable burnt on 1st splice and ESP & tubing was hot w/NORM.
 4. RIH w/bit. Tagged @4295'. POOH w/bit.
 5. RU wire line and perforate well @4152-58', 4236-53', 4260-70' at 4 JSPF. RD wire line.
 6. RIH w/treating packer set @4232'. RU Warrior and pump 1500 gal of 15% PAD acid. Pull packer up to 4010' and perform rock salt job w/3500 gal of acid and 1000# of rock salt. RD Warrior. RU pump truck and pump scale squeeze with 100 bbl of fresh water and 60 gal of 6090 chemical. Flush with 100 bbl of 10# brine water. RD pump truck. POOH w/treating packer.
 7. RIH w/ESP equipment set on 123 jts of 2-7/8" tubing. Intake set @3975'.
 8. ND BOP/NU wellhead.
 9. RDPU & RU. Clean location and return well to production.

RUPU 07/03/2014 RDPU 07/10/2014

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐


SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 09/10/2014
TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy_johnson@oxv.com TELEPHONE NO. 806-592-6280

For State Use Only
APPROVED BY Mary E. Brown TITLE Dist. Supervisor DATE 9/9/2014
CONDITIONS OF APPROVAL IF ANY:

SEP 09 2014

September 4, 2014

Work Plan Report for Well:NHSAU 313-32

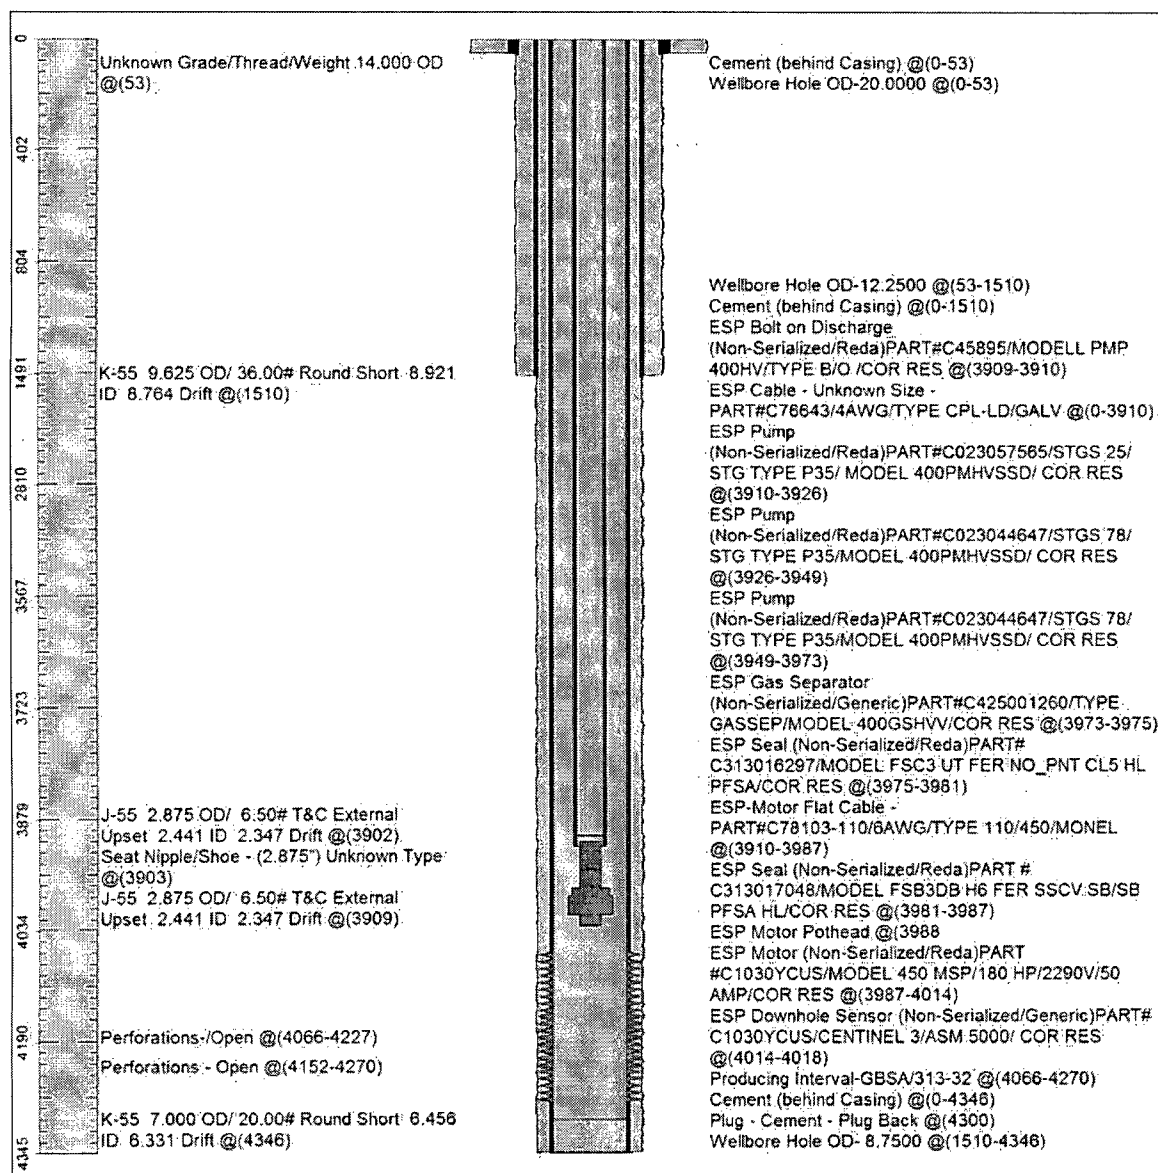

Survey Viewer