

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

HOBBSCOCD

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

FEB 12 2015

5. Lease Serial No. NMLC031621A

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on reverse side.

RECEIVED

If Unit or CA/Agreement, Name and/or No.

1. Type of Well [X] Oil Well [] Gas Well [] Other
2. Name of Operator ENERVEST OPERATING LLC Contact: WILL WHITE
3a. Address 1001 FANNIN STREET SUITE 800 HOUSTON, TX 77002-6708
3b. Phone No. (include area code) Ph: 432-563-3355
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 6 T20S R37E NWSW 2310FSL 660FWL
8. Well Name and No. BRITT A-6 03
9. API Well No. 30-025-05939-00-S2
10. Field and Pool, or Exploratory MONUMENT
11. County or Parish, and State LEA COUNTY, NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

Table with 2 columns: TYPE OF SUBMISSION and TYPE OF ACTION. Includes checkboxes for Notice of Intent, Subsequent Report, Final Abandonment Notice, Acidize, Deepen, Production (Start/Resume), Water Shut-Off, etc.

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recomplate in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

- 1) MIRU. POOH W/ PROD EQUIP
2) Set CIBP @ 5,113'. Tag BP w/ tbg. Circ hole w/ MLF.
3) Spot 25sx cmt @ 5,113' to 5,013' 150' Plug.
4) Spot 25sx cmt @ 3,707' to 3,607' 140' Plug
5) Spot 25sx cmt @ 2,300' to 2,200' WOC-Tag 2170'
6) Perf @ 342' - Sqz 40sx cmt, disp TOC to 242'. WOC-Tag
7) Perf @ 60' - Circ 20sx cmt to surface in all casings
8) RDMO. Cut off WH & anchors. Install P&A marker

RECLAMATION PROCEDURE ATTACHED

SEE ATTACHED FOR CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct. Electronic Submission #287934 verified by the BLM Well Information System For ENERVEST OPERATING LLC, sent to the Hobbs Committed to AFMSS for processing by JIM AMOS on 01/31/2015 (15JA0084SE) Name: WILL WHITE Title: AGENT Date: 01/14/2015

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By: James R. [Signature] Title: SPET Date: 2-3-15 Office: CFD

E-PERMITTING P&A NR INT to PA P&A R DHC COMP CSNG CHG Loc TA RBDMS

crime for any person knowingly and willfully to make to any department or agency of the United to any matter within its jurisdiction.

** BLM REVISED ** BLM REVISED ** BLM REVISED **

WMB/OCD 2/16/2015

FEB 17 2015


Well Name: Britt A-6 #3 Plantation ID Number: 5371
 Location: 2310' FSL & 660' FWL Sec: 6-L Township: 20S
 County: Lea State: NM API: 30-025-05939

Lease Type: Federal
 Range: 37E
 Formation: Monument Blinetry

Surface Csg
 Size: 10-3/4"
 Wt.&Thrd: 29#
 Grade: _____
 Set @: 292'
 Sxs cmt: 250 sx
 Circ: Yes
 TOC: _____
 Hole Size: _____

Intermediate Csg 1
 Size: 7-5/8"
 Wt.&Thrd: 26.4#
 Grade: _____
 Set @: 2529'
 Sxs Cmt: 870 sx
 Circ: Yes
 TOC: _____
 Hole Size: _____

Production Csg
 Size: 5-1/2"
 Wt.&Thrd: 14# & 15.5#
 Grade: _____
 Set @: 5769'
 Sxs Cmt: 365 sx
 Circ: _____
 TOC: 2250'
 Hole Size: 6-3/4"

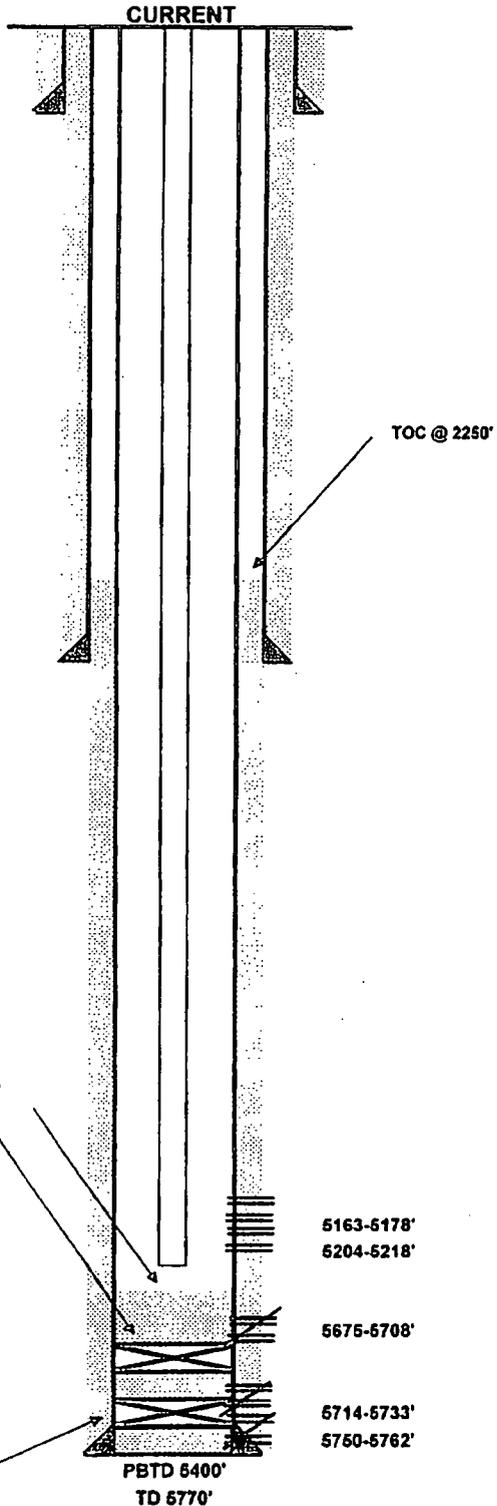

KB: 3574'
 DF: _____
 GL: 3564'
 Spud Date: 7/20/1950
 Compl. Date: 9/14/1950

History - Highlights

7/20/1950: Spud well 7/20/1950. Drill to TD 5770'. Ran 4 DST's. Cmt 5-1/2" csg. Perf'd 5750-5762'. Swabbed. Set CICR at 5749'. Sqzd 5750-5765' w/25 sx. PBTD at 5741'. Perf'd 5675-5678', 5682-5698', 5704-5708', 5714-5733'.
 9/13/1956: Set CICR @ 5713'. Sqz perms 5714-5733' w/24 sx.
 2/18/1972: Pressure tested csg (O-5655'). Tested okay.
 7/11/1972: Well uneconomical - Shut In.
 4/6/1994: Spot cmt plug from 4026-5228'. Spot cmt plug from 2565-3963'. Tested csg to 500 psi. Well T&A'd.
 10/19/2005: Tested csg to 700 psig from 0 - 2565'. Test okay.
 12/14/2006: RIH and drill out cmt from 2545-5400'. Run logs. Perf well from 5163-5178' w/32 holes, 2 JSPF. Acidized w/82 gals 15% NEFE acid dropping BS. Swabbed well. Perf'd well from 5204-5208 and 5212-5218 w/24 holes 2 SPF. Acidized w/1500 gals 15% NEFE w/50 BS. RIH w/lbg set at 5276'. RIH w/rods and pump, and place well back on prod.

Tubulars - Capacities and Performance							
	bbl/ft	cu/ft	Tensile (lbs)	Burst (psi)	Collapse (psi)	ID (in)	Drift (in)
5-1/2" 14# J-55 Casing	0.02440	0.1370	172000	4270	3120	5.012	4.887
5-1/2" 15.5# J-55 Casing	0.02380	0.1338	229000	4810	4040	4.950	4.825


Well Name: Britt A-6 #3 Plantation ID Number: 5371
 Location: 2310' FSL & 660' FWL Sec: 6-L Township: 20S
 County: Lea State: NM API: 30-025-05939

Lease Type: Federal
 Range: 37E
 Formation: Monument Blinebry

Surface Csg
 Size: 10-3/4"
 Wt.&Thrd: 29#
 Grade: _____
 Set @: 292'
 Sxs cmt: 250 sx
 Circ: Yes
 TOC: _____
 Hole Size: _____

Intermediate Csg 1
 Size: 7-5/8"
 Wt.&Thrd: 26.4#
 Grade: _____
 Set @: 2529'
 Sxs Cmt: 870 sx
 Circ: Yes
 TOC: _____
 Hole Size: _____

Production Csg
 Size: 5-1/2"
 Wt.&Thrd: 14# & 15.5#
 Grade: _____
 Set @: 5769'
 Sxs Cmt: 365 sx
 Circ: _____
 TOC: 2250'
 Hole Size: 6-3/4"

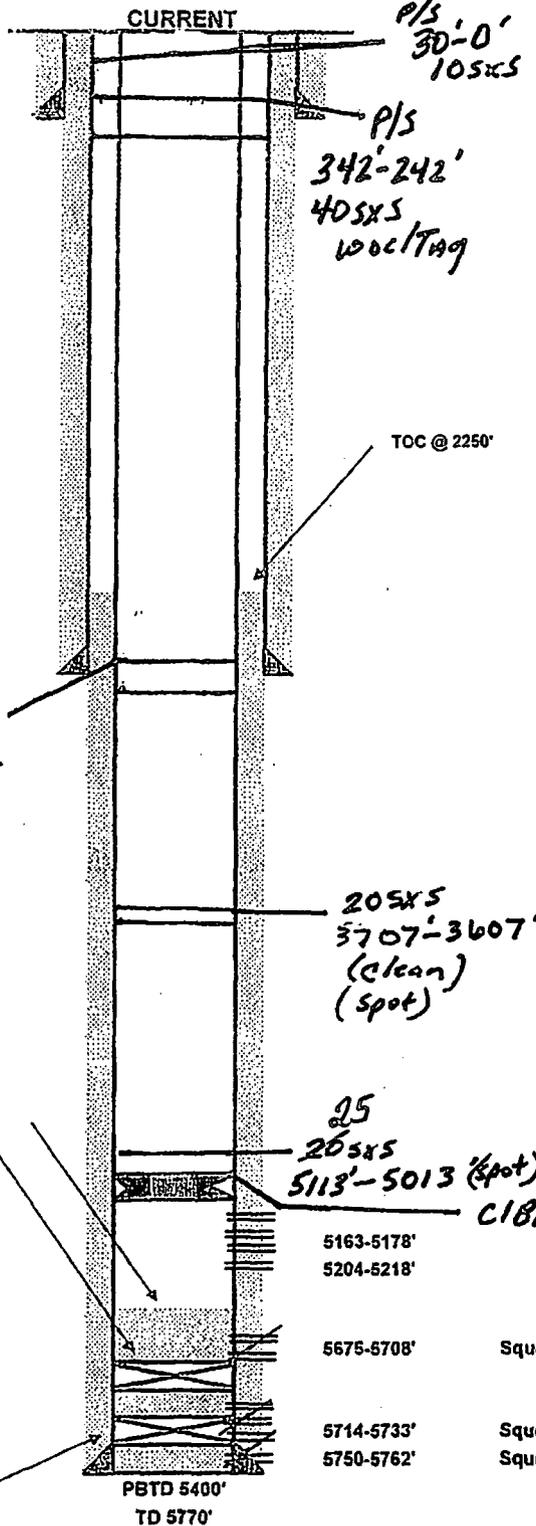

KB: 3574'
 DF: _____
 GL: 3564'
 Spud Date: 7/20/1950
 Compl. Date: 9/14/1950

History - Highlights

7/20/1950: Spud well 7/20/1950. Drill to TD 5770'. Ran 4 DST's. Cmt 5-1/2" csg. Perf'd 5750-5762'. Swabbed. Set CICR at 5749'. Sqzd 5750-5765' w/25 sx. PBTD at 5741'. Perf'd 5675-5678', 5682-5698', 5704-5708', 5714-5733'.
 9/13/1956: Set CICR @ 5713'. Sqz perfs 5714-5733' w/24 sx.
 2/18/1972: Pressure tested csg (O-5655'). Tested okay.
 7/1/1972: Well uneconomical - Shut In.
 4/6/1994: Spot cmt plug from 4026-5228'. Spot cmt plug from 2565-3963'. Tested csg to 500 psi. Well T&A'd.
 10/19/2005: Tested csg to 700 psig from 0 - 2565'. Test okay.
 12/14/2006: RIH and drill out cmt from 2545-5400'. Run logs. Perf well from 5163-5178' w/32 holes, 2 JSPF. Acidized w/82 gals 15% NEFE acid dropping BS. Swabbed well. Perf'd well from 5204-5208 and 5212-5218 w/24 holes 2 SPF. Acidized w/1500 gals 15% NEFE w/50 BS. RIH w/tbg set at 5276'. RIH w/rods and pump, and place well back on prod.

5163-5178'
 5204-5218'
 5675-5708' Squeezed
 5714-5733' Squeezed
 5750-5762' Squeezed

Tubulars - Capacities and Performance							
	bb/ft	cl/ft	Tensile (lbs)	Burst (psid)	Collapse (psid)	ID (in)	Drift (in)
5-1/2" 14# J-55 Casing	0.02440	0.1370	172000	4270	3120	5.012	4.887
5-1/2" 15.5# J-55 Casing	0.02330	0.1336	229600	4810	4040	4.950	4.825

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

Permanent Abandonment of Federal Wells
Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.**

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

J. Amos 3/6/11



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Petroleum Engineering Tech
575-234-5909, 575-361-2648 (Cell)

Cody Layton
Supervisory Multi Resources
575-234-5959

Duncan Whitlock
Environmental Protection Specialist
575-234-5926

Trishia Bad Bear
Natural Resource Specialist
575-393-3612

Linda Denniston
Environmental Protection Specialist
575-234-5974

Jeffery Robertson
Natural Resource Specialist
575-234-2230

Solomon Hughes
Natural Resource Specialist
575-234-5951